



**AGENDA
PUBLIC WORKS/SAFETY COMMITTEE
TUESDAY, JULY 18, 2023
5:30 PM
DESTIN CITY HALL BOARDROOM**

- 1. CALL TO ORDER**
- 2. ROLL CALL/PLEDGE OF ALLEGIANCE**
- 3. APPROVAL OF MINUTES**
 - A) June 13, 2023 Minutes**
 - B) May 9, 2023 Minutes**
- 4. NEW BUSINESS**
 - A) Committee Volunteer Member Training - Sandy Trammell**
 - B) Lamar Advertising Proposal**
 - C) City Mobility Plan Review**
Mobility Plan Update
 - D) Committee Work Plan Review**
 - E) ADA Transition Plan for Pedestrian Facilities, Draft Report and Presentation**
- 5. CONTINUING BUSINESS**
 - A) Stormwater/Floodplain Management, Comments from Public**
 - B) Public Works and Emergency Management Update**
- 6. DISCUSSION**
 - A) Committee Member Discussion and Updates:**
 - A) Jim Wood - Chair**
 - B) John Green - Vice Chair**
 - C) Marcie Bell**
 - D) Sam Perman**
 - E) Curtis Smith**
 - F) John Stephens**
 - G) Tom Weidenhamer**

7. PUBLIC COMMENTS (Comments from the public on any matters considered at the meeting, or on any matters not on the agenda)

Any person requiring a special accommodation at this hearing because of a disability or physical impairment should contact the City Clerk at (850) 837-4242 at least 48 hours prior to the hearing. If a person decides to appeal any decision made with respect to any matter considered at such meeting, such person will need a record of the proceeding and for such purpose may need to ensure that a verbatim record of the proceeding is made, which record includes the testimony and evidence upon which the appeal is to be based. (Sec. 286.0105, Florida Statutes)

DRAFT

**PUBLIC WORKS/PUBLIC SAFETY COMMITTEE
MEETING MINUTES DESTIN CITY HALL BOARDROOM
TUESDAY, JUNE 13, 2023 - 5:30 PM**

1. CALL TO ORDER & PLEDGE OF ALLEGANCE:

Chairman Wood called the Public Works/Public Safety Committee to order on Tuesday, June 13, 2023, at 5:30 p.m.

2. ROLL CALL:

Members Present

James T. Wood, Jr.
John Green
Tom Weidenhamer
Sam Perman
John Stephens
Marcie Bell

Staff

Kim Montgomery Deputy City Clerk
Michael Burgess PW Director
JT Hart PW Deputy Director
Ryan Scott, City Engineer

Mayor Bobby Wagner

3. APPROVAL OF MINUTES: No Minutes for this meeting.

4. NEW BUSINESS:

A) Updates from local Airport Staff – The representatives did not show up for the meeting, so this was not discussed.

B) City Speed Hump Policy – To be discussed at end of New Business.

C) Stealth Speed Monitoring Device – Mr. Burgess explained that his department has one and with the uptick of requests for speed tables staff needs to have another one on hand and is requesting a recommendation for funds to be set aside for the purchase of another device.

Motion by Chairman Wood to recommend City Council approve the purchase of one stealth speed monitoring device for \$6,250.80 with Committee member Weidenhamer providing the second. The motion passed 6-0.

D) Flashing Pedestrian Crosswalk and other enhancement proposals, locations – Mr. Hart explained staff has ordered six (6) new devices and once they're delivered and staff has assembled them, they will be ready to be deployed to the preferred locations. Chairman Wood stated that he would like to have one installed at Main Street and North Lakeside Drive. The others can be installed at Scenic 98/Barracuda, Scenic 98/James Lee Park (west end), Scenic 98/James Lee Park/Crab Trap Restaurant, Scenic 98/James Lee Park (east side) Scenic 98/east of Tarpon Street.

DRAFT

Motion by Chairman Wood recommends to have staff install the flashing pedestrian Crosswalk devices at the following locations, Scenic 98/Barracuda, Scenic 98/east of Tarpon Street, Scenic 98/James Lee Park (west end), Scenic 98/James Lee Park/Crab Trap Restaurant, Scenic 98/James Lee Park (east side) and Main Street and North Lakeside Drive. Committee member Perman provided the second. The motion passed 6-0.

E) Residential Speed Limits – Chairman Wood questioned why most residential streets are posted 30-mph and feels they should be 25 and asked, what needs to be done to change them. According to Mr. Burgess, according to the State Statutes, anything otherwise posted would have to be changed through the adoption of an ordinance. He informed the members that the cost for the sign and posts are about \$150.00 apiece, and if they wanted an ordinance to change the speed limit all over the city, it would have to be advertised twice in the local paper before it can be adopted on second reading.

Committee member Green does not agree with spending the money and changing the signs and the speed limit because no one pays attention to the signs or drives the speed limits.

F) Lola Circle Speed Reduction – Mr. Burgess explained one of the homeowners on this street has requested the have the speed limit established at 25 and a “We Love Our Children” sign to be installed at the entrance to the roadway, adding that street does not have a posted speed limit.

Motion by Committee member Bell, seconded by Committee member Weidenhamer to recommend to City Council approve the installation a sign at the entrance of Lola Street for the neighborhood with one being a posted speed limit sign for 25 mph and the other being a We Love our Children, the motion passed 6-0.

Speed Hump Policy – After a brief discussion regarding the draft Speed Hump Policy and the different the scenarios that can be affected by the required percentages, **Chairman Wood made the motion to table the discussion to their next meeting in July. Committee member Green providing the second. The motion passed 6-0.**

7. PUBLIC COMMENT:

➤ **Stormwater & Floodplain Management Issues - Comments from the Public**
There was no public comment.

8. CONTINUING BUSINESS:

➤ **Public Works and Emergency Management Update – JT Hart**

Mr. Hart provided the members with the following:

DRAFT

Departmental Update:

Currently have two vacancies -

- Maintenance Technician (vacant for over two years, advertised)
- Facilities Maintenance Technician (vacant over 6 months, advertised)

Operational Update:

Recent & Upcoming Council Agenda Items

- May 1 – Regular City Council Meeting/Approved/Authorized
 - Recently reviewed Linear Park concept road design on hold
- Jun 5 – Regular City Council Meeting/Approved/Authorized
 - Resurfacing of Community Center & OCSD parking lots
 - Resurfacing/Restriping of Vintage Circle/Court

Project Update:

- US98 Median Improvements (SR293 to County Line), imminent
- Staff/contractor working on repairing sidewalk hazards.
- Crystal Beach Dr. restriping US 98 to Luke – complete
- H&T Resurfacing of Scenic 98 (west loop – Cobia) – complete
 - Resurfacing/Restriping of Vintage Circle/Court – scheduling
- H&T Main St speed hump installation laid out – scheduling
- Tymco 600ss Street Sweeper purchase approved – processing
- 6 Pedestrian crosswalk light sets (12 total) – ordered
- Final CTC property acquired
- Harbor Pump Hydrogate – ordered
- Traffic accident occurred at Airport Rd crossing 7 Jun – requested report
- ZIIC is, hopefully temporarily, having manpower issues
- GovDeals City Surplus Auction yielding positive returns
- New Dump Truck – mid-late 2023

Emergency Management Update/Operational Update

- Updates to Disaster Preparedness Plan began in March of 2023
- Hurricane Season officially began 1 June

****Mr. Burgess informed the members that the July meeting is the same night as a budget hearing and will need to be rescheduled. The decision was to have it on July 18th.**

9. OLD BUSINESS:

➤ Member Comments:

• **Committee member Bell** – In reference to the locations of the message boards, she requested to have one installed on Gulf Shore Drive alerting people there are no restrooms on Norriego Point. She also spoke of an active construction site on Gulf Shore Drive and how the

DRAFT

workers have continually parked their vehicles on the sidewalk, which is a safety issue for pedestrians. She feels they need to work on codes to make them stricter to prevent these type issues from constantly happening. The Chairman suggests that when the members see these kind of issues to bring it to staff so that they can be better prepared to discuss the issue at these meetings. He also stated that he would see what he can find out and they can discuss further at their next meeting.

Committee member Bell did state that she has been in contact with the Building Department about the ongoing problems at this constriction site, and how she feels there needs be a tighter ordinance created for staff to be able enforce.

- **Chairman Perman** – Spoke of her continued concerns she has about the different types of electric transportation being used throughout the city and the need for new policies, because she is seeing all the different types in the bike lanes, on the sidewalks and in the streets and no one seems to know the proper operating procedures.

Chairman Wood explained there is a workshop scheduled for July 13th for some of the topics she is concerned about.

Committee member Bell spoke of the State Statue for bicycle light requirements. As well as helmets requirements for a certain age group that is never enforced and feels this committee should address this in the future.

➤ **ADJOURNMENT:**

Having no further business at this time, the meeting adjourned at 7:30 p.m.

Adopted and approved this _____ day of _____ 2023.

James T. Wood, Jr. Chairman

Kim Montgomery, Deputy City Clerk

DRAFT

**PUBLIC WORKS/PUBLIC SAFETY COMMITTEE
MEETING MINUTES DESTIN CITY HALL BOARDROOM
TUESDAY, APRIL 11, 2023 - 5:30 PM**

1. CALL TO ORDER & PLEDGE OF ALLEGANCE:

Public Works Director Michael Burgess called the Public Works/Public Safety Committee to order on Tuesday, May 9, 2023, at 5:30 p.m.

2. ROLL CALL:

Members Present

James T. Wood, Jr.
John Green
Tom Weidenhamer
Sam Perman
John Stephens
Curtis Smith
Marcie Bell

Staff

Kim Montgomery Deputy City Clerk
Michael Burgess PW Director
JT Hart PW Deputy Director
Ryan Scott, City Engineer

3. APPROVAL OF MINUTES: March 2023

Motion by Committee member Perman, seconded by Committee member Stephens to approve the April 11, 2023 minutes as written, passed unanimously, 7-0.

4. APPROVAL OF THE AGENDA:

5. NEW BUSINESS:

➤ **Destin Water Users – Lockwood Wernet**

Provided the members with an update on the following:

- Tracking water sales and gallons billed.
- Completed a conversion of the disinfection system from chlorine gas to liquid chlorine bleach for safety sakes of the surrounding neighbors in case there was ever a leak its safer .
- Construction for new facilities is underway and it being built to withstand new hurricane standards since hurricane Michael.
- All wells within the service areas now have generators.
- Waterline upgrades have been made to Cobia Street and they are working towards replacing all 2-inch lines with a larger diameter lines as part of their annual work program.
- Completed the installation of underground disposal and above ground irrigation at Morgan’s Sports Complex.
- Performing technical studies for the 25-acre land adjacent to the Airport they purchased which will be a wet weather disposal for reclaimed water.
- Sanitary Sewer and Evaluation survey for all gravity systems for necessary

DRAFT

repairs on west side of the city.

- Added a Force Main near the Charles Apartments at the new right-of-way.
- Surveying all manholes and Air Release valves for conditions and evaluating what repairs that may be necessary to keep everything in good repair to prevent any sanitary sewer overflows.
- Working on their Master Plan for Water Model Project in terms of how water flows through the systems to determine if any additional lines need to be added or upsized and how to make those happen.
- Evaluating the Lift Stations throughout the city to determine if any need to be upgraded.
 - In terms of city projects, keeping a close eye on the following:
 - Cross Town Connector Project progress so they can install a new line from Benning to Beach.
 - Linear Park Project that may impact some water lines and force mains in the area as well as some right-of-way that may be needed from the city.
 - Asked to keep them in the communication loop of any new roadway projects so they can get out and perform any repairs that may be needed in roadway segments at the same time to help keep cost down.

➤ **Resurfacing & Restriping of Vintage Circle and Vintage Court**

Mr. Hart provided the members with the information on the cost and details of this project and staff is seeking their recommendation to City Council scheduled for the June 5, 2023, Council meeting agenda.

Motion to support and recommend to City Council approve the resurfacing and restriping of Vintage Circle and Vintage Court with Committee member Weidenhamer providing the second to the motion. The motion passed 7-0.

➤ **Citywide Speed Reduction**

Mr. Burgess explained the revised draft speed hump policy for their review and the steps necessary for the process of the request and the criteria to meet the threshold for the approval process and the cost.

Capt. Fulghum spoke to the members about speeding issues in the city and explained that the OCSO does not have a specific unit set aside to enforce speeding in Destin. He further explained that they have 4 people assigned to work 12-hour shifts and have the city broken down to two zones and explained how they have their officers dispatched for calls received. In addition, they have a speed trailer assigned to district three that covers the area from Duke Field, south to Okaloosa Island and east to the Okaloosa/Walton County line that is constantly rotated throughout the area and currently, is located here in Destin on Kelly Street. He also spoke of the

DRAFT

message board they have that periodically display different messages and it gets rotated throughout the same coverage areas of the County. He provided the members with their speeding statistics on Okaloosa Island and the in the city and how those numbers can be affected when someone speeding is stopped on the island and given ticket, that act tends to slow drivers down in the city. He also mentioned a \$50k FDOT grant they're seeking, with the assistance of the city's Grants & Projects Manager, to help address speeding and aggressive driving in the city. The grant will help fund overtime work for deputies to provide additional assistance in the city. Additionally, they place their spare unmanned vehicle in areas of the city for short periods of time in an attempt to slow the traffic down.

➤ Speed Hump Policy Revision

In discussing the speed hump policy revision, the members discussed at length the different perimeters of how the speed hump policy is affected by the surroundings whether its an HOA condominium setting or the standard neighborhood and the requirements necessary to meet the standards outlined, in order go on to Council for approval.

Mr. Burgess added that he and Mr. Hart will work closely with the City Engineer to come up with establishing the criteria to be completely scientific and objective.

➤ Indian Trail Speed Hump Request

Mr. Burgess explained a citizen who spoke at the April 17th Council Meeting about wanting them and as a result, City Council directed staff to start the process for them to be installed on Indian Trail. He pointed out that Indian Trail is 10,000 feet long with no stop signs, except at the Main Street, and would like to know exactly where they need to go, adding that would be a tremendous help because he hasn't been able to communicate with that individual. According to Committee member Stephens, he is positive it would be west of Main Street, the same location where the lady who came and spoke at a recently past meeting about wanting sidewalks installed.

Committee member Green spoke of a citizen who approached him and questioned if the stop sign at Main Street and Indian Trail could be made into a 3-way stop. Mr. Burgess stated that he would speak to the City Engineer and get his opinion and report back.

Committee member Smith added that a warrant analysis for stop signs would first need to be done before deciding to have one installed. Committee member Green reminded the members of the incident with Kolton, who perished from being hit by a car at Main Street and Kelly and how that area also did not warrant a three way stop but they were installed because of that accident, and he would not want to see anything similar happen before getting them installed.

7. PUBLIC COMMENT:

DRAFT

➤ **Stormwater & Floodplain Management Issues - Comments from the Public**

There was no public comment.

8. CONTINUING BUSINESS:

➤ **Public Works and Emergency Management Update – JT Hart**

- Hydra gates have been purchased for the harbor pump.
- Restriping from Crystal Beach Drive to Luke Avenue and Hwy 98 is in progress.
- Resurfacing on Scenic Hwy. 98 is finished, and the striping and crosswalks are on schedule to get put down.
- Additional Pedestrian Lights are in the purchasing process.
- Boring estimates at Four Prong Lake in Destin is under evaluation by all parties involved.
- Indian Trail Sidewalk request is on hold since it is included in the Mobility Plan that Council will be reviewing.
- Provided the members with the Okaloosa County Sheriff's April Statistics. Chairman Wood asked for those to be provided to the members in their packet.

9. OLD BUSINESS:

➤ **Member Comments:**

- **Committee member Stephens** – Reported that the Harbor Capacity Study Committee has recommended the installation of petroleum absorption pads in the storm drains along the harbor. Mr. Burgess explained there are three already in place. Committee member Stephens also spoke of a smell emanating around Harbor Docks. Mr. Burgess explained what happens when there's not been any rain and how they have that area on schedule to get cleaned with the equipment they have scheduled to rent in the next few weeks.

- **Committee member Bell** – Thanked staff for installing the loading and unloading signs at the end of Gulf Shore Drive and how its improved.

- **Chairman Wood** – Spoke of experiencing how short the crosswalk countdown is at Main Street and 98 Palms and how it needs to be increased for those that don't or can't walk that fast, to have enough time to get across safely.

➤ **ADJOURNMENT:**

Having no further business at this time, the meeting adjourned at 7:30 p.m.

Adopted and approved this _____ day of _____ 2023.

James T. Wood, Jr. Chairman

Kim Montgomery, Deputy City Clerk



LAMAR

PARTNERING WITH THE CITY OF DESTIN

Unify to Beautify!

THE MISSION

Unify to Beautify! Lamar Advertising will partner with the City of Destin to help beautify the landscape by reducing the number of outdoor advertising structures AND upgrading the aesthetics of the remaining Lamar billboards.

THE PLAN

Lamar will reduce the number of Lamar billboards within the City limits by 45%! There are currently eleven (11) structures owned and operated by Lamar Advertising, from the Destin Bridge to just east of Gulfstarr Dr. Lamar is offering to permanently **REMOVE FIVE (5) BILLBOARD STRUCTURES** and upgrade the remaining six (6) to blend within the coastal landscape.

THE AESTHETICS

The Lamar Art Department has created a unique billboard design consistent with the City of Destin's coastal vernacular architectural design theme. The remaining six (6) billboard structures will be rebuilt with this one-of-a-kind architecture, providing unity with the coastal community theme.

The billboard faces will also be upgraded from the dated look of the "old fashioned" billboards to the more contemporary and efficient LED digital billboard faces. The digital components will be regulated and controlled to meet all industry standards and State regulations with no scrolling, flashing, or blinking graphics.


THE POWERLINES

Lamar Advertising will, at our expense, install underground power to all six of the remaining billboard structures, thus contributing to the City's long-term underground powerline project.

THE ADDED PARTNERSHIP BENEFIT

As another benefit of partnership, Lamar will provide the City with one digital spot on each of the remaining six (6) billboard structures. The spot may be used to advertise upcoming events, safety and weather conditions, storm prep and evacuation routes, or anything the City desires to communicate to the community.

The digital display will allow the City to upload and schedule new messages in real time. In the case of an emergency situation that affects the community, a digital board will allow the City to get a message to the public faster than any other media.

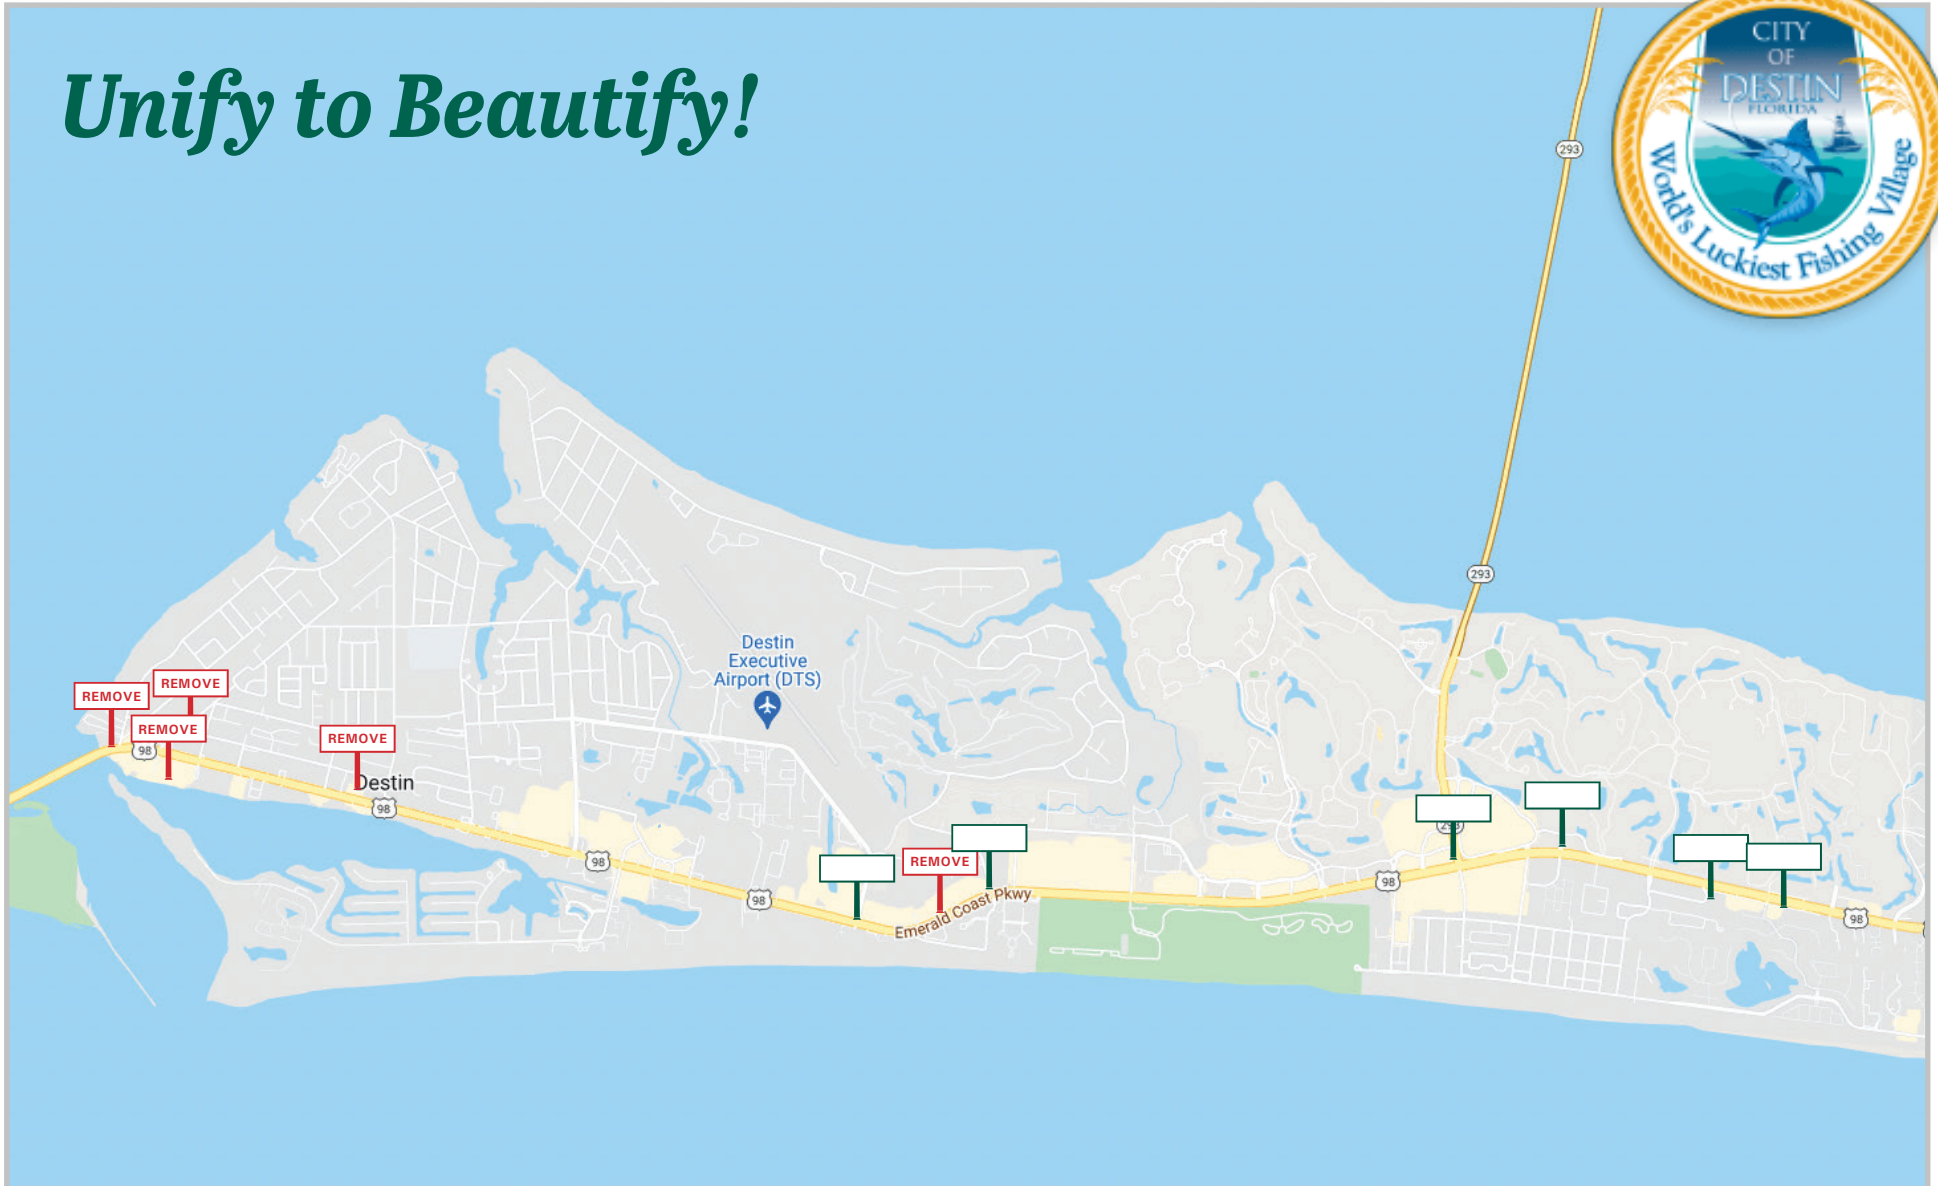

CITY OF DESTIN



AGENDA ITEM

COUNCIL MEETING DATE: July 18, 2023
TYPE OF AGENDA ITEM: Presentation
AGENDA OUTLINE NUMBER: 4.C.

TO: City Council

THRU: Lance Johnson, City Manager

FROM: Louis Zunguze, Community Development Director
Kimberly Kopp, Land Use Attorney

DATE: August 5, 2022

SUBJECT: Mobility Plan Update

I. BACKGROUND:

At the City Council Meeting on March 1, 2021, the motion to replace transportation concurrency (MMTD) with a Mobility Fee-Based Plan passed 7-0.

II. DISCUSSION: The Community Development Department is continuing work on the Mobility Plan to address transportation needs through 2050. The overall goal of the Plan is to compile a comprehensive list of projects the City can undertake and fund with Mobility Fees and other sources of funding. After completing an assessment of existing conditions, issues and potential needs, the process is moving on to identify projects to include in the plan.

The purpose of this Agenda Item is to brief City Council on the status of the process and introduce the list of transportation projects that are being recommended for the Mobility Plan. The following **projects, categories of projects, and policy priorities** have already been identified based on the existing conditions assessment, review of City plans and previously identified project priorities, and stakeholder feedback received on the Plan.

- 1. Continuous multimodal facilities and a cohesive design strategy for the Cross Town Connector from US Highway 98 and Stahlman Avenue to Commons Drive and Indian Bayou Trail. (Including pedestrian safety enhancements at the US 98/Stahlman Ave. intersection)**
- 2. Intersection improvements that address safety and connectivity, which currently include 13 intersections of local and collector roads.**
- 3. US Highway 98 strategy west of Airport Road includes priorities the City of Destin can emphasize in its coordination with the Florida Department of**

Transportation (FDOT) during the ongoing PD&E Study.

4. Gulf Shore Drive reconfiguration to convert the four travel lanes to two travel lanes to reduce speed, improve safety, better accommodate all modes of transportation, and create a pleasing gateway into the neighborhood.
5. Small project initiatives on local streets that create new connections and improve traffic flow.
6. Main Street streetscape improvements on the section south of Airport Road to include multimodal facilities, lighting, landscape, and signage.
7. Coordinated transit and park and ride strategy that incorporates transit strategy from the Transit Development Plan.
8. Parking strategy for Harbor District that details improvements to existing City-owned parking lots.
9. Gulf Power Linear Park and Trail implementation plan that stages sections based on opportunities and some of the constraints related to right-of-way.
10. Emphasizing the need for sidewalks on both sides of the street for City-initiated roadway and sidewalk gap infill projects.
11. Coordinate street requirements, capacity improvements, and Mobility Plan projects with new development and the Mobility Fee that is being developed.

A. Link to Strategic Goals / Objectives:

3. Improve mobility and connectivity
4. Enhanced quality of life and safety for families
6. Effective, efficient, and aesthetically pleasing infrastructure

B. Effect on Budget (EOB): This project is already approved in the budget.

C. Level of Service (LOS): Improved Level of Service

D. Legislative Sponsor:

III. CONCLUSION: Staff is seeking feedback from City Council on this list of projects. The presentation highlights some early decisions and commitments that need to be made to shape the **projects, categories of projects, and policy priorities.**

IV. RECOMMENDED MOTION: Informational and feedback from City Council

Attachments:

1. MobilityPlanUpdate 08.15.22

The background image shows a street intersection with a blue overlay. A street sign for 'Emerald Coast 34800 Pkwy' is visible. Several cars are parked or moving at the intersection. The sky is cloudy.

City of Destin Mobility Plan

City Council Briefing

August 2022

Agenda

- Project status
- Public Feedback on Mobility Plan topics
- Major projects
- Intersection and small network improvements
- Other project and policy initiatives
- Next Steps

Overall Mobility Plan Goal

Compile a comprehensive list of projects the City can undertake and fund with mobility fees and other sources of funding.

Current Status



Completed


- Needs assessment and trends and conditions analysis
- Initial feedback on transportation issues and needs
- Identified primary roadway projects and intersection improvements

In Progress

- Mobility Plan and Fee Study documentation
- Evaluating and vetting projects



What modes of transportation do you use to get around Destin (not including exercise)?

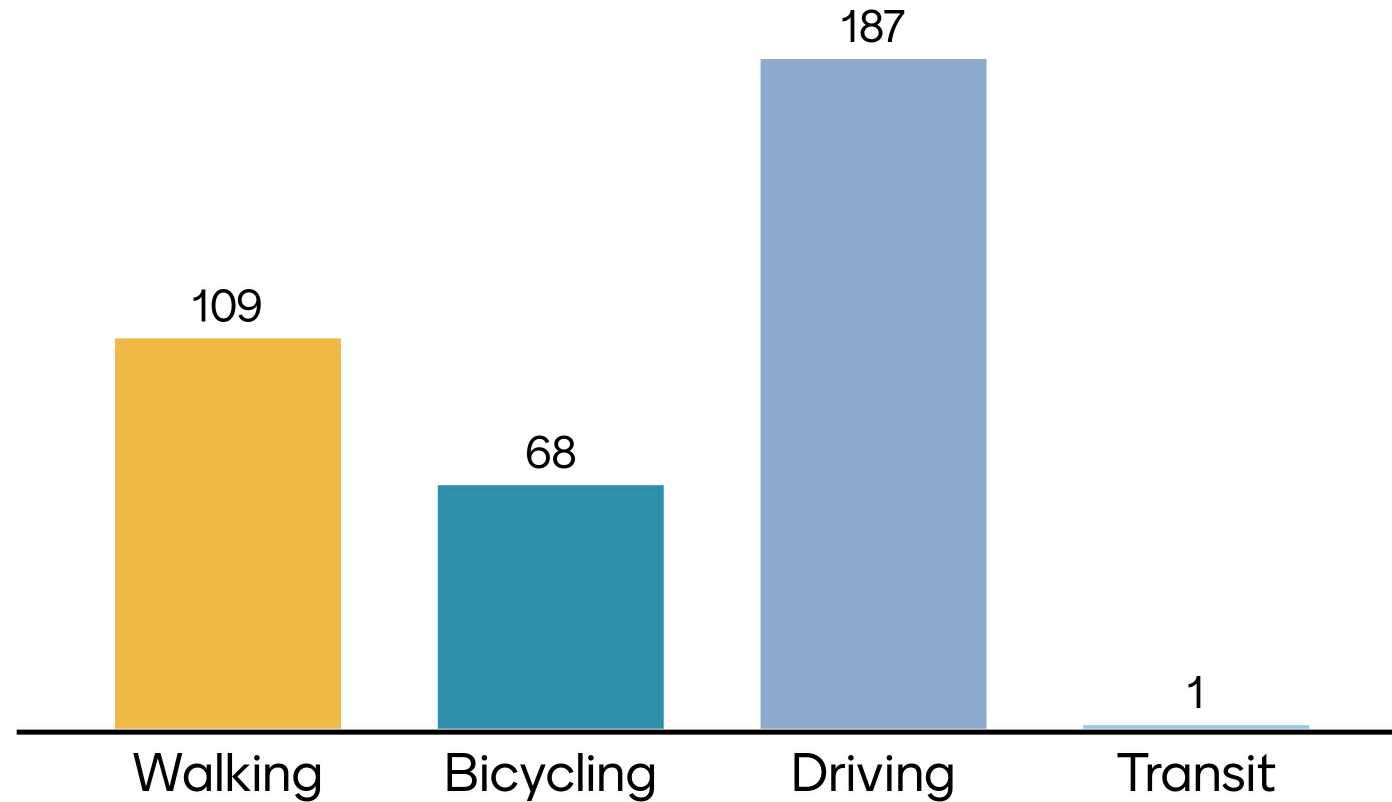


QUALITY OF LIFE







Rank the following transportation emphasis areas in order of importance to you

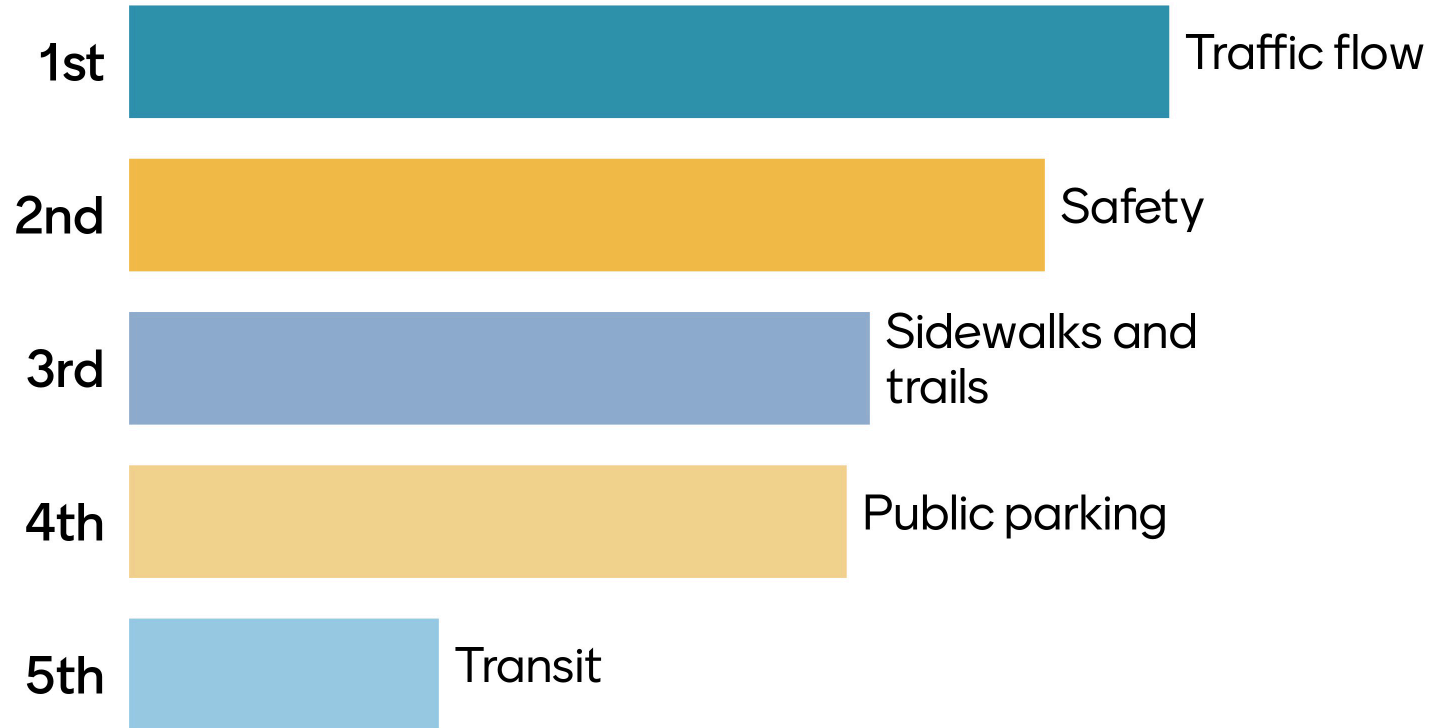



If you had \$100, what percentage would you spend on the following?

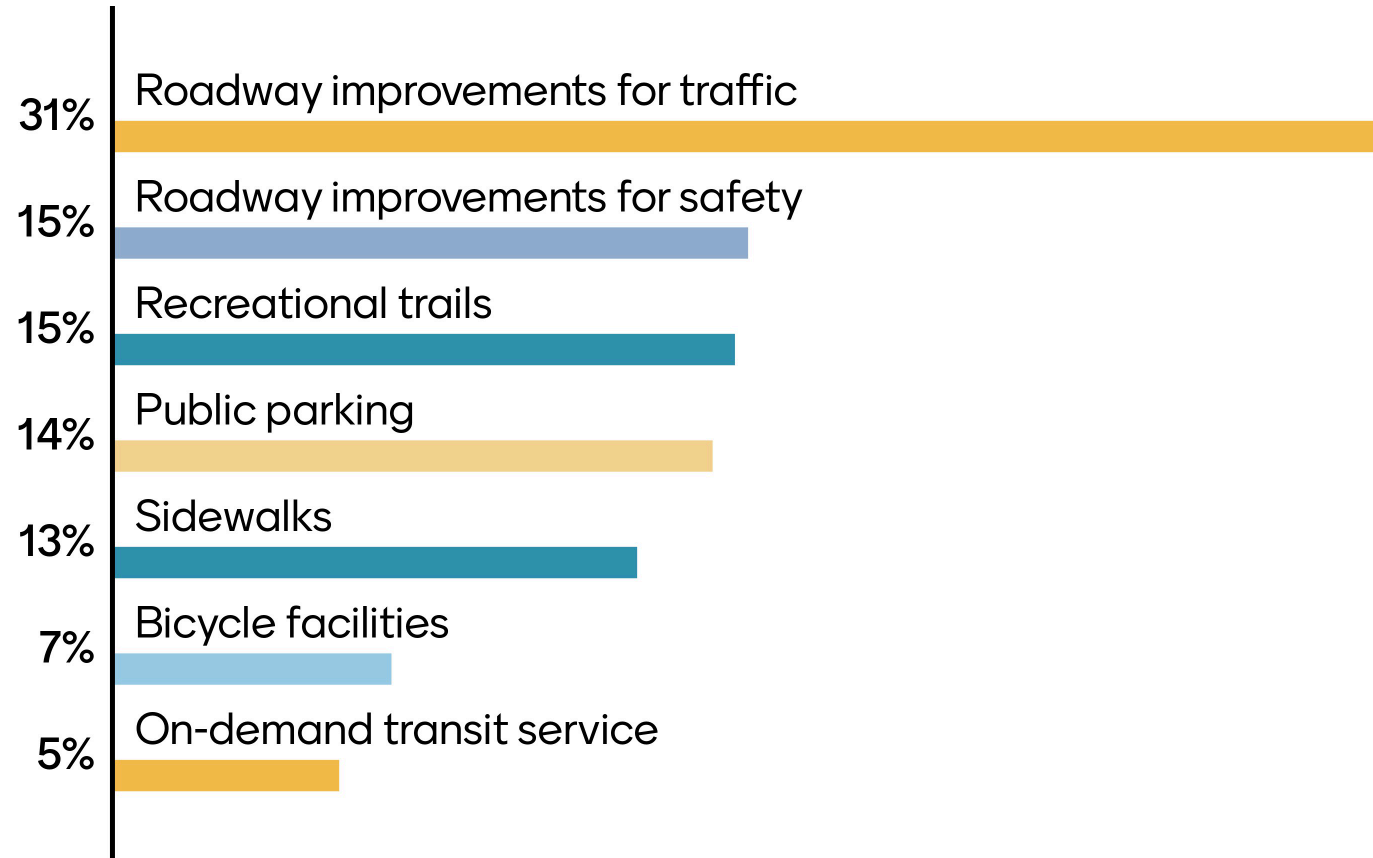

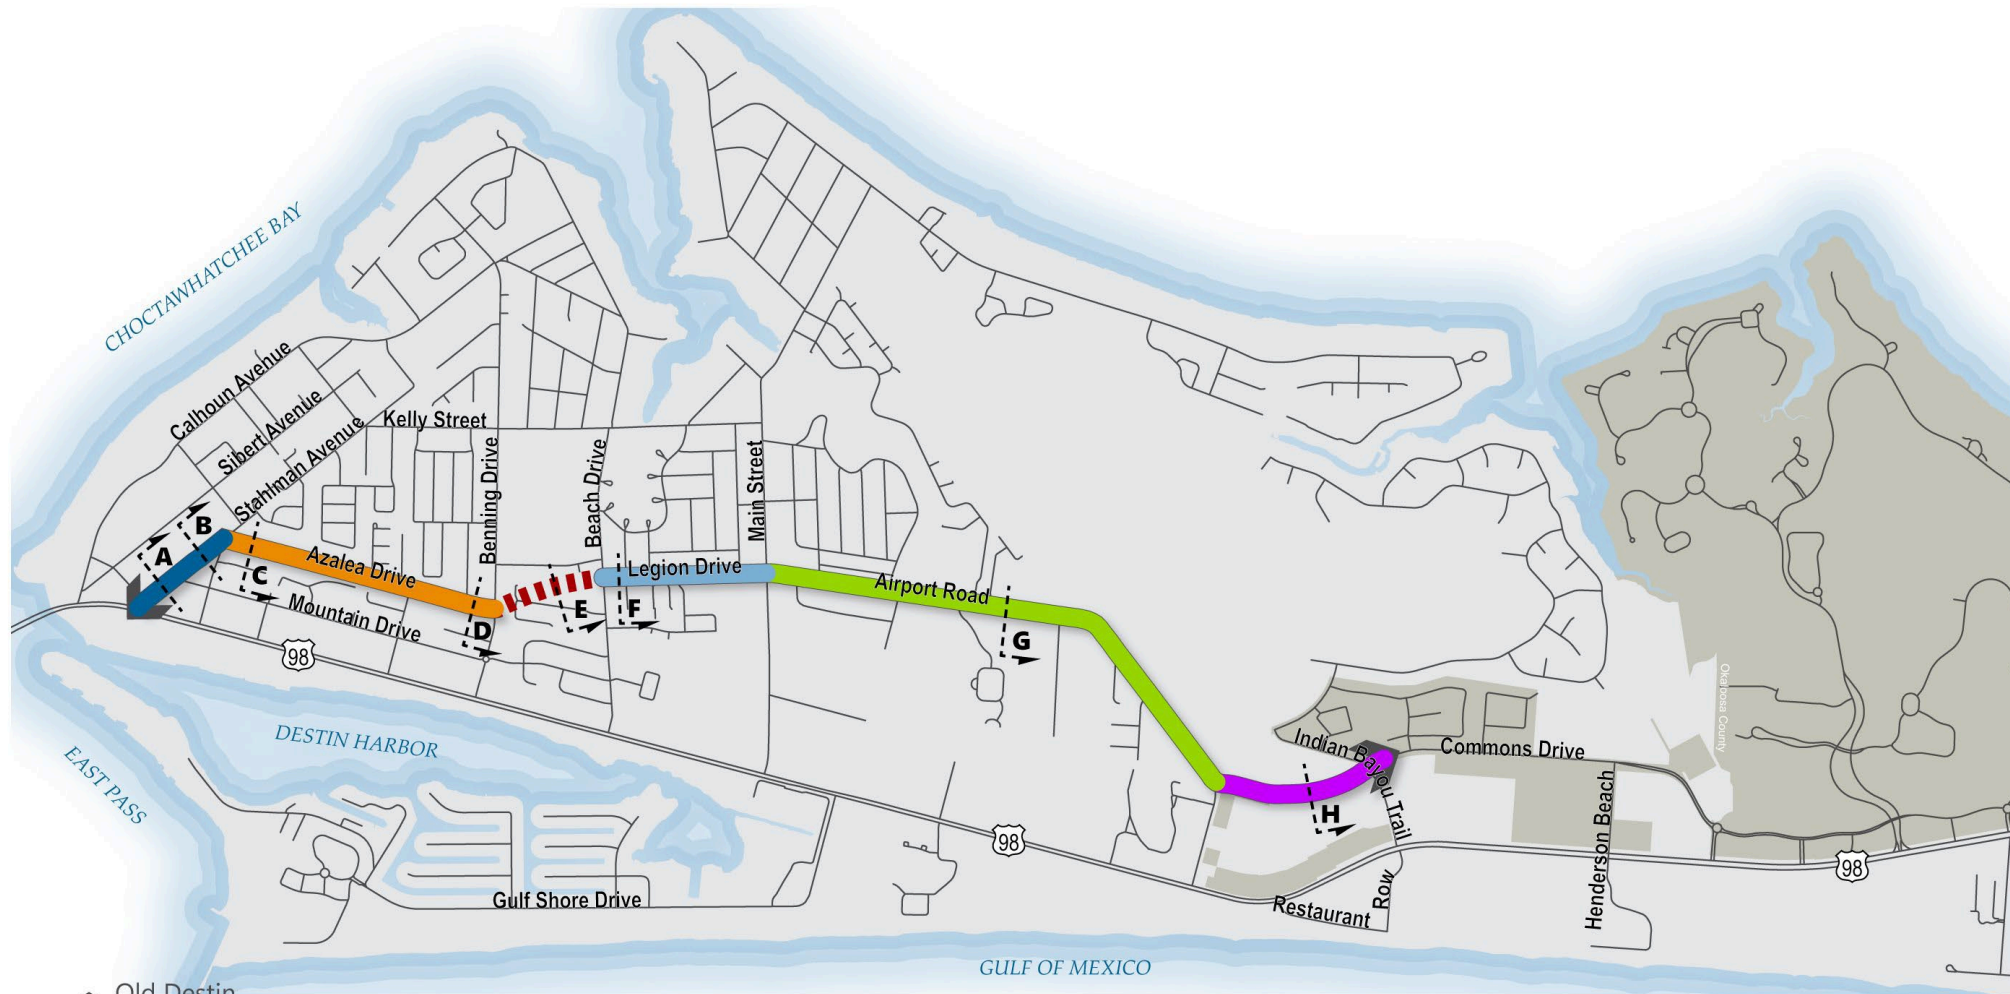


MOBILITY PLAN | Cross Town Connector

- | | |
|--|---|
|  Stahlman Avenue |  Legion Drive |
|  Azalea Drive |  Airport Road |
|  Azalea Drive Extension |  Commons Drive |

 Section A



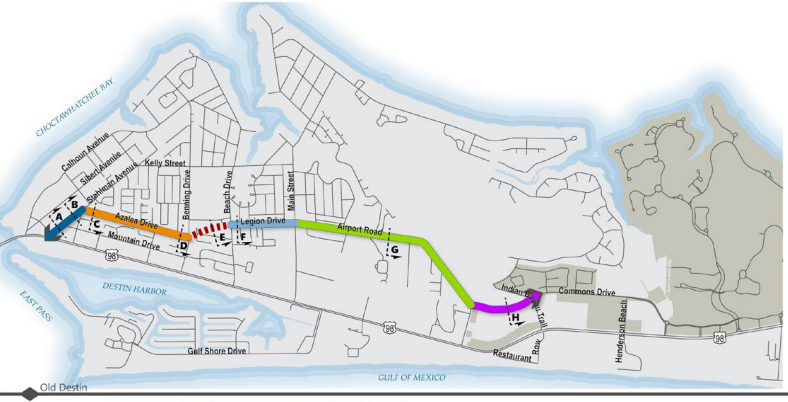

Crosstown Connector Sections

A Stahlman Avenue north of Zerbe Street

B Stahlman Avenue north of Mountain Drive

C Azalea Drive east of Stahlman Avenue


D Azalea Drive west of Benning Drive

E Azalea Drive Extension east of Benning Drive



F Legion Drive west of Benning Drive


G Airport Road east of Main Street

H Commons Drive east of Airport Road

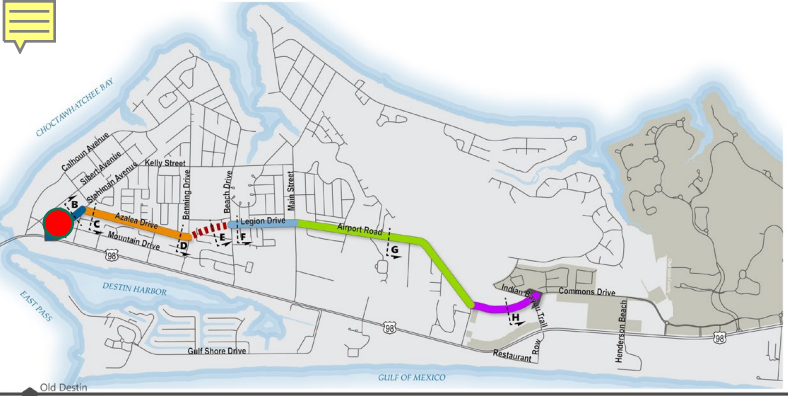



Stahlman Avenue north of Zerbe Street Section A

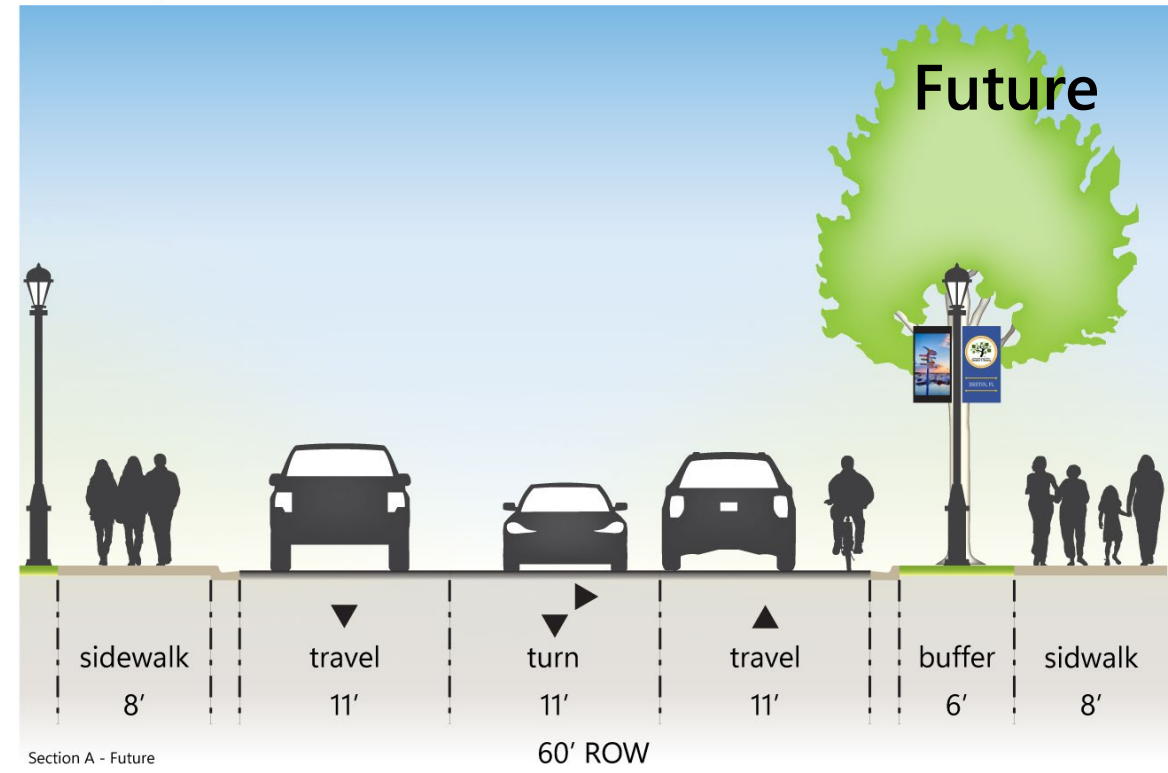
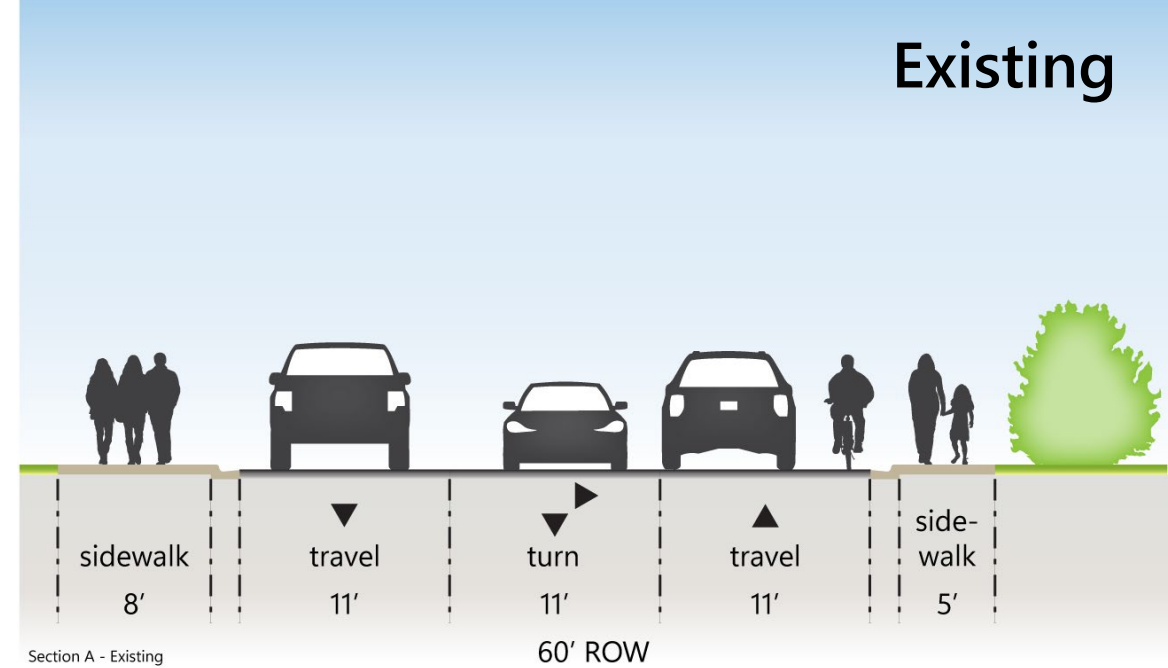


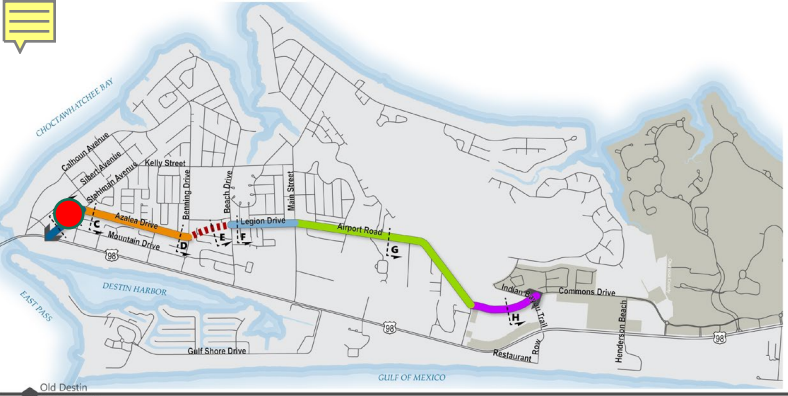


Stahlman Avenue north of Mountain Drive

Section B

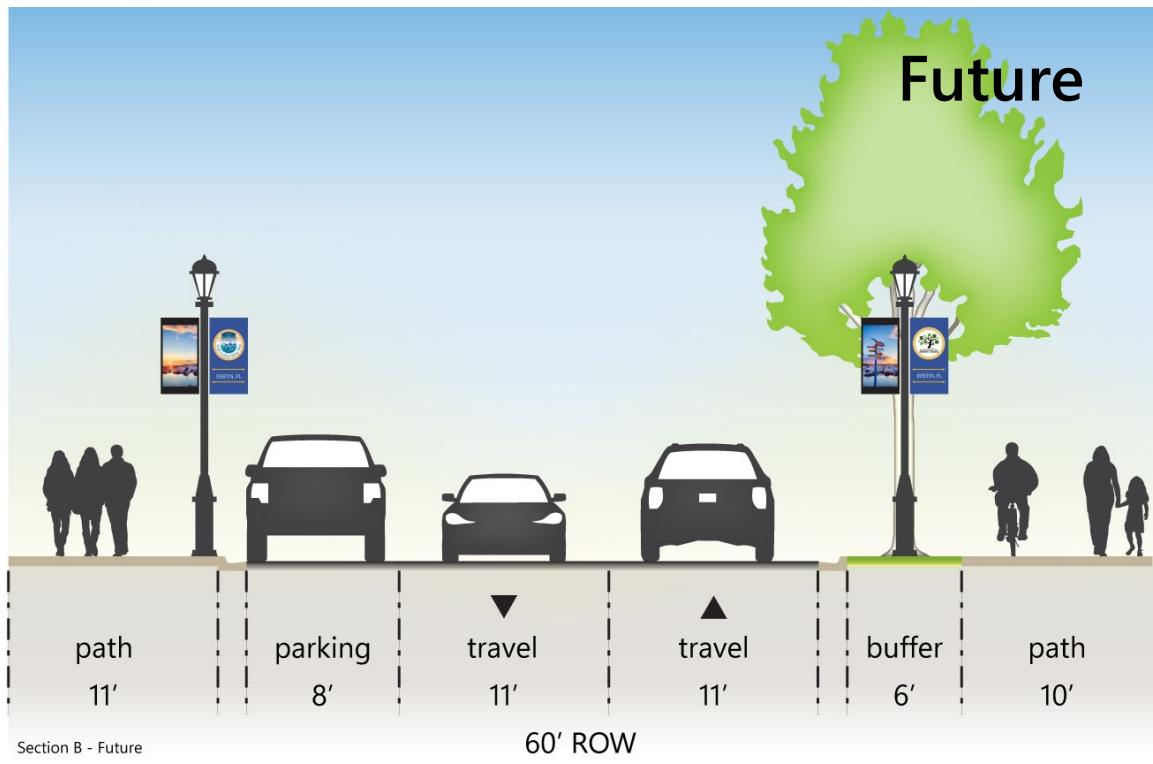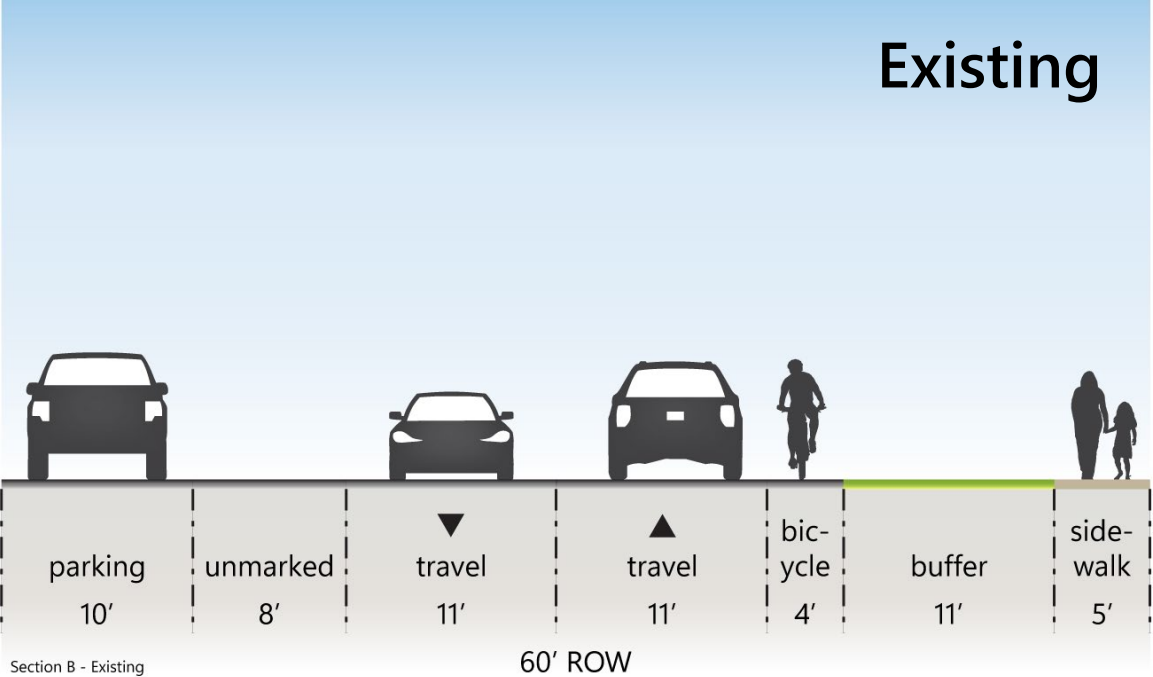


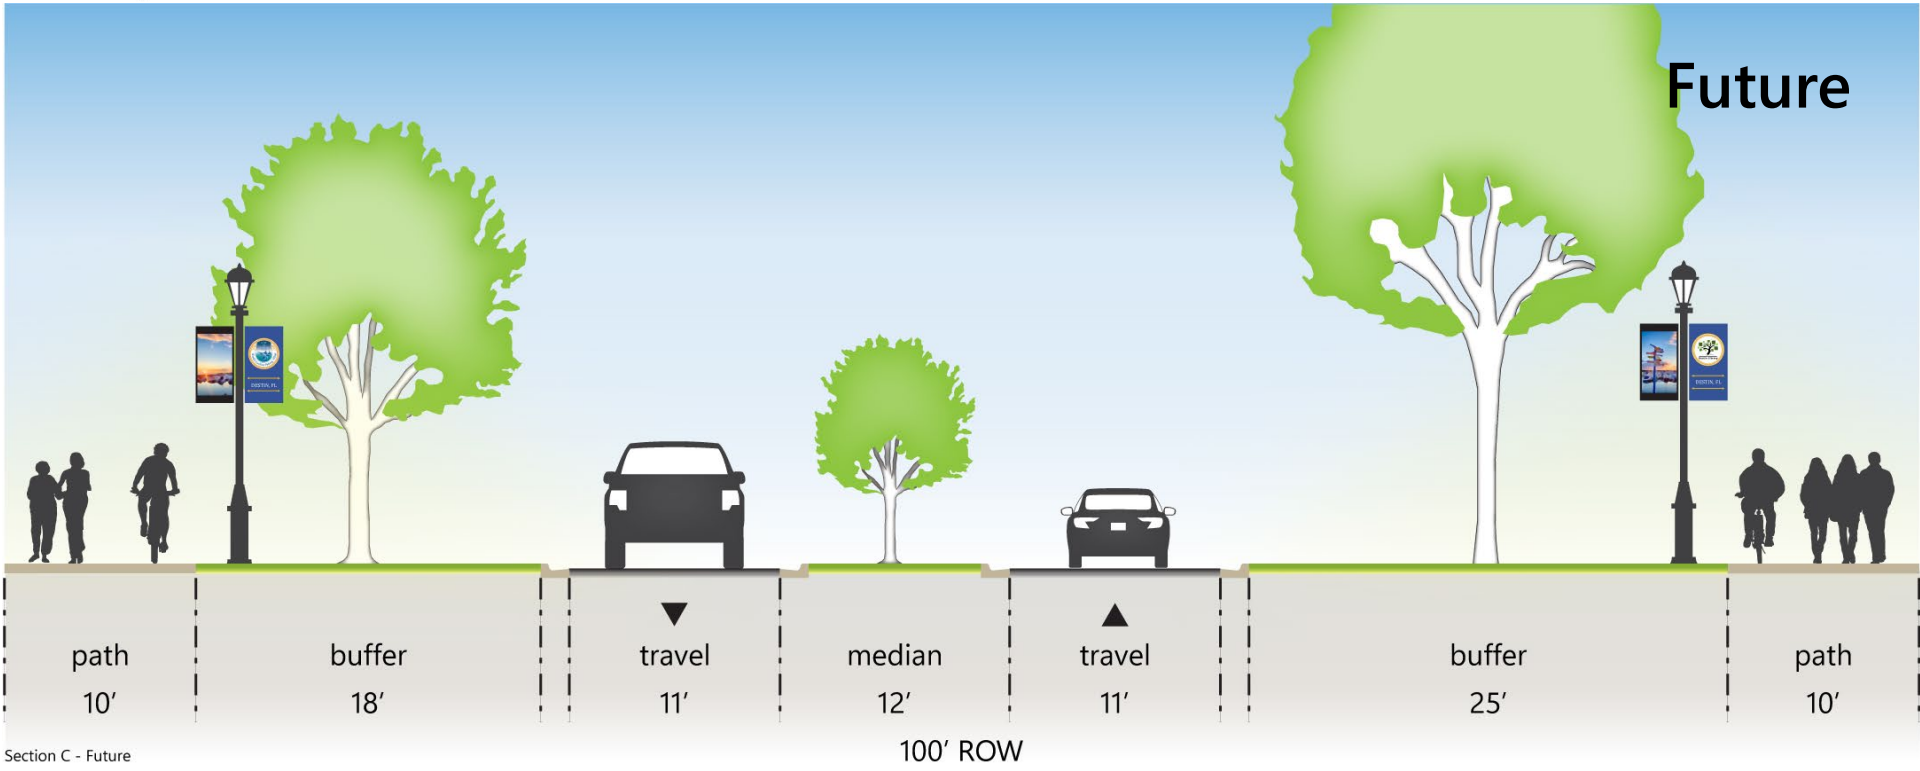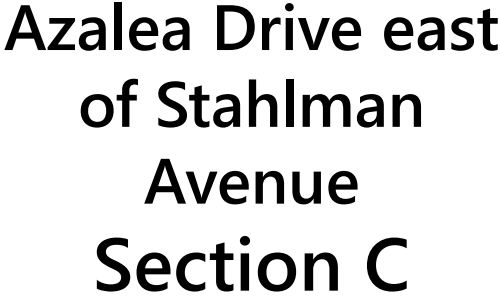

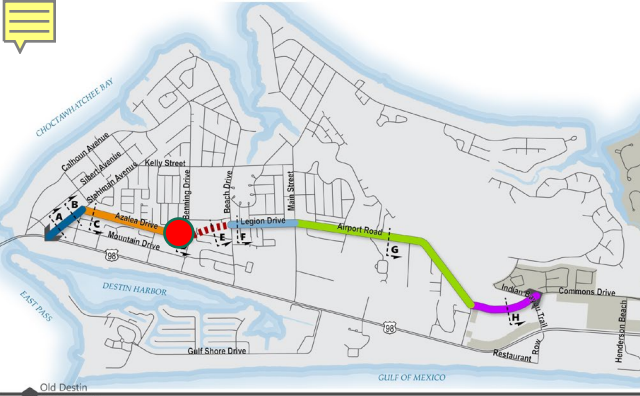


Azalea Drive west of Benning Drive Section D

Existing

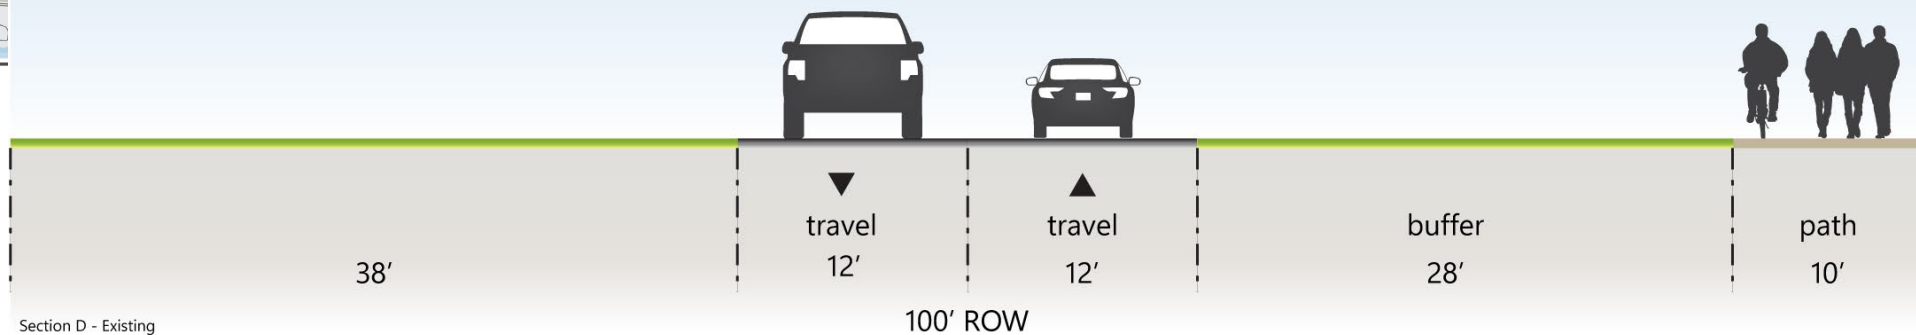


Section D - Existing


Future

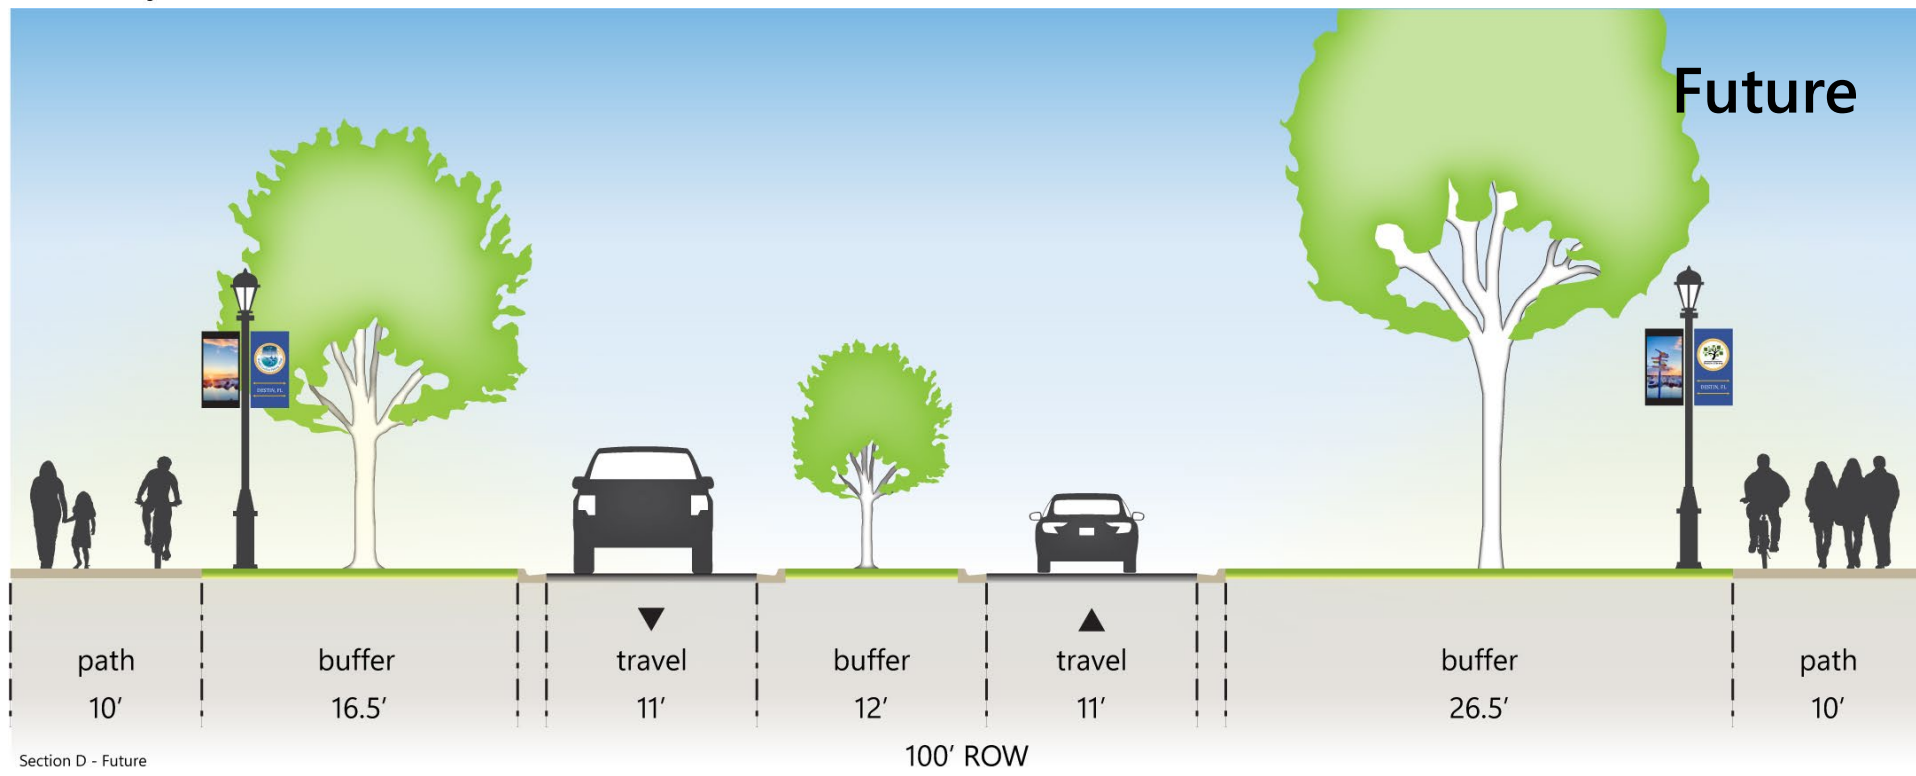

Section D - Future

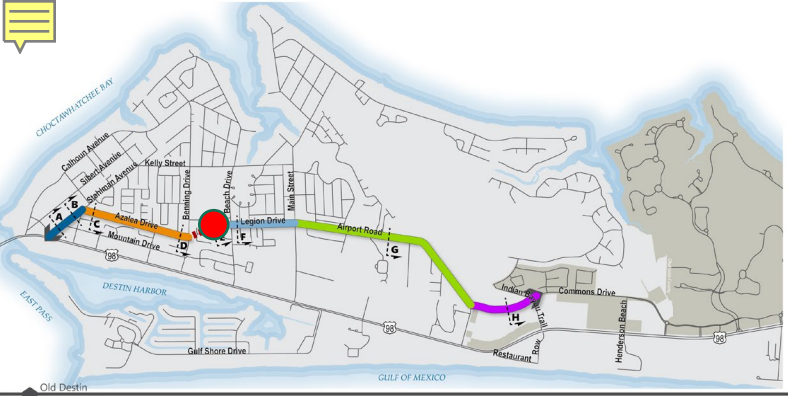

Azalea Drive Extension east of Benning Drive Section E


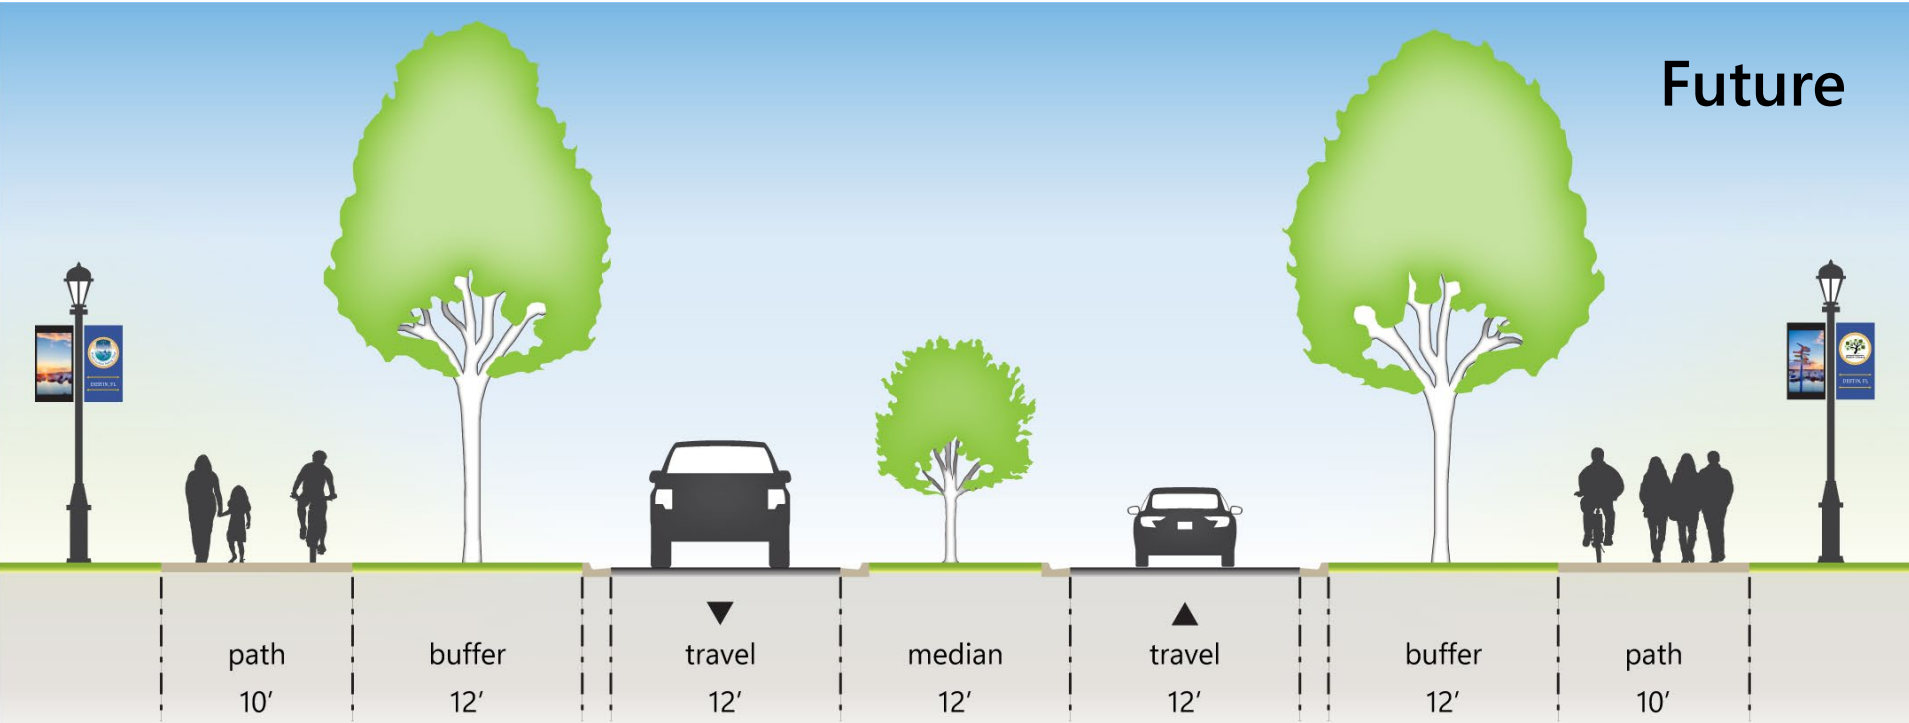



Section E - Future

ROW varies




Legion Drive west of Benning Drive Section F

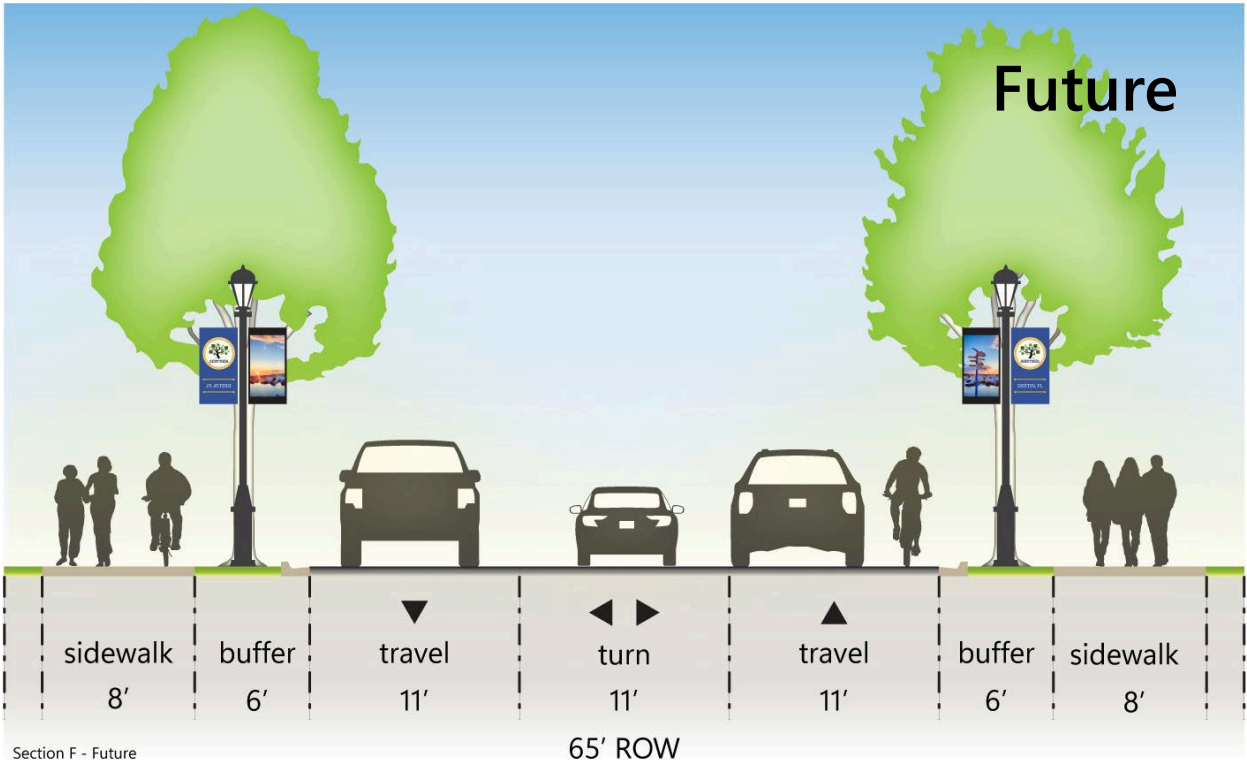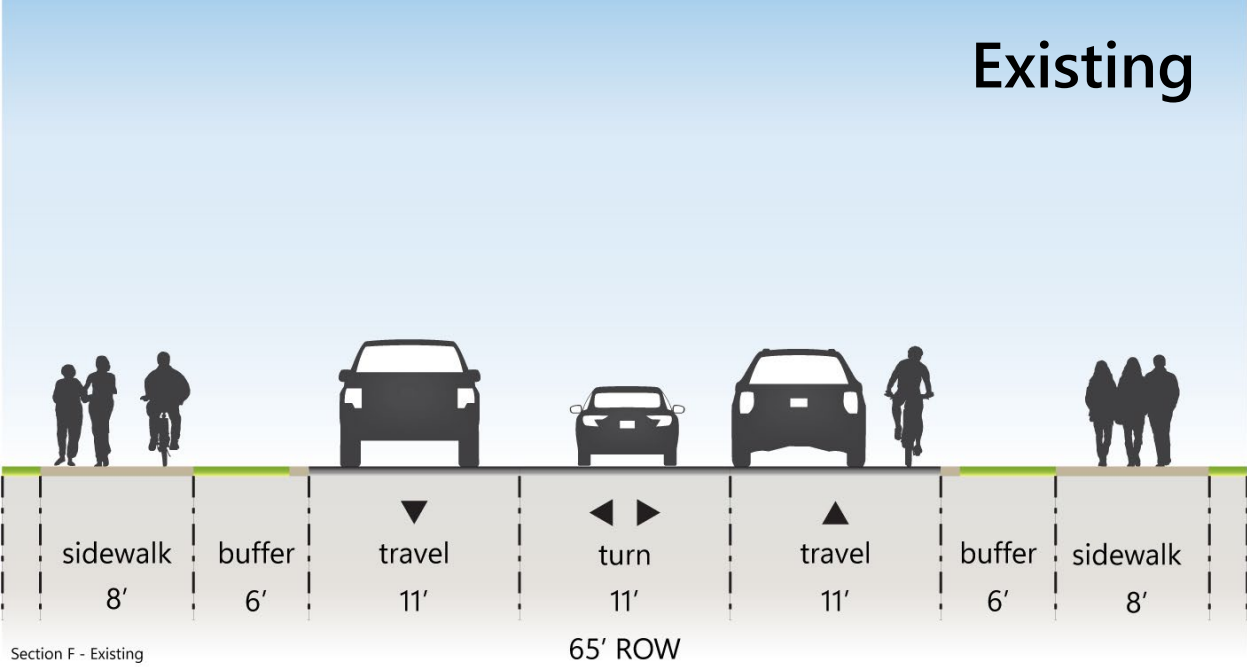

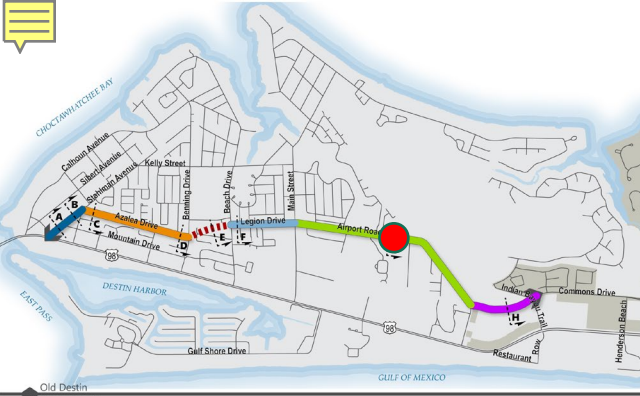


Airport Road east of Main Street Section G

Existing

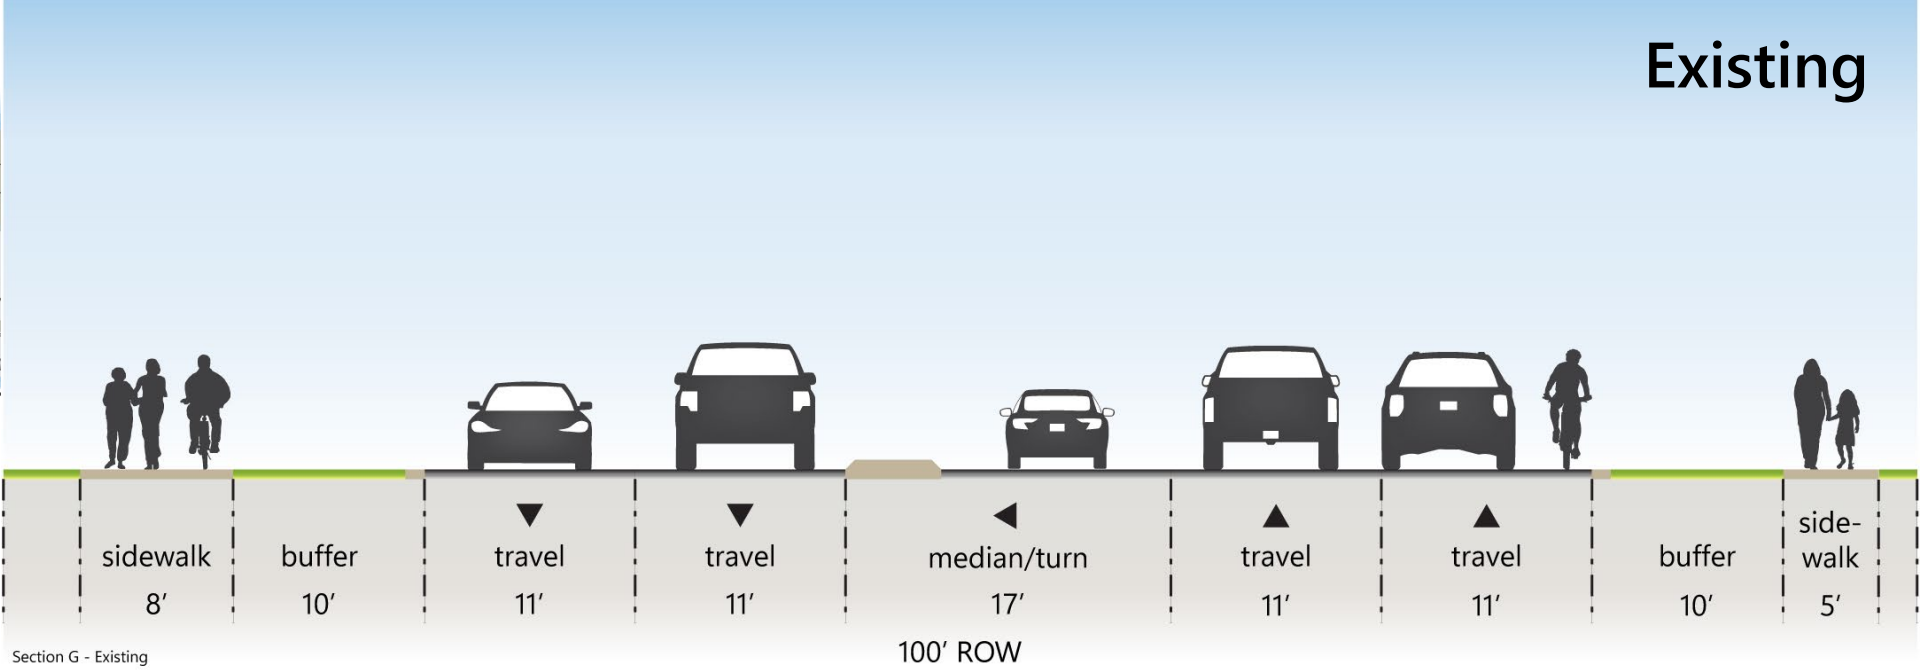


Section G - Existing


Future

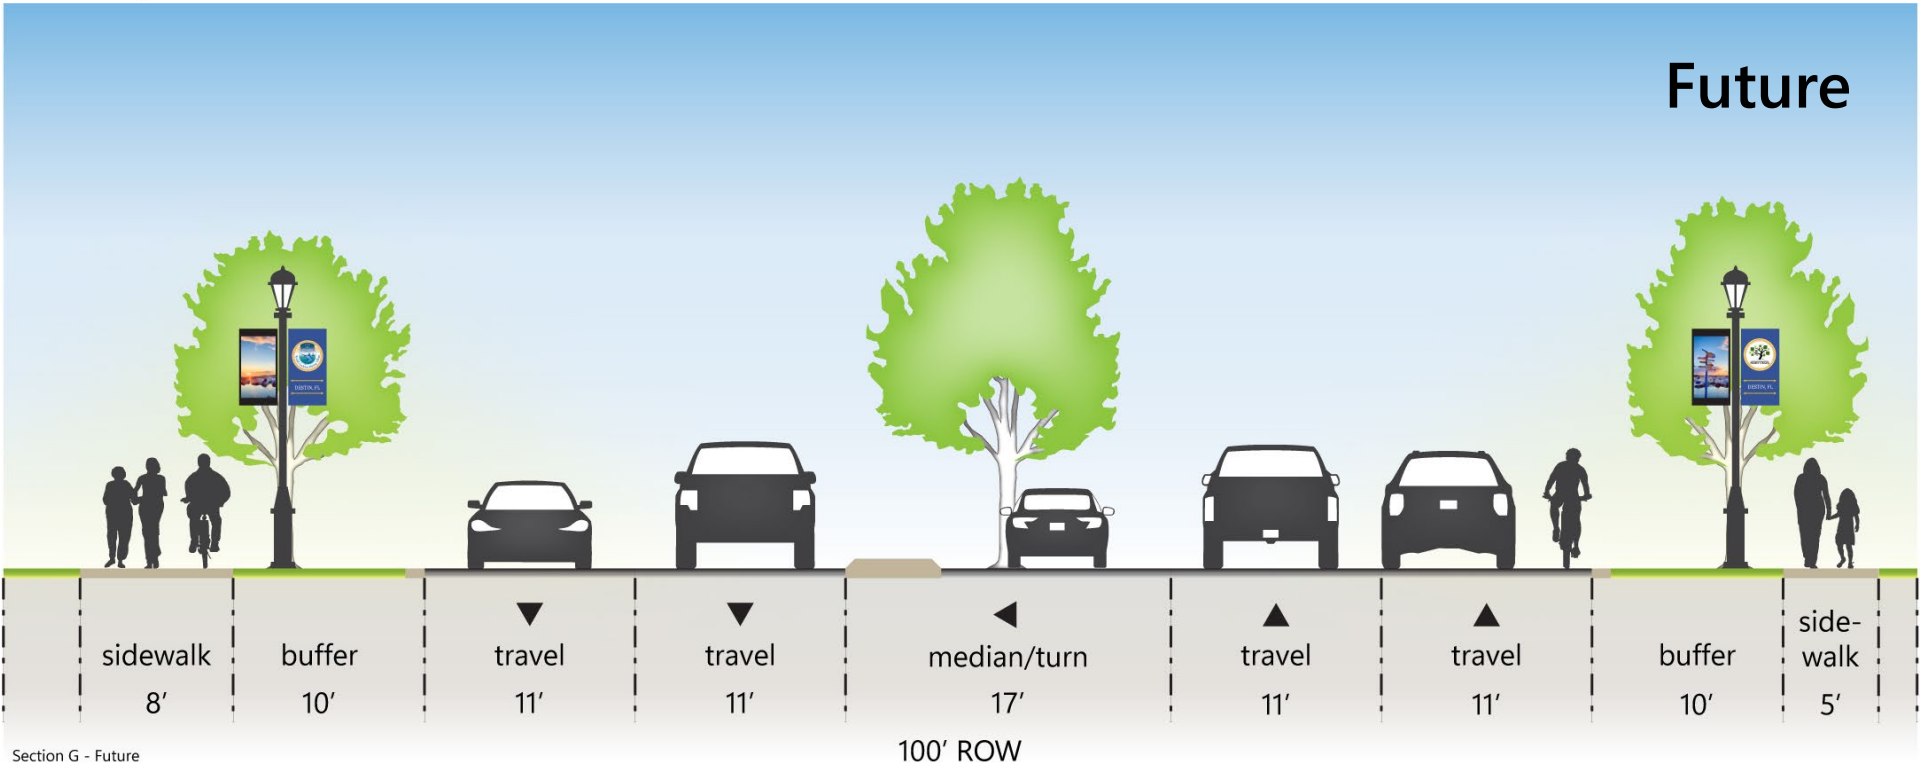

Section G - Future

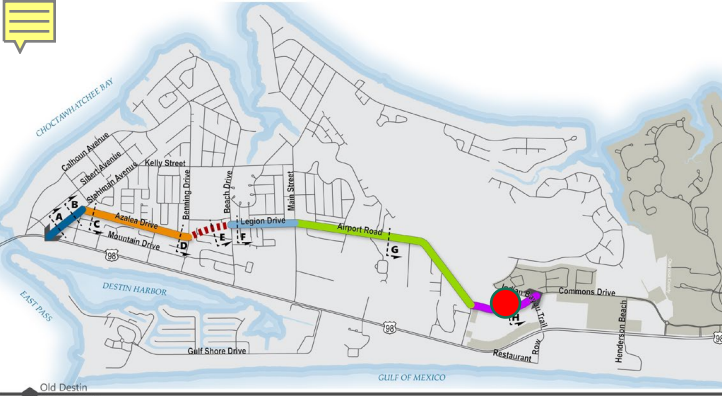


Commons Drive east of Airport Road Section H

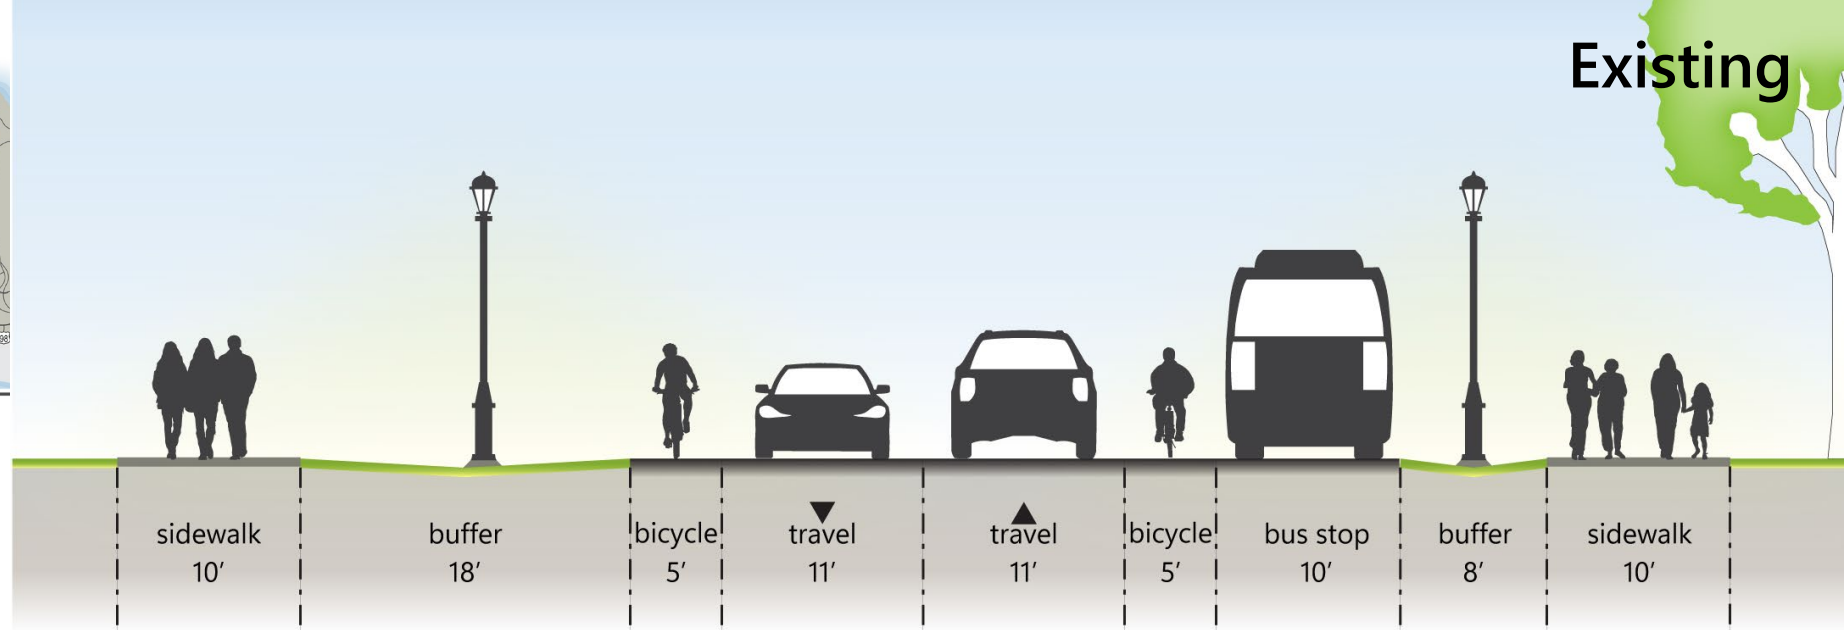

Section H - Existing

ROW varies

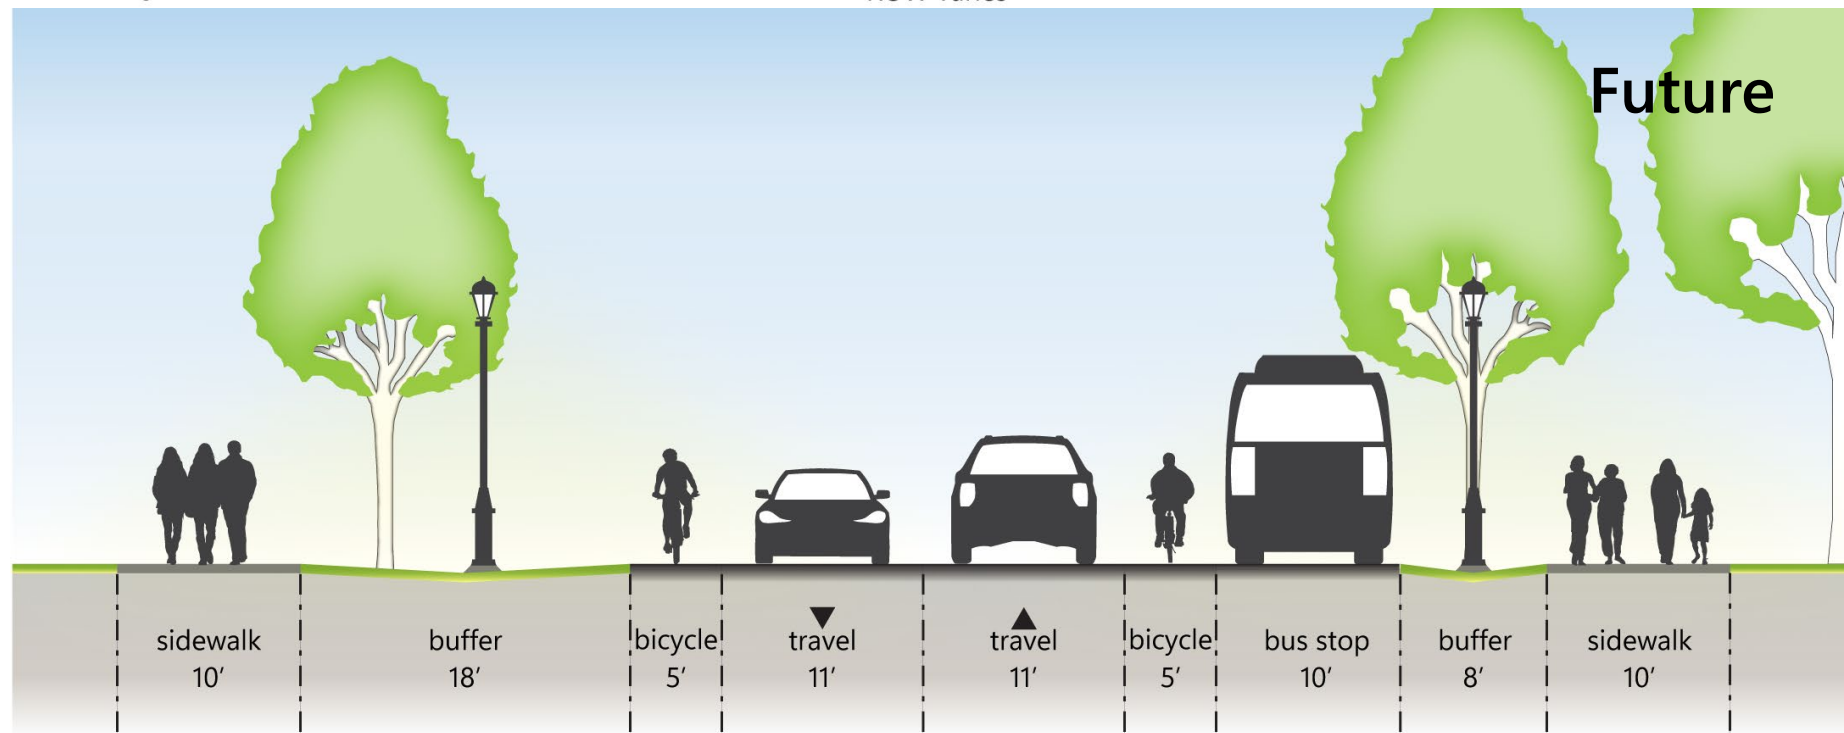

Section H - Future



ROW varies

US 98 West of Airport Road

- Coordination issues with FDOT during current PD&E study
 - Status of Marler Bridge replacement
 - Operational improvements at intersections (US 98 and Stahlman Avenue)
 - Pedestrian pathway under the bridge
 - Intersection design – safety for all users
 - Ultimate design condition back of curb for sidewalks and buffer zone
 - Utilities relocation
 - Lighting and landscape
 - Location of transit stops and transit operations
 - Wayfinding

Gulf Shore Drive


- Better utilization of ROW (lane reassignment) for the four travel lanes and continuous turn lane
- Increase safety for drivers and others
- Pedestrian and bicycle facilities
- Bus stop location and design
- Gateway to Holiday Isle
 - Lighting and landscape

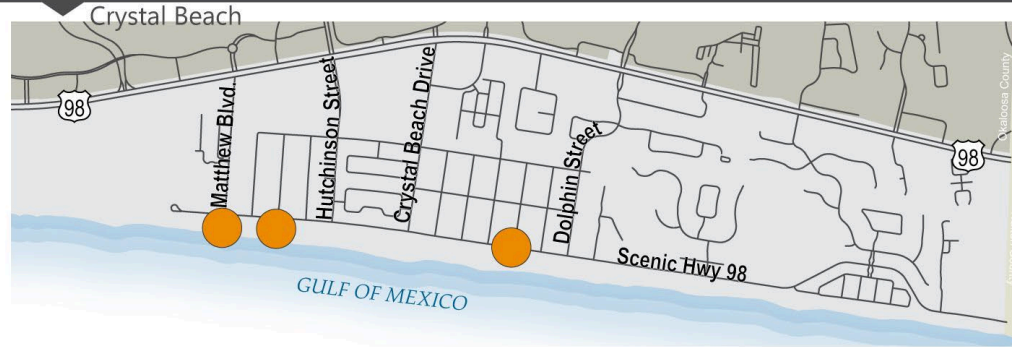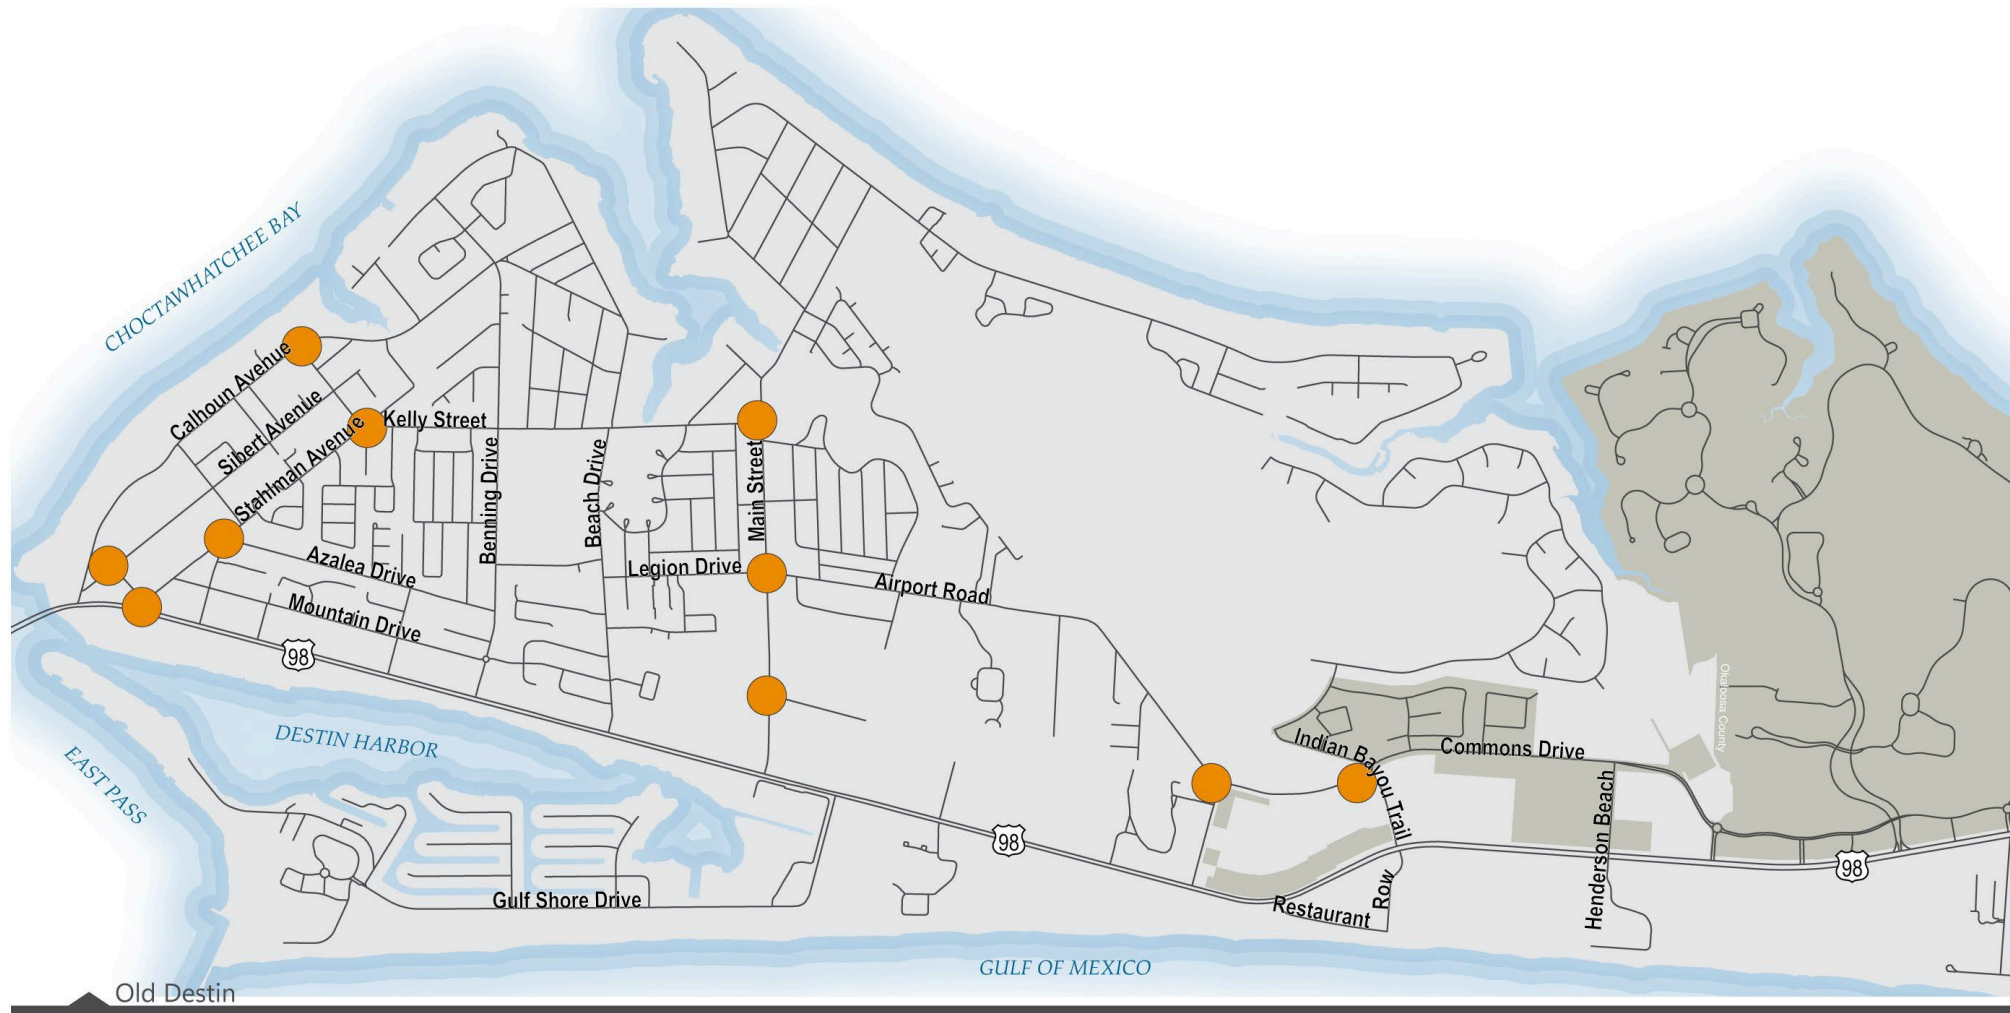

MOBILITY PLAN | Intersection Improvements


● Safety and Connectivity Opportunity



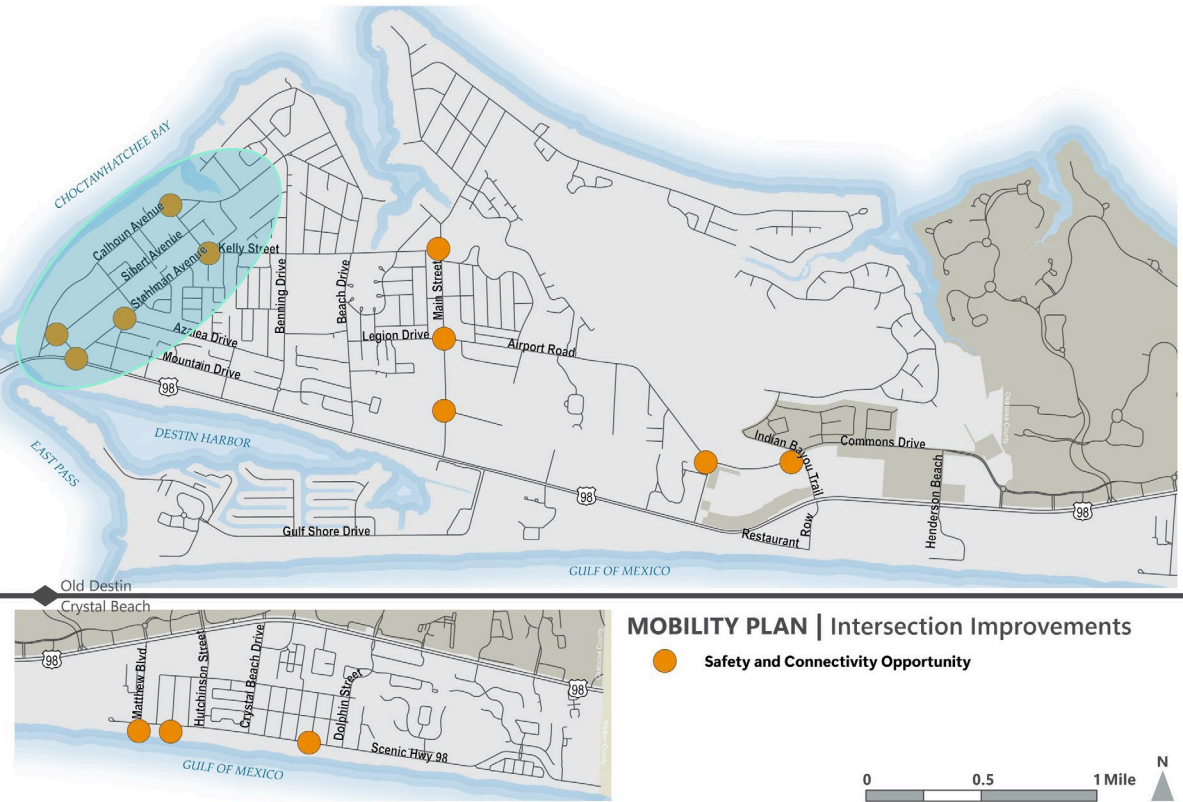


Intersection Improvements West

- Stahlman Avenue/Zerbe Street @ US 98 – Cross Town Connector – Pedestrian facilities linking public parking and Harbor
- Stahlman Avenue @ Azalea Drive – Cross Town Connector – Skew angles and lack of pedestrian crossing
- Stahlman Avenue @ Kelly Street
- Calhoun Avenue @ Sibert Avenue – Pedestrian facilities linking public parking and Harbor
- Calhoun Avenue @ Kelly Street – Traffic calming, east-west bicycle connection

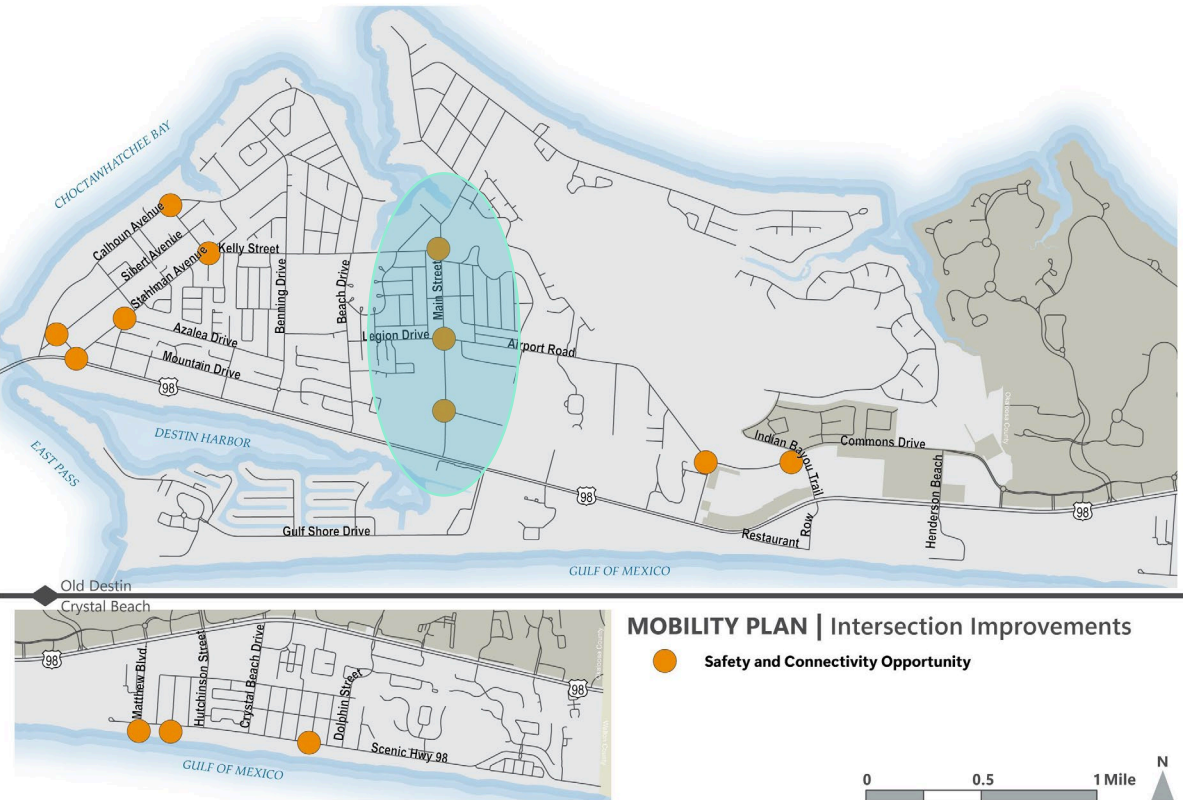


Intersection Improvements Main Street

- Main Street @ Legion Drive/Airport Road – Cross Town Connector, transition between 2 and 4 lane
- Main Street @ 98 Palms Boulevard
- Main Street @ Kelly Street – Pedestrian safety, traffic calming, east-west bicycle connection

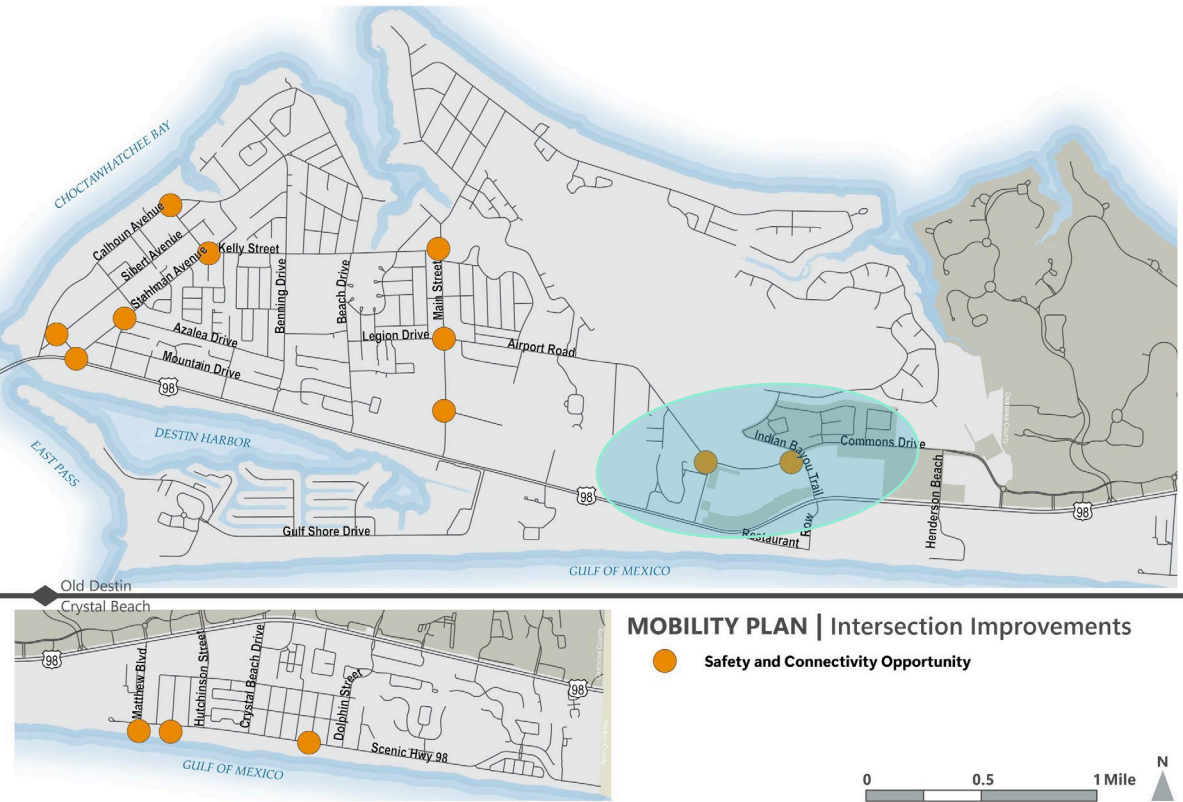

Intersection Improvements Commons Drive

- Commons Drive @ Airport Road – Cross Town Connector, connection to Gulf Power Linear Park
- Commons Drive @ Indian Bayou Trail – Cross Town Connector – Bike ramp connection to sidewalk, complete sidewalks and crossings

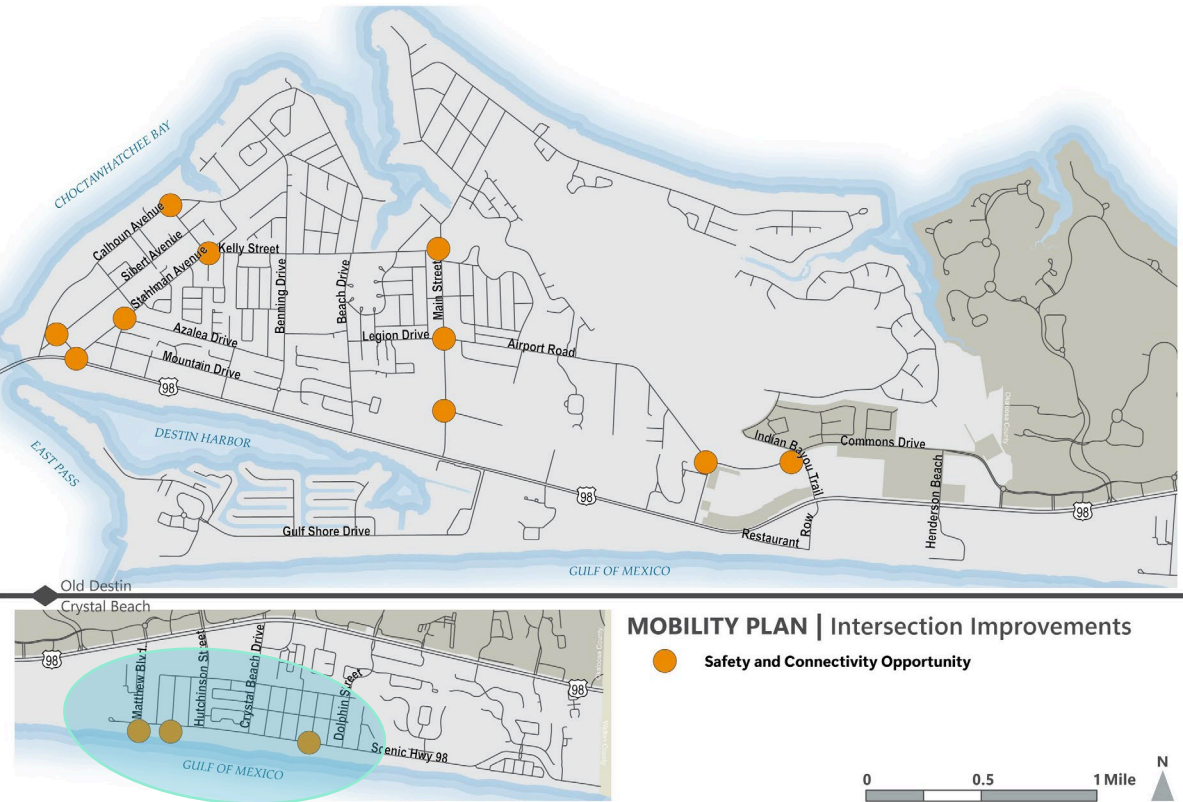

Intersection Improvements Scenic 98

- Scenic 98 @ Matthew Boulevard – Bicycle and pedestrian connection between US 98 and Scenic 98
- Scenic 98 @ Shirah Street – Mid-block crossing links to beach access
- Scenic 98 @ Pompano Street – Mid-block crossing links to beach access

SMALL PROJECT INITIATIVES

- Construct John Avenue between Dolphin and Sunfish Streets
- Construct Pine Street between Blue Marlin Court and Sibert
- Construct Sailfish Drive between Sailfish Circle and Azalea Drive
- Acquire ROW and construct roadway between Indian Trail and Indian Bayou North
- Roundabout at First and 4th Streets @ Benning Drive
- Provide 6' sidewalks on all local streets in Crystal Beach, prioritize streets with beach accesses to the Gulf
- Transportation infrastructure linked to stormwater improvements

POLICY AND PROJECT INITIATIVES

- Continuous multimodal facilities for east to west connection/Cross Town
- Intersection improvements that address safety and connectivity
- US 98 strategy west of Airport Road
- Gulf Shore Drive reconfiguration
- Improvements at local intersections
- Main Street streetscape improvements
- Coordinated transit and park and ride strategy
- Parking strategy for harbor district
- Gulf Power Linear Park and Trail
- Sidewalks on both sides of street
- Implement sidewalk and other street requirements for new development

Next Steps

- Complete scoping and cost estimating for priority projects
- Update and publish a draft project list
- Map recommended projects
- Vet, refine and prioritize projects

DESTIN PUBLIC WORKS/SAFETY COMMITTEE



WORK PLAN FOR FISCAL YEAR 2024

Respectfully Submitted,

15 Aug 2023

James T. Wood Jr.
Chairman, PW/S Committee

John Green
Vice Chairman, PW/S Committee

Public Works/Safety Committee

Work Plan for Fiscal Year 2024

The Public Works/Safety (PW/S) Committee is pleased to submit to the Destin City Council the committee's Fiscal Year 2024 Work Plan.

Public Works/Safety Committee

The Public Works/Safety committee is comprised of seven (7) members, each serving four-year terms consecutive with that of the Councilor making the nomination. The committee members elect a new Committee Chairperson and Vice Chairperson following new city elections once new committee members are chosen at the first available meeting.

MEETING DATE/TIME: The second (2nd) Tuesday of each month at 5:30 p.m. The meeting location is the City Hall Annex facility across Commons Drive from the main City Hall facility (the current City Council Meeting location).

STAFF LIAISON: Public Services Department

MISSION STATEMENT: The Public Works/Safety committee's purpose is to identify and review various functional areas relating to public works and safety, including street construction and maintenance, public parking areas and sidewalks, City rights-of-way, and the like; assess the need for projects relating to matters of public safety including, but not limited to, traffic signals, streetlights, crosswalks and emergency management information; and to staff recommendations to City Council. The committee's objectives shall be based upon implementation of the City's Comprehensive Plan. An additional mission assigned by the City Council is to serve as the City Surtax Committee making recommendations to the City Council on use of funds from the recent Okaloosa County ½ cent sales tax referendum.

Florida Sunshine Compliance: The Public Works / Safety Committee as an advisory committee to the Destin City Council is required by law to operate within Florida Governmental Sunshine Laws. The practical impact of the law is to limit all of your conversations with fellow committee members on topics currently or potentially coming before the committee to the meeting itself and no conversations outside of the meetings. Additionally, and purely as a recommendation, when e-mailed by staff as a meeting/issue topic, never select "reply to all" as other committee members may have been addressed on the original e-mail. Selecting "reply to all" is not in itself a violation; but may inadvertently lead to comments between committee members that could then be construed as violations of the law.

How to Join the Committee: <https://www.cityofdestin.com/FormCenter/City-Clerk-9/Committee-Volunteer-Application-57> (fill and submit the application on-line).

General Goals of the PW/S Committee: review all identified areas and provide recommendations to the Destin City Council as needed.

1. Provide Destin's citizenry a venue for raising community issues in the public works and safety arenas. The PW/S Committee will then research, prioritize and provide recommendations for funding to the Destin City Council.
 - a. The Committee Chairperson will ensure that briefings and other informational venues are provided to members so that they can be educated on critical issues.
 - b. Committee members will attend informational events and ensure that they are educated to the maximum extent possible so that quality recommendations can be provided to the Destin City Council
2. Review 5 - Year Pedestrian Facilities Plans: Pathways Master Plan, sidewalk plan, road resurfacing plan, roadway restriping plan and evaluate alternatives and prioritize for implementation.
3. Support citywide concerns by re-initiating meeting with the City Manager, Community Development Director, Community Redevelopment Committee Manager, Public Information Manager, City Attorney, Destin Fire Control District including the Beach Safety Division and Okaloosa County Sheriff's Office and other Federal and State Agencies as the opportunity arises. Publicize results in local newspapers or on City's website to promote greater public awareness.
4. Provide an avenue for citizen concerns and input on stormwater management issues including:
 - a. Localized flooding issues
 - b. Drainage system failures
 - c. City wide Stormwater Master Plan Update
 - d. Stormwater Utility Fee adoption
5. Initiate and monitor the Committee's high priority points of interest including the following:
 - a. Committee's roll in implementation of the City's Fiscal Year 2024 Strategic Goals

-
- b. Vision Triangle/Median Safety
 - c. Lifeguard/Beach Safety Program
 - d. Safety on US Highway 98
6. Monitor specific area assignments and report safety concerns and make recommendations at monthly committee meetings.
7. Provide an avenue for citizen concerns and input on right-of-way safety issues including:
- a. Speed Hump Policy
 - b. Roadway Safety Audits
 - c. Low Speed Vehicle (LSV) safety
 - d. Street Lighting
8. Serve as an advisory committee to the Destin City Council recommending projects for funding from the recent Okaloosa County ½ cent sales tax referendum. Approximately 10% of the annual funds will be set aside for committee project recommendations.

Staff: Public Services Representative, Public Services Director, Assistant City Clerk

PUBLIC WORKS/PUBLIC SAFETY COMMITTEE

James T. Wood Jr – Chairman

John Green – Vice Chairman

Tom Weidenhamer

Marcie Bell

Curtis Smith


John Stephens

Sam Perman

CITY OF DESTIN
PUBLIC WORKS/PUBLIC SAFETY COMMITTEE
AREA ASSIGNMENTS AS OF JAN 2021

- Review assigned area at least monthly for any safety concerns.
- Review area for proper signage, condition of roads, sidewalks, bike paths, medians, streetlights, drainage, etc.
- Review any citizens/homeowners' association concerns/recommendations.
- Report concerns/recommendations at monthly committee meetings.

Area Map

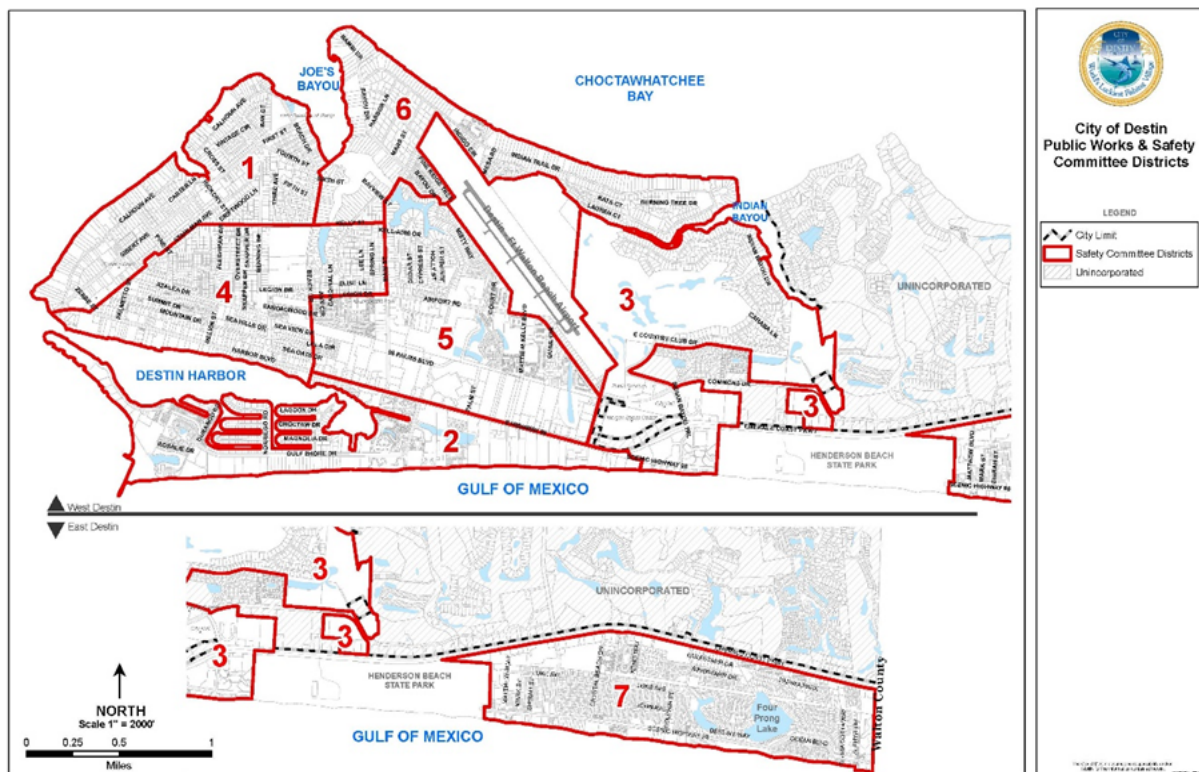

1. Weidenhamer / 2. Bell / 3. Smith
4. Stephens / 5. Wood / 6. Green / 7. Perman

Annual Meeting Plan:

Month	Date of Meeting	Main Meeting Topic	Coordinating Notes
Oct 2023	10	FPL/Okaloosa Gas	
Nov 2023	14	Emerald Coast Regional Council – TPO Annual Priorities	
Dec 2023	12	DWU Operational Update	
Jan 2024	9	Review of member areas (Top 2 issues per zone)	
Feb 2024	13	DFD/Beach Safety/ OSCO Spring Break	
Mar 2024	12	Hurricane Prep	
April 2024	9	Roadway/Striping/Sidewalk Priorities	
May 2024	14	Fiscal Year Spending Priorities	
Jun 2024	11	Mid-Bay Bridge Authority	
Jul 2024	9	FY2025 Work Plan Discussion/Approval	
Aug 2024	13	FY2025 Work Plan Discussion/Approval	
Sept 2024	10	Present Work Plan to Council	

All presentations should be planned for approx. 10-15 minutes. If a decision or recommendation is desired the presentation should provide options for consideration along with cost estimates if applicable.

The PW/PS committee will also request to review development plans or other city upgrades that may impact on any area where the committee has advisory capacity.

CITY OF DESTIN



AGENDA ITEM

COUNCIL MEETING DATE: July 18, 2023

TYPE OF AGENDA ITEM: Presentation

AGENDA OUTLINE NUMBER: 4.E.

TO: City Council

THRU: Lance Johnson, City Manager
Ryan Scott, City Engineer

FROM: Michael Burgess, Public Services Director

DATE: 06/08/2023

SUBJECT: ADA Transition Plan for Pedestrian Facilities, Draft Report and Presentation

I. BACKGROUND: The City started the process to develop an ADA Transition Plan in 2020 with Phase I (Field Survey). The presentation provided is the culmination of both Phase I and Phase II which was the prioritization and cost estimation to remedy those deficiencies identified.

II. DISCUSSION: This is an informational item. Staff is continuing to work with Baskerville Donovan to finalize the report.

Attachments include:

Final Draft ADA Transition Plan

Cost Estimates by Priority Location

A. Link to Strategic Goals / Objectives: I. Financially Sound City providing Service Excellence

II. Enhanced Quality of Life and Safety for Families

IV. Effective, Efficient, and Aesthetically Pleasing Infrastructure

V. Improve Mobility and Connectivity

B. Effect on Budget (EOB): Recommendations for funding the identified improvements are identified within the Draft Plan on page 15. They are as follows:

FY24 - FY28 \$383,046 annually (priority 1 & 2)

FY29 - FY33 \$426,312 annually (priority 3)

C. Level of Service (LOS): This is an informational item. Funding to start the implementation of this plan will be included in our FY24 Capital budget request under RR054 (Transportation.)

D. Legislative Sponsor:

III. **CONCLUSION**: This is an informational item.

IV. **RECOMMENDED MOTION**: No motion is required.

Attachments:

1. Final Draft, Destin ADA Transition Plan
2. Destin ADA Transition Plan, Final Estimate by Priority Location
3. Destin ADA Transition Plan Report Transmittal

CITY OF DESTIN ADA TRANSITION PLAN PHASE II

TRANSITION REPORT

CITY OF DESTIN PUBLIC WORKS

MAY 2023



Job No. 48201.02

Project Manager
Michael Langston, P.E.
Florida P.E. #49463

Project Engineer
Jason Frick, P.E.
Florida P.E. #88469



449 West Main Street Pensacola,
Florida 32502
Engineering Business: EB-0000340
850-438-9661



Table of Contents

Introduction 2

 Priority Classification 2

 Report of Findings 2

 Purpose and Objectives 2

 Project Location 4

 Scope of the Transition Plan Project 4

 Public Involvement and Input 4

 City of Destin Grievance Procedure 4

 Transition Plan 5

 Priority Locations by Ranking 7

 Summary of Deficiencies 10

 Estimates of Probable Cost 13

 Summary Estimates by Priority Location 14

 Funding and Schedule of Implementation 14

 New Construction Projects 14

Phase I Existing Condition Site Inspections and Data Collection 15

 Study Limits 15

 Equipment Used 15

 Content of Data Collection 15

 Appendices 18



Introduction

The City of Destin has developed the Americans with Disabilities Act (ADA) Transition Plan to improve accessibility and address obstacles within the city's walking paths. The plan aligns with federal standards and aims to benefit the public by ensuring compliance with accessibility guidelines. It identifies barriers to accessibility and provides a roadmap for implementation to achieve a higher level of inclusivity. This transition plan has been executed in two phases, with Phase II encompassing data collection on improvements made since Phase I, analysis of deficiencies, assessment of hindrances to access, and a high-level cost analysis to inform future repair planning.

Priority Classification

The City has categorized its areas into three priority levels: Priority 1, Priority 2, and Priority 3. These classifications were determined based on ADA guidelines, the significance of access within the city, and input from the public. The priorities are as follows:

Priority 1: Collector class roadways, government buildings, and public transportation stops.

Priority 2: Parks, beach access, and boat launches.

Priority 3: All other areas maintained by the city.

Report of Findings

Phase I involved identifying elements that impede accessibility within the designated areas. These findings were compiled into a comprehensive report, which underwent review by city staff and was presented to the public during a meeting at the City Annex on February 24, 2023. Valuable feedback and comments from stakeholders were incorporated into the report, resulting in the development of the transition plan outlined in this document.

Purpose and Objectives

The City of Destin's administration and City Council are dedicated to providing accessible pedestrian infrastructure within the city limits. To fulfill this commitment, city staff, supported by consultants from Baskerville-Donovan, Inc., conducted an evaluation of the public walking infrastructure. The evaluation has led to the creation of this transition plan, which will serve as a guiding document for future planning, budgeting, and improvements to facilities identified as having accessibility barriers. By following this plan, the community will gain access to major travel routes, local roads, government buildings, transit stops, beaches, and parks, fostering inclusivity for all residents and visitors.

Title II of the Americans with Disabilities Act (ADA): Ensuring Accessibility in the City of Destin

The Americans with Disabilities Act (ADA), established in 1990, is a federal civil rights law that prohibits discrimination based on disabilities. It covers various domains, including employment, state and local



government, public accommodations, commercial facilities, transportation, and telecommunications. The U.S. Department of Justice (DOJ) oversees the implementation of this law, issuing regulations, standards, and technical assistance to ensure compliance.

Title II of the ADA specifically applies to state and local government agencies, including the City of Destin. It encompasses a wide range of facilities, services, programs, activities, and events. However, this transition plan primarily focuses on improving accessibility in pedestrian walking facilities maintained by the City of Destin. It represents the initial step towards achieving an accessible standard, with potential inclusion of other city-maintained features in the future, as budgetary considerations permit.

Program Accessibility under 28 CFR Part 35, Subpart D

The program accessibility regulations outlined in 28 CFR Part 35, Subpart D, govern the implementation of Title II ADA requirements. This subpart emphasizes that each service, program, or activity, when viewed comprehensively, must be readily accessible and usable by individuals with disabilities. It also allows flexibility for addressing accessibility concerns by considering programs in their entirety.

Transition Plan Requirements under 28 CFR 35.150(d)

The Transition Plan, as stipulated in 28 CFR 35.150(d), mandates that a public entity employing 50 or more individuals must develop a plan within six months of January 26, 1992, outlining the necessary steps to achieve program accessibility through structural changes to facilities. The public entity must provide an opportunity for interested individuals with disabilities or organizations representing them to participate in the plan's development by submitting comments. Additionally, the plan must be made available for public inspection.

If a public entity has jurisdiction over streets, roads, or walkways, its transition plan must include a schedule for providing curb ramps or other sloped areas at pedestrian crossings. Priority should be given to walkways serving entities covered by the ADA, including state and local government offices and facilities, transportation, places of public accommodation, and employers. The plan must fulfill certain minimum requirements, including:

Identification of physical obstacles in the public entity's facilities that limit program accessibility for individuals with disabilities.

A detailed description of the methods to be employed for achieving accessibility in the facilities.

Specification of a schedule for implementing the necessary steps to achieve compliance. If the transition plan extends beyond one year, it should outline the actions to be taken during each year of the transition period.

Indication of the official responsible for implementing the plan.

In cases where a public entity has already complied with the transition plan requirements of a Federal agency public meeting regulation implementing Section 504 of the Rehabilitation Act of 1973, the requirements in this paragraph (d) apply only to policies and practices not previously included in the transition plan.



Project Location

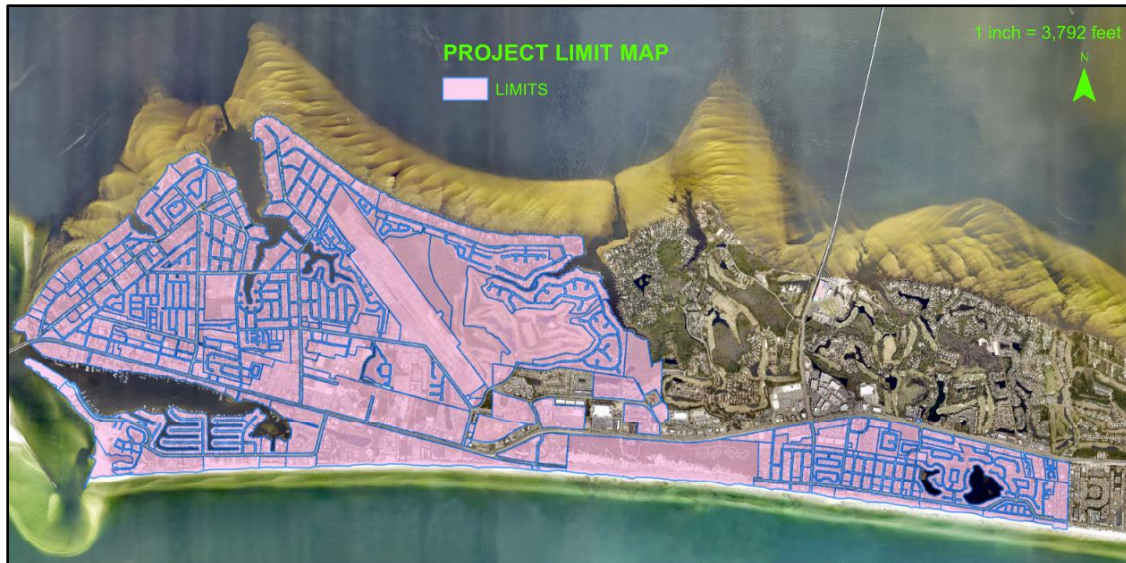


Figure 1 Project Limits Map

Scope of the Transition Plan Project

The Transition Plan project focuses on the public walking infrastructure within the City of Destin limits. This encompasses sidewalks, curb ramps, and ramps with railings. However, certain areas were excluded from the survey and report, including regions without sidewalks, gated communities, and sections along U.S. 98, which falls under the authority of the Florida Department of Transportation (FDOT).

Public Involvement and Input

To ensure comprehensive community involvement, the development of this Transition Plan incorporated input from local stakeholders, organizations, and individuals dedicated to promoting accessibility. A public meeting was conducted on February 24, 2023, at the city annex. The meeting was widely advertised, allowing attendees to ask questions and provide comments regarding the summary of the findings report. Public comments were accepted until the close of business on Friday, March 3rd. It is worth noting that no public comments were received during this period.

City of Destin Grievance Procedure

In adherence to Title II of the ADA, the City of Destin has implemented a grievance procedure to address reports or complaints related to Title II services, programs, and activities within the city. For reference, the City of Destin Grievance Procedure can be found in **Appendix A** of this document.

The designated ADA Coordinator for the City of Destin is:



Michael Burgess
4200 Indian Bayou Trail
Destin, FL 32541
850-837-4242
ADACoordinator@cityofdestin.com

Transition Plan

Evaluating Accessibility and Prioritizing Improvements

The transition plan plays a crucial role in defining the evaluation criteria that will be utilized to identify obstacles to accessibility, prioritize locations, establish location boundaries, quantify deficiencies, and estimate the costs and timeline for implementing the plan.

Evaluation Criteria

The initial evaluation focused on comprehensive data collection of existing public access routes. The evaluation aimed to identify barriers by comparing them against the following criteria:

- Compliance with the Americans with Disabilities Act (ADA) 2010 Design Standards.
- Florida Accessibility Code.
- Public input and opinions on public access.

Tables 1 to 3 provide an overview of the specific criteria employed in the ADA evaluation of sidewalks, curb ramps, and ramps with railings. These criteria have been derived from the 2012 Florida Accessibility Code for Building Construction.

Table 1 Sidewalk Criteria

Sidewalks		
Walking Surface Components	Accessibility Criteria	Reference Section
Cross Slope Maximums	2.0% Maximum	Chapter 4 section 403.3
Running Slope Maximums	1:20 Maximum	Chapter 4 section 403.3
Openings/Gaps	½ inch Maximum	Chapter 3 section 302.3
Changes in Level	¼ inch or ½ inch if beveled Maximum	Chapter 3 sections 303.2 and 303.3 and Exception
Clear Width Minimums	36 inches but can be reduced to 32 inches minimum for a maximum length of 24 inches. Multiple segments must be separated by 48 inches	Chapter 4 section 403.5.1 and Exception



Table 2 Curb Ramp Criteria

Curb Ramps		
Curb Ramp Components	Accessibility Criteria	Reference Section
Running Slope Maximums	8.33% Maximum	Chapter 4 section 405.2
Cross Slope Maximums	2.0% Maximum	Chapter 4 section 405.3
Openings/Gaps	½ inch Maximum	Chapter 3 section 302.3
Changes in Level	¼ inch or ½ inch if beveled Maximum	Chapter 3 sections 303.2 and 303.3 and Exception
Detectable Warning Device	Does the ramp provide a Detectable Warning	Chapter 4 section 406.8
Detectable Warning Device Damage	Does the Detectable Warning Device Have Damage	Chapter 4 section 406.8
Clear Length of Landing	36" Minimum	Chapter 4 section 406.4
Clear Width of Landing	36" Minimum	Chapter 4 section 406.4
Ramp Width	36" Minimum	Chapter 4 section 403.5.1 and Exception

Table 3 Ramps with Railings Criteria

Ramps with Railings		
Ramp and Railing Components	Accessibility Criteria	Reference Section
Running Slope Maximums	8.33% Maximum	Chapter 4 section 405.2
Cross Slope Maximums	2.0% Maximum	Chapter 4 section 405.3
Clear Width where handrails are provided	36 inches minimum	Chapter 4 section 405.5
Ramp Rise and Length	30 inches maximum and limited to 30 feet at 1:12 slope	Chapter 4 section 405.6
Ramp Landing	Must contain a landing	Chapter 4 sections 405.7 and 405.7.4
Clear Width of Landing	36" Minimum	Chapter 4 section 405.7.2
Length of Landing	60 inches minimum	Chapter 4 section 405.7.3
Handrails	Required with runs greater than 6 inches	Chapter 4 section 405.8 and comply with 505
Handrails on both sides and continuous	Left and Right Handrails shall be Provided and continuous	Chapter 5 sections 505.2 and 505.3
Handrail height	Between 34 inches minimum and 38 inches maximum	Chapter 5 section 505.4
Handrail Extensions and Returns	Shall Extend 12 inches beyond the top and bottom runs and shall return to a wall, guard, or the landing surface	Chapter 5 section 505.10.1



Priority Locations by Ranking

In this section, locations within the city are categorized based on their access priority, designated as Priority 1, Priority 2, and Priority 3. These rankings help identify key points of interest throughout the city and are crucial for prioritizing accessibility improvements. The rankings presented in this report were developed for the summary of findings and were subject to public input and comments.

The priority locations include the following:

Priority 1:

Collector-class roadways
Local government buildings
Intersections
Roadways serving public transportation

Priority 2:

Parks
Beach accesses

Priority 3:

Other city-maintained pedestrian routes

These rankings guide the allocation of resources and efforts in addressing accessibility barriers within each category. By focusing on priority locations, the transition plan ensures a systematic approach to improving accessibility throughout the city.

Priority 1 rankings

Category_1A: Collector class roadway intersections

	Major Collector	Limits
1A-100	Stahlman Ave. South	U.S. Hwy. 98 to Benning Dr.
1A-101	Benning Dr.	U.S. Hwy. 98 to Calhoun Ave.
1A-102	Beach Dr.	U.S. Hwy. 98 to Bay Ct.
1A-103	Main Street	98 Palms Blvd to Indian Trail
1A-104	Gulf Shore Dr. West	Noriego Point to Durango Rd.
1A-105	Matthew Boulevard	U.S. Hwy. 98 to Scenic Hwy. 98
1A-106	Hutchinson Street	U.S. Hwy. 98 to Scenic Hwy. 98
1A-107	Kelly Street	Calhoun Ave. to Stahlman Ave.
1A-108	Azalea Dr.	Benning Dr. to Stahlman Ave.
1A-110	Legion Dr. East	Beach Dr. to Main St.
1A-111	Airport Rd.	U.S. Hwy. 98 to Main St.
1A-112	Commons Boulevard	Airport Rd. to Indian Bayou Trail
1A-113	Scenic Hwy. 98 East	East of Matthew Blvd. to Chateau La Mar



	Minor Collector	Limits
1A-114	Calhoun Ave.	U.S. Hwy. 98 to Carter Lane
1A-115	Sibert Ave.	Calhoun Ave. to East of Kelly St.
1A-116	Cross Street	Calhoun Ave. to South of Sibert Ave.
1A-118	Mountain Dr.	Stahlman Ave. to Beach Dr.
1A-119	Gulf Shore Dr. East	Durango Rd. to U.S. 98
1A-120	Legion Dr. West	Benning Dr. to Beach Dr.
1A-122	Indian Trail	Bayou Dr. to Indian Bayou North
1A-123	98 Palms Boulevard	Main Street to U.S. Hwy. 98
1A-124	Mattie M. Kelly Boulevard	Airport Rd. Extending south then east
1A-126	Indian Bayou Trail	Country Club Dr. to U.S. Hwy. 98
1A-127	Restaurant Row	U.S. Hwy. 98 South
1A-128	Scenic Hwy. 98 West	West of Henderson Beach State Park
1A-130	Crystal Beach Dr.	U.S. Hwy. 98 Scenic Hwy. 98
1A-131	Dolphin Street	Luke Ave. south to Scenic Hwy. 98

Category_1B: Intersections and Roadway Segments Serving Local Government Buildings.

	Government Buildings	Limits
1B-132	Destin Library	Adjacent Stahlman Ave.
1B-133	Community Center	Adjacent Stahlman Ave.
1B-134	Destin Fishing Museum	Adjacent Stahlman Ave. to Hwy. 98.
1B-135	Destin City Annex	Indian Bayou Trail
1B-136	Destin Maintenance Facility	Adjacent on Commons Dr. to Airport Rd.
1B-137	Lifeguard Station	South of Grand Palms Boulevard
1B-138	Emergency Vehicles	South of Grand Palms Boulevard
1B-139	Destin City Hall	Entrance to City Hall on Indian Bayou Trail

Category_1C: Intersections and roadways serving public transportation access EC Rider Stops

	Public Transportation Stop	Limits
1C-140	98 Palms Plaza	South of 98 Palms Plaza
1C-141	Crystal Beach Plaza	East and West Crystal Beach Plaza
1C-142	Holiday Inn Express and Suites	Entrance to Holiday Inn Express
1C-143	Destin Downtown Shopping Center	East side of Main Street between Hwy. 98 and 98 Palms Blvd.
1C-145	Sandpiper Cove	Entrance to Sandpiper Cove
1C-147	Waterview Towers	Entrance to Waterview Towers
1C-148	East Pass Towers	Entrance to East Pass Towers
1C-149	Gulf Breeze Ct. and Gulf Shores Dr	Entrance to Gulf Breeze Ct.



1C-150	Destin Pointe/Jetty East	Entrance at Melrose Ave.
1C-151	Holiday Surf and Racquet Club - Gulf Shores Dr	Entrance to Holiday Surf and Racquet Club
1C-152	Destin On The Gulf - Gulf Shores Dr	Entrance to Destin on the Gulf
1C-154	Benning Dr and Harbor Blvd	East Side of Benning Dr. between Hwy. 98 and Mountain Dr.
1C-169	Windgate by Windham	Limits of Palm Street to Hwy. 98
1C-172	The Inn at Crystal Beach	Entrance to the Inn at Crystal Beach
1C-173	Crystal Sands	Entrance to Crystal Sands
1C-174	James Lee Park	Entrance to James Lee Park
1C-177	Hampton Inn	Entrance to Hampton Inn
1C-178	Back Porch Restaurant - Scenic Hwy. 98	Entrance to Back Porch Restaurant

Priority 2 rankings

Category_2A Parks/Beach Parks/Beach Trails

	Parks	Limits
2A-200	Captain Leonard Destin Park	Entrance to Leonard Destin Park on Calhoun
2A-201	Clement Taylor Park	Entrance to Clement Taylor Park on Calhoun
2A-205	Nancy Weidenhammer Dog Park	North Side of Commons Dr. between Indian Bayou and Airport Rd.
2A-206	Morgan Sports Complex	East of Airport Rd. and south of Commons Dr.
2A-207	Buck Destin Park	Entrance to Buck Destin Park on Legion Dr.
2A-208	Dalton Threadgill Park	South Side of Hickory from Calhoun to Stahlman Ave.
2A-210	Kell-Aire Nature Walk	Juniper Street to Juniper Ct.to Kell Aire Dr.
2A-211	Main Street Park	Main Street between Bayview Street and Bayou Dr.
2A-212	Mattie Kelly Park and Nature Walk	Mattie Kelly Park Entrance on Beach Dr.
2A-213	June White Decker Park	Entrance to June White Decker Park on Restaurant Row
2A-214	Norriego Point Beach Access	West end of Gulf Shore Dr.
2A-215	The Shore at Crystal Beach Park	Entrance to Shore at Crystal Beach Park south Side of Scenic Hwy. 98
2A-218	O'Steen Beach Trail	South side of Gulf Shore Dr. at Beach Access
2A-219	Calhoun Beach Trail	Calhoun Beach Access on the South Side of Scenic Hwy. 98
2A-220	Shirah St. Beach Trail `	Shirah St. to Entrance of Shirah St. Beach Trail



2A-221	Crystal Beach Trail Access	Entrance to Crystal Beach Trail on Scenic Hwy. 98.
2A-222	Barracuda St. Beach Trail	Barracuda St to Entrance of Barracuda St. Beach Trail
2A-223	Pompano St. Beach Trail	Pompano St. to Entrance of Pompano St. Beach Trail
2A-224	Tarpon St. Beach Trail	Tarpon St. to Entrance of Tarpon St. Beach Trail.
2A-225	Silver Shells Trail	South Side of Scenic Hwy. 98 between US 98 and Restaurant Row
2A-228	Kell Aire Park	Spanish Moss Trail to Juniper Ct.

Category_2B Boat Launches

	Boat Launch	Limits
2B-227	Joe's Bayou Boat Launch	Joe's Bayou Boat Launch Entrance on Beach Dr.

Priority 3 rankings

Category_3A All Other Areas

	All Areas not Previously Included	Limits
3A-667	All Other Surveyed Locations	Remaining Areas

Summary of Deficiencies

This section provides a general quantification of the deficiencies observed in the field within each priority location. The deficiencies are categorized into sections for sidewalks, curb ramps, and ramps with railings, along with associated barriers to accessibility. The quantities presented within each priority are intended to provide a comprehensive understanding of the accessibility challenges by location and are used to develop the cost estimates for future planning budgets.

Sidewalks

Barrier To Access	Quantity Identified
Cross Slope deviations greater than 2.00%	
Priority 1 Locations	489
Priority 2 Locations	79
Priority 3 Locations	807
Running slope deviations greater than 5.0%	
Priority 1 Locations	27
Priority 2 Locations	5
Priority 3 Locations	18



Openings/Gaps greater than ½"	
Priority 1 Locations	175
Priority 2 Locations	23
Priority 3 Locations	164
Changes in Level	
Priority 1 Locations	338
Priority 2 Locations	39
Priority 3 Locations	517
Clear Width	
Priority 1 Locations	2
Priority 2 Locations	1
Priority 3 Locations	5
Damaged Concrete	
Priority 1 Locations	87
Priority 2 Locations	14
Priority 3 Locations	76
Total Deficiencies	2866

Curb Ramps

Barrier To Access	Quantity Identified
Landing Lengths of less than 3 feet	
Priority 1 Locations	79
Priority 2 Locations	12
Priority 3 Locations	14
Ramps with slopes greater than 1:12 or 8.33%	
Priority 1 Locations	7
Priority 2 Locations	2
Priority 3 Locations	0
Cross-slope deviations greater than 2.00%	
Priority 1 Locations	10
Priority 2 Locations	0
Priority 3 Locations	0
Landing slope deviations greater than 2.0% in any direction	
Priority 1 Locations	91
Priority 2 Locations	15
Priority 3 Locations	0
Damaged/Missing detectable warning device	
Priority 1 Locations	156
Priority 2 Locations	58
Priority 3 Locations	187
Abrupt changes in level greater than ¼"	



Priority 1 Locations	11
Priority 2 Locations	2
Priority 3 Locations	0
Gaps or openings in the walking surface greater than ½"	
Priority 1 Locations	7
Priority 2 Locations	1
Priority 3 Locations	0
Ramp Widths less than 3 feet	
Priority 1 Locations	25
Priority 2 Locations	3
Priority 3 Locations	2
Damaged concrete	
Priority 1 Locations	33
Priority 2 Locations	6
Priority 3 Locations	69
Total Deficiencies	790

Ramps with Handrails

Barrier To Access	Quantity Identified
Ramp lengths over 30'	
Priority 1 Locations	0
Priority 2 Locations	0
Priority 3 Locations	0
Ramp running slopes greater than 8.33%	
Priority 1 Locations	2
Priority 2 Locations	0
Priority 3 Locations	0
Ramp cross slopes greater than 2.0%	
Priority 1 Locations	0
Priority 2 Locations	0
Priority 3 Locations	0
Ramp clear width less than 36"	
Priority 1 Locations	0
Priority 2 Locations	0
Priority 3 Locations	0
Ramp Landing slopes greater than 2.0% in any direction	
Priority 1 Locations	0
Priority 2 Locations	0
Priority 3 Locations	0
Ramp Landing lengths less than 60"	
Priority 1 Locations	0



Priority 2 Locations	0
Priority 3 Locations	0
Ramp Landing clear width less than 36"	
Priority 1 Locations	0
Priority 2 Locations	0
Priority 3 Locations	0
Handrails provided on only one side	
Priority 1 Locations	8
Priority 2 Locations	0
Priority 3 Locations	0
Handrails that are not continuous	
Priority 1 Locations	0
Priority 2 Locations	0
Priority 3 Locations	0
Handrail gripping surface below 34" or less than 38"	
Priority 1 Locations	0
Priority 2 Locations	0
Priority 3 Locations	0
Handrail extensions extending less than 12" horizontally above the landing.	
Priority 1 Locations	0
Priority 2 Locations	0
Priority 3 Locations	0
Damaged concrete	
Priority 1 Locations	4
Priority 2 Locations	0
Priority 3 Locations	0
Total Deficiencies	14

Estimates of Probable Cost

The estimates of probable cost have been developed based on recent bids for similar work in the area. Repair budgets were created using the field data collected during Phase I and compared with the defined limits in the Evaluation Criteria section. A reasonable replacement quantity was then applied to the unit costs for repairing each type of deficiency. The primary focus of repairs is expected to involve the removal and replacement of concrete, including the installation of detectable warning devices where applicable.

Data points for sidewalks were collected at intervals of approximately 100 feet, with observations made for damaged concrete, changes in elevation, and gaps between collection points. These observations were then captured at the subsequent data collection point.



A 15% contingency has been incorporated into the unit item cost to account for unforeseen field conditions and the multi-year nature of the project. It should be noted that this cost estimate presents a worst-case scenario, and some areas may require less extensive repair methods. Additionally, compliance may be technically infeasible in cases where the roadway profile and surrounding grades make it unreasonable to expect adjacent sidewalks to meet accessibility standards.

The following summary estimates are grouped based on priority location. **Appendix B** provides detailed estimates for each location.

Summary Estimates by Priority Location

The summary estimates provide an overview of the expected costs associated with improving accessibility at each priority location. These estimates serve as a guide for budgeting and planning purposes, ensuring that adequate resources are allocated to address accessibility barriers effectively. For more detailed cost breakdowns, please refer to **Appendix B**.

Priority Location 1 Repairs	\$1,653,130
Priority Location 2 Repairs	\$262,100
Priority Location 3 Repairs	\$2,131,562
Total Location Repairs	\$4,046,792

Funding and Schedule of Implementation

To fully fund the implementation of this transition plan, an estimated \$4,046,792 will be required over the course of 10 years. The recommended approach is to prioritize work on Priority 1 and Priority 2 locations during the first five years, with an annual budget of \$383,046. Priority 3 locations, which include residential areas, can be addressed during years 6 to 10, with an annual budget of \$426,312.

It is important to note that the budgets provided in **Appendix B** represent the anticipated total repairs and do not account for cost-saving offsets that may be realized from capital improvement projects. Any capital improvement projects that involve paving, roadway reconstruction, intersection work, drainage, signalization, or maintenance should include improvements to adjacent ADA facilities. The costs associated with these improvements should be subtracted from the ADA Transition Budget for the respective year.

New Construction Projects

The city has adopted a policy requiring all new construction projects for improvements within the city to comply with applicable accessibility standards and codes. It is recommended that, where practical, minimum standards provided by sources such as ADA Title II, The Access Board, and the Florida Accessibility Code be used. Additionally, seeking input from local users during programming and design phases is encouraged whenever possible to ensure that accessibility needs are met effectively.



By adhering to these guidelines, the city can ensure that accessibility considerations are integrated into all new construction projects, promoting inclusivity and compliance with accessibility standards and codes.

Phase I Existing Condition Site Inspections and Data Collection

Study Limits

The survey conducted for this transition plan was conducted within specific geographical boundaries. The western limit of the survey was set at the foot of the Marler Bridge, while the northern limit included Bayou Dr. and Indian Trail. The eastern limit extended to the entrance of Chateau La Mer on Scenic Hwy. 98, and the southern limit was set at Gulf Shore Dr. at Norriego Point Beach Access.

Data collection was focused on walking facilities within the authority of the city. Therefore, private gated communities and facilities along Hwy. 98 were excluded from the survey, as the maintenance and responsibility for those areas lie with other entities.

By establishing these study limits, the survey focused on the areas directly under the jurisdiction of the city and aimed to assess and address accessibility barriers within those boundaries.

Inspection Methodology

Equipment Used

For data collection and archiving purposes, digital software and GPS equipment were utilized. The Trimble R1 unit was employed to obtain location data with sub-meter accuracy. To record the attributes of the City's walking infrastructure, custom data collection menus were developed internally and implemented through the Survey 123 app. These menus were categorized into sidewalks, curb ramps, and ramps with railings. The captured data was stored in real-time using an ESRI cloud-based online server.

Content of Data Collection

Sidewalks

The evaluation of sidewalks was conducted in accordance with FDOT Design Standards Index 522-001 and the 2012 Florida Accessibility Code for Building Construction. Detailed assessments were conducted at 100-foot intervals, which included measurements of slope, identification of breaks in grade exceeding $\frac{1}{4}$ inch, identification of gaps or openings in the concrete greater than $\frac{1}{2}$ inch, and identification of any obstructions that would reduce the width of the walking path to less than 36 inches. Photographs were taken at each collection point and included in the accompanying data files.

Additionally, detailed field notes were provided at relevant locations to aid in future understanding of the conditions observed during data collection. These notes serve as valuable references for further analysis and planning.



Curb Ramps

During the data collection process, curb ramps were categorized based on FDOT Design Standards Index 522-002. The following types of curb ramps were included in the evaluation:

Parallel Curb Ramps: These curb ramps are designed to provide access to the sidewalk for individuals using wheelchairs or other mobility devices. They run parallel to the direction of the curb and provide a smooth transition from the street level to the sidewalk.

Perpendicular Curb Ramps: Perpendicular curb ramps are installed at intersections and provide access to pedestrians crossing the street. They are oriented perpendicular to the curb and allow for a safe and accessible transition between the sidewalk and the roadway.

Blended Transition Curb Ramps: Blended transition curb ramps are designed to blend the slope of the curb ramp with the adjacent sidewalk grade. They provide a smooth and seamless transition for pedestrians with disabilities and are typically used in areas where space is limited.

Detectable Warning Surface: Curb ramps often include detectable warning surfaces, which are tactile surfaces with distinctive patterns that provide sensory cues to individuals with visual impairments. These surfaces indicate the presence of a transition point from the pedestrian walkway to the vehicular area.

During the evaluation, the condition and compliance of each type of curb ramp were assessed, considering factors such as slope, dimensions, alignment, and detectable warning surfaces, to ensure they met the required accessibility standards.

CR-A	CR-F
CR-B	CR-G
CR-C	CR-H
CR-D	CR-K
CR-E	CR-L
Type 2 (Curbed Returns with radial sidewalk)	Type 3 (Linear sidewalk)
CR-X Undefined in the Field	

During the data collection process for ramps with handrails, visual identification was used to determine the type of ramp in the field. Measurements of dimensions and slopes were taken at each ramp location. The evaluation also included an inspection of the condition and compliance of the ramps and handrails according to the 2012 Florida Accessibility Code for Building Construction, FDOT Design Standards Index 515-051 (Steel Bridge Pedestrian/Bicycle Railing), and FDOT Design Standards Index 515-061 (Aluminum Bridge Pedestrian/Bicycle Railing).

The documentation at these facilities included identifying the number of ramps and landings at each location. Detailed measurements were taken for length, width, direction of travel, and cross slopes of the



ramps. The concrete condition was assessed for any damage, gaps, openings, or breaks in grade. The ramps and railings were evaluated based on the applicable FDOT Design Standards and the Florida Accessibility Code.

Photographs were taken at each collection point to provide visual documentation, and detailed notes were recorded to provide additional information about the existing conditions at each location.

Site inspections were conducted in accordance with the standards and specifications provided by the 2012 Florida Accessibility Code, Americans with Disabilities Act (ADA), and other relevant resources. The observations and recommendations in the inspection reports are based on these regulatory standards and specifications. The recommendations consider barriers identified during the inspection and may include improvements beyond the minimum standards, considering public input and other factors.

It should be noted that recommendations for improvements may go beyond the minimum standards and consider options beyond what is required by the regulations.



Appendices

DRAFT



Appendix A

City of Destin Grievance Procedure

DRAFT

ADA Grievance Policy & Procedure

1. PURPOSE:

This ADA Grievance Policy & Procedure is established to meet the requirements of the Americans with Disabilities Act of 1990, as amended. It may be used by anyone who wishes to file a complaint alleging discrimination on the basis of disability in the provision of services, activities, programs, or benefits by the City of Destin. The City of Destin's Human Resources Policy governs employment-related complaints of disability discrimination.

2. REFERENCES:

Americans with Disabilities Act of 1990, as amended. 42 U.S.C. § 12101

3. POLICY & PROCEDURE:

A. The complaint should be in writing and contain information about the alleged discrimination such as name, address, phone number of complainant and location, date, and description of the problem. Alternative means of filing complaints, such as personal interviews or a tape recording of the complaint, will be made available for persons with disabilities upon request. If you require a different format to file a complaint, please contact the City's ADA Title II Coordinator using the contact information provided below.

B. If a person with a disability is unable to access program, service, or activity of the City of Destin, they are encouraged to contact the ADA Title II Coordinator either via postal service at 4200 Indian Bayou Trail, Destin, FL 32541, call (850) 837-4242, email ADACoordinator@cityofdestin.com or submit a form via the City's Help Desk Portal (Report a Problem/Let Us Know link). Through this interactive process, the ADA Title II Coordinator will work with the individual to discuss the issue and explore options for improving access to the program, service or activity.

C. The City of Destin will make all reasonable modifications to policies and programs to ensure that people with disabilities have an equal opportunity to enjoy all of its programs, services, and activities. No surcharge on a particular individual with a disability or any group of individuals with disabilities to cover the cost of providing auxiliary aids/services or reasonable modifications of policy, such as retrieving items from locations that are open to the public but are not accessible to persons who use wheelchairs will be assessed.

D. Within 15 calendar days after receipt of the complaint, the ADA Coordinator or their designee will meet with the complainant to discuss the complaint and the possible

resolutions. Within 15 calendar days of the meeting, ADA Coordinator or their designee will respond in writing, and where appropriate, in a format accessible to the complainant, such as large print, Braille, or audio recording. The response will explain the position of the City of Destin and offer options for substantive resolution of the complaint.

E. If the response by ADA Coordinator or their designee does not satisfactorily resolve the issue, the complainant and/or his/her designee may appeal the decision within 15 calendar days after receipt of the response to the City Manager or his/her designee. Within 15 calendar days after receipt of the appeal, the City Manager or his/her designee will meet with the complainant to discuss the complaint and possible resolutions. Within 15 calendar days after the meeting, the City Manager or his/her designee will respond in writing, and, where appropriate, in a format accessible to the complainant, with a final resolution of the complaint.

4. **RECORDKEEPING**

All written and/or electronic complaints received by the ADA Coordinator or his/her designee, appeals to the City Manager or his/her designee, and responses from these two offices will be retained according to the Florida Records Retention Statutes and Laws.



Lance A. Johnson
City Manager

Attachments:

1. None



Appendix B
Estimates of Probable Cost

DRAFT

Unit Cost

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 6,045.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Missing detectable warning device	Install detectable warning device	1	1	\$ 519.80	\$ 519.80
	Missing or Damaged Detectable Warning Device	Remove and replace detectable warning device	1	1	\$ 634.80	\$ 634.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	3596	\$ 3,596.00
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	1	1	3596	\$ 3,596.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	1	1	3596	\$ 3,596.00
	Damaged concrete	Remove and replace Curb Ramp		1	3596	\$ -
Subtotal						\$ 12,921.89
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	1	150	\$ 12.09	\$ 1,813.50
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	1	150	\$ 12.09	\$ 1,813.50
	Ramp clear width less than 36"	SF Remove and Replace Concrete	1	150	\$ 12.09	\$ 1,813.50
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Handrails provided on only one side	LF handrail install	1	30	\$ 185.20	\$ 5,555.88
	Handrails that are not continuous	LF handrail install	1	30	\$ 185.20	\$ 5,555.88
	Handrail gripping surface below 34" or less than 38"	LF handrail install	1	30	\$ 185.20	\$ 5,555.88
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	1	30	\$ 185.20	\$ 5,555.88
	Damaged concrete	SF Remove and Replace Concrete	1	85	\$ 12.09	\$ 1,027.65
Subtotal						\$ 29,900.67
Grand Total						\$ 31,411.92

Priority 1 Total

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	489	125	\$ 12.09	\$ 739,001.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	27	125	\$ 12.09	\$ 40,803.75
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	175	50	\$ 12.09	\$ 105,787.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	338	50	\$ 12.09	\$ 204,321.00
	Clear Width	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Damaged Concrete	SF Remove and Replace Concrete	87	125	\$ 12.09	\$ 131,478.75
Subtotal						\$ 1,221,996.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	79	25	\$ 12.09	\$ 23,877.75
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	7	28	\$ 12.09	\$ 2,369.64
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	10	28	\$ 12.09	\$ 3,385.20
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	91	25	\$ 12.09	\$ 27,504.75
	Missing or Damaged detectable warning device	Remove and replace detectable warning device	156	1	\$ 519.80	\$ 81,088.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	11	1	\$ 634.80	\$ 6,982.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	7	1	\$ 3,596.00	\$ 25,172.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	25	1	\$ 3,596.00	\$ 89,900.00
	Damaged concrete	Remove and replace Curb Ramp	33	1	\$ 3,596.00	\$ 118,668.00
Subtotal						\$ 378,948.94
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	2	150	\$ 12.09	\$ 3,627.00
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	8	30	\$ 185.20	\$ 44,447.04
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	4	85	\$ 12.09	\$ 4,110.60
Subtotal						\$ 52,184.64
Grand Total						\$1,653,130.33

Priority 2 Totals

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	79	125	\$ 12.09	\$ 119,388.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	5	125	\$ 12.09	\$ 7,556.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	23	50	\$ 12.09	\$ 13,903.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	39	50	\$ 12.09	\$ 23,575.50
	Clear Width	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged Concrete	SF Remove and Replace Concrete	14	125	\$ 12.09	\$ 21,157.50
Subtotal						\$ 185,883.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	12	25	\$ 12.09	\$ 3,627.00
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	2	28	\$ 12.09	\$ 677.04
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	15	25	\$ 12.09	\$ 4,533.75
	Damaged or missing detectable warning device	Remove and replace detectable warning device	58	1	\$ 519.80	\$ 30,148.40
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	2	1	\$ 634.80	\$ 1,269.60
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	3	1	\$ 3,596.00	\$ 10,788.00
	Damaged concrete	Remove and replace Curb Ramp	6	1	\$ 3,596.00	\$ 21,576.00
Subtotal						\$ 76,215.79
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 262,099.54

Priority 3 Totals

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	807	125	\$ 12.09	\$ 1,219,578.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	18	125	\$ 12.09	\$ 27,202.50
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	164	50	\$ 12.09	\$ 99,138.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	517	50	\$ 12.09	\$ 312,526.50
	Clear Width	SF Remove and Replace Concrete	5	25	\$ 12.09	\$ 1,511.25
	Damaged Concrete	SF Remove and Replace Concrete	76	125	\$ 12.09	\$ 114,855.00
Subtotal						\$ 1,774,812.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	14	25	\$ 12.09	\$ 4,231.50
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	187	1	\$ 519.80	\$ 97,202.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
	Damaged concrete	Remove and replace Curb Ramp	69	1	\$ 3,596.00	\$ 248,124.00
Subtotal						\$ 356,750.10
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 2,131,562.10

Total All Locations

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1,375	125	\$ 12.09	\$ 2,077,968.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	50	125	\$ 12.09	\$ 75,562.50
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	362	50	\$ 12.09	\$ 218,829.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	894	50	\$ 12.09	\$ 540,423.00
	Clear Width	SF Remove and Replace Concrete	8	25	\$ 12.09	\$ 2,418.00
	Damaged Concrete	SF Remove and Replace Concrete	177	125	\$ 12.09	\$ 267,491.25
Subtotal						\$ 3,182,692.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	105	25	\$ 12.09	\$ 31,736.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	9	28	\$ 12.09	\$ 3,046.68
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	10	28	\$ 12.09	\$ 3,385.20
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	106	25	\$ 12.09	\$ 32,038.50
	Damaged detectable warning device	Remove and replace detectable warning device	401	1	\$ 519.80	\$ 208,439.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	13	1	\$ 634.80	\$ 8,252.40
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	8	1	\$ 3,596.00	\$ 28,768.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	30	1	\$ 3,596.00	\$ 107,880.00
	Damaged concrete	Remove and replace Curb Ramp	108	1	\$ 3,596.00	\$ 388,368.00
Subtotal						\$ 811,914.83
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ 4,110.60
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	2	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	8	30	\$ 185.20	\$ 44,447.04
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	4	85	\$ 12.09	\$ 4,110.60
Subtotal						\$ 52,184.64
Grand Total						\$ 4,046,791.97

1A-100. Stahlman Avenue

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	26	125	\$ 12.09	\$ 39,292.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	11	50	\$ 12.09	\$ 6,649.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	31	50	\$ 12.09	\$ 18,739.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
Subtotal						\$ 70,726.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	3	28	\$ 12.09	\$ 1,015.56
	Missing or Damaged Detectable Warning Device	Remove and replace detectable warning device	1	1	\$ 519.80	\$ 519.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
Subtotal						\$ 5,131.36
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 75,857.86

1A-101. Benning Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	35	125	\$ 12.09	\$ 52,893.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	23	50	\$ 12.09	\$ 13,903.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	36	50	\$ 12.09	\$ 21,762.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
Subtotal						\$ 91,581.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	7	25	\$ 12.09	\$ 2,115.75
	Damaged detectable warning device	Remove and replace detectable warning device	12	1	\$ 519.80	\$ 6,237.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
Subtotal						\$ 16,186.12
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 107,767.87

1A-102. Beach Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	58	125	\$ 12.09	\$ 87,652.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	4	50	\$ 12.09	\$ 2,418.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	24	50	\$ 12.09	\$ 14,508.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 107,601.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	44	25	\$ 12.09	\$ 13,299.00
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	5	25	\$ 12.09	\$ 1,511.25
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	13	1	\$ 3,596.00	\$ 46,748.00
	Damaged concrete	Remove and replace Curb Ramp	5	1	\$ 3,596.00	\$ 17,980.00
Subtotal						\$ 80,916.37
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 188,517.37

1A-103. Main Street

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	31	125	\$ 12.09	\$ 46,848.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	5	125	\$ 12.09	\$ 7,556.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	9	50	\$ 12.09	\$ 5,440.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	12	50	\$ 12.09	\$ 7,254.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	14	125	\$ 12.09	\$ 21,157.50
Subtotal						\$ 88,257.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	4	28	\$ 12.09	\$ 1,354.08
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	3	25	\$ 12.09	\$ 906.75
	Damaged detectable warning device	Remove and replace detectable warning device	6	1	\$ 519.80	\$ 3,118.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	2	1	\$ 634.80	\$ 1,269.60
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	3	1	\$ 3,596.00	\$ 10,788.00
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 18,041.73
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 106,298.73

1A-104. Gulf Shore Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	7	125	\$ 12.09	\$ 10,578.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	4	50	\$ 12.09	\$ 2,418.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	4	50	\$ 12.09	\$ 2,418.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 15,414.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	8	1	\$ 519.80	\$ 4,158.40
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	3	1	\$ 3,596.00	\$ 10,788.00
Subtotal						\$ 15,581.20
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 30,995.95

1A-105. Matthew Boulevard

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	4	125	\$ 12.09	\$ 6,045.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 6,045.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	3	25	\$ 12.09	\$ 906.75
	Damaged detectable warning device	Remove and replace detectable warning device	6	1	\$ 519.80	\$ 3,118.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
Subtotal						\$ 11,858.32
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 17,903.32

1A-106. Hutchinson Street

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	7	125	\$ 12.09	\$ 10,578.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 13,299.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 640.77
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 13,939.77

1A-107. Kelly Street

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	31	125	\$ 12.09	\$ 46,848.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	8	50	\$ 12.09	\$ 4,836.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	17	50	\$ 12.09	\$ 10,276.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
Subtotal						\$ 66,495.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	5	25	\$ 12.09	\$ 1,511.25
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 2,550.85
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 69,045.85

1A-108. Azalea Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	8	125	\$ 12.09	\$ 12,090.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	4	50	\$ 12.09	\$ 2,418.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	6	50	\$ 12.09	\$ 3,627.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 19,646.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	3	25	\$ 12.09	\$ 906.75
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
Subtotal						\$ 9,138.35
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 28,784.60

1A-110. Legion Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	6	125	\$ 12.09	\$ 9,067.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	11	50	\$ 12.09	\$ 6,649.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 18,437.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	3	25	\$ 12.09	\$ 906.75
	Damaged detectable warning device	Remove and replace detectable warning device	4	1	\$ 519.80	\$ 2,079.20
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
Subtotal						\$ 11,151.27
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 29,588.52

1A-111. Airport Road

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	25	125	\$ 12.09	\$ 37,781.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	6	50	\$ 12.09	\$ 3,627.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	12	50	\$ 12.09	\$ 7,254.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	10	125	\$ 12.09	\$ 15,112.50
Subtotal						\$ 63,774.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	9	25	\$ 12.09	\$ 2,720.25
	Damaged detectable warning device	Remove and replace detectable warning device	16	1	\$ 519.80	\$ 8,316.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Damaged concrete	Remove and replace Curb Ramp	4	1	\$ 3,596.00	\$ 14,384.00
Subtotal						\$ 33,217.55
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 96,992.30

1A-112. Commons Boulevard

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 4,231.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 338.52
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 4,570.02

1A-113. Scenic Highway 98 East

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	28	125	\$ 12.09	\$ 42,315.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	7	50	\$ 12.09	\$ 4,231.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	13	50	\$ 12.09	\$ 7,858.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	8	125	\$ 12.09	\$ 12,090.00
Subtotal						\$ 69,517.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	13	25	\$ 12.09	\$ 3,929.25
	Damaged detectable warning device	Remove and replace detectable warning device	16	1	\$ 519.80	\$ 8,316.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Damaged concrete	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
Subtotal						\$ 27,869.35
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 97,386.85

1A-114. Calhoun Avenue

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	40	125	\$ 12.09	\$ 60,450.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	3	125	\$ 12.09	\$ 4,533.75
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	27	50	\$ 12.09	\$ 16,321.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	41	50	\$ 12.09	\$ 24,784.50
	Clear Width	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged Concrete	SF Remove and Replace Concrete	5	125	\$ 12.09	\$ 7,556.25
Subtotal						\$ 113,948.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	15	25	\$ 12.09	\$ 4,533.75
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	15	1	\$ 519.80	\$ 7,797.00
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Damaged concrete	Remove and replace Curb Ramp	4	1	\$ 3,596.00	\$ 14,384.00
Subtotal						\$ 37,502.75
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 151,451.00

1A-115. Sibert Avenue

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	8	125	\$ 12.09	\$ 12,090.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	19	50	\$ 12.09	\$ 11,485.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	43	50	\$ 12.09	\$ 25,993.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	4	125	\$ 12.09	\$ 6,045.00
Subtotal						\$ 55,614.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	3	25	\$ 12.09	\$ 906.75
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	6	25	\$ 12.09	\$ 1,813.50
	Damaged detectable warning device	Remove and replace detectable warning device	16	1	\$ 519.80	\$ 8,316.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	#####	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	#####	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	#####	\$ -
Subtotal						\$ 11,375.57
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 66,989.57

1A-116. Cross Street

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	6	125	\$ 12.09	\$ 9,067.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	7	50	\$ 12.09	\$ 4,231.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 16,019.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	3	25	\$ 12.09	\$ 906.75
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
Subtotal						\$ 5,542.35
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 21,561.60

1A-118. Mountain Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	21	125	\$ 12.09	\$ 31,736.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	4	125	\$ 12.09	\$ 6,045.00
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	10	50	\$ 12.09	\$ 6,045.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	5	125	\$ 12.09	\$ 7,556.25
Subtotal						\$ 52,591.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	10	25	\$ 12.09	\$ 3,022.50
	Damaged detectable warning device	Remove and replace detectable warning device	4	1	\$ 519.80	\$ 2,079.20
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 5,101.70
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 57,693.20

1A-119. Gulf Shore Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	34	125	\$ 12.09	\$ 51,382.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	3	125	\$ 12.09	\$ 4,533.75
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	13	50	\$ 12.09	\$ 7,858.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	11	50	\$ 12.09	\$ 6,649.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	11	125	\$ 12.09	\$ 16,623.75
Subtotal						\$ 87,048.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Damaged detectable warning device	Remove and replace detectable warning device	4	1	\$ 519.80	\$ 2,079.20
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
Subtotal						\$ 14,076.20
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 101,124.20

1A-120 Legion Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	8	125	\$ 12.09	\$ 12,090.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	3	50	\$ 12.09	\$ 1,813.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	3	50	\$ 12.09	\$ 1,813.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	3	125	\$ 12.09	\$ 4,533.75
Subtotal						\$ 20,250.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 20,250.75

1A-122. Indian Trail Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	32	125	\$ 12.09	\$ 48,360.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	7	50	\$ 12.09	\$ 4,231.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	15	50	\$ 12.09	\$ 9,067.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	4	125	\$ 12.09	\$ 6,045.00
Subtotal						\$ 69,215.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Damaged detectable warning device	Remove and replace detectable warning device	10	1	\$ 519.80	\$ 5,198.00
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 6,775.82
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 75,991.07

1A-123. 98 Palms Boulevard

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 1,209.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 1,209.00

1A-124. Mattie M. Kelly Bouleva

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	1	1	\$ 519.80	\$ 519.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,154.60
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 1,154.60

1A-126. Indian Bayou Trail

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 1,511.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,239.30
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 2,750.55

1A-127. Restaurant Row

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	4	125	\$ 12.09	\$ 6,045.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 7,858.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	28	\$ 12.09	\$ 677.04
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,281.54
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 9,140.04

1A-128. Scenic Highway 98 West

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 2,418.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	28	\$ 12.09	\$ 677.04
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 677.04
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 3,095.04

1A-130. Crystal Beach Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	15	125	\$ 12.09	\$ 22,668.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	11	50	\$ 12.09	\$ 6,649.50
	Clear Width	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 30,225.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	6	25	\$ 12.09	\$ 1,813.50
	Damaged detectable warning device	Remove and replace detectable warning device	13	1	\$ 519.80	\$ 6,757.40
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Damaged concrete	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
Subtotal						\$ 27,826.47
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 58,051.47

1A-131. Dolphin Street

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	4	1	\$ 519.80	\$ 2,079.20
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 2,381.45
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 2,381.45

1B-132. Destin Library

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 4,836.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 4,836.00

1B-133. Community Center

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 1,511.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,039.60
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	8	30	\$ 185.20	\$ 44,447.04
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	4	85	\$ 12.09	\$ 4,110.60
Subtotal						\$ 48,557.64
Grand Total						\$ 51,108.49

1B-134. Destin Fishing Museum

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	3	50	\$ 12.09	\$ 1,813.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 5,440.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 3,898.25
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 9,338.75

1B-135. Destin City Annex

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ -

1B-136. Destin Maint. Facility

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 2,720.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 2,720.25

1B-137. Lifeguard Station

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 634.80
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 634.80

1B-138. Emergency Vehicles

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ -

1B-139. City Hall Entrance

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ -

1C-140. 98 Palms Plaza

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	10	125	\$ 12.09	\$ 15,112.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	5	50	\$ 12.09	\$ 3,022.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	3	125	\$ 12.09	\$ 4,533.75
Subtotal						\$ 23,273.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 3,898.25
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 27,171.50

1C-141. Crystal Beach Plaza

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 3,324.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 3,324.75

1C-142. Holiday In Express

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ -

1C-143. Destin Downtown Shoppin

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	5	125	\$ 12.09	\$ 7,556.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	3	50	\$ 12.09	\$ 1,813.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
Subtotal						\$ 14,508.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 14,508.00

1C-145. Sandpoper Cove North

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	5	125	\$ 12.09	\$ 7,556.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 8,160.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 4,200.50
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 12,361.25

1C-146. Gulf Shores Dr.

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ -

1C-147. Waterview Towers

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
Subtotal						\$ 8,231.60
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 8,231.60

1C-148. East Pass Towers

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 3,022.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	1	1	\$ 519.80	\$ 519.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 822.05
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 3,844.55

1C-149. Gulf Breeze Ct.

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,976.65
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 1,976.65

1C-150. Destin Pointe Jetty Ea

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 1,511.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 1,511.25

1C-151. Holiday Surf & Racquet

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	4	125	\$ 12.09	\$ 6,045.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 8,160.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 8,160.75

1C-152. Destin on the Gulf

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	7	125	\$ 12.09	\$ 10,578.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 10,578.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 10,578.75

1C-154. Benning Dr. & Harbor B

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	4	50	\$ 12.09	\$ 2,418.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 8,160.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	1	1	\$ 519.80	\$ 519.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	#####	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	#####	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	#####	\$ -
Subtotal						\$ 822.05
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 8,982.80

1C-169. Windgate by Windham

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	3	50	\$ 12.09	\$ 1,813.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 6,951.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 6,951.75

1C-172. The Inn at Crystal Bea

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	3	125	\$ 12.09	\$ 4,533.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
Subtotal						\$ 9,974.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
Subtotal						\$ 4,937.85
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 14,912.10

1C-173. Crystal Sands

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	6	125	\$ 12.09	\$ 9,067.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 11,787.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,039.60
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 12,827.35

1C-174. James Lee Park

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 1,511.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 1,511.25

1C-177. Hampton Inn

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 3,627.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 3,627.00

1C-178. Back Porch Restaurant

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ -

2A-200. Captain Leonard Destin

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	4	125	\$ 12.09	\$ 6,045.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	3	50	\$ 12.09	\$ 1,813.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	8	50	\$ 12.09	\$ 4,836.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 12,694.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,644.10
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 14,338.60

2A-201. clement Taylor Park

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 3,627.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 3,627.00

2A-205. Nancy Weidenhammer par

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
Subtotal						\$ 5,742.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 5,742.75

2A-206. Morgan Sports Complex

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	12	125	\$ 12.09	\$ 18,135.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
Subtotal						\$ 22,366.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 22,366.50

2A-207. Buck Destin Park

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 4,533.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	1	1	\$ 519.80	\$ 519.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 519.80
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 5,053.55

2A-208. Dalton Threadgill Park

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	7	125	\$ 12.09	\$ 10,578.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	8	50	\$ 12.09	\$ 4,836.00
	Clear Width	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 17,832.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	1	1	\$ 519.80	\$ 519.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 822.05
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 18,654.80

2A-210. Kell-Aire Nature Walk

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 4,836.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Damaged detectable warning device	Remove and replace detectable warning device	3	1	\$ 519.80	\$ 1,559.40
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
Subtotal						\$ 13,888.95
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 18,724.95

2A-211. Main Street Park

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	10	125	\$ 12.09	\$ 15,112.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	6	50	\$ 12.09	\$ 3,627.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	6	50	\$ 12.09	\$ 3,627.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	5	125	\$ 12.09	\$ 7,556.25
Subtotal						\$ 31,434.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	3	1	\$ 519.80	\$ 1,559.40
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,559.40
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 32,993.40

2A-212. Mattie Kelly Park

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	4	125	\$ 12.09	\$ 6,045.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	4	50	\$ 12.09	\$ 2,418.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	8	50	\$ 12.09	\$ 4,836.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 13,299.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	5	25	\$ 12.09	\$ 1,511.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	5	1	\$ 519.80	\$ 2,599.00
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	3	1	\$ 3,596.00	\$ 10,788.00
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 14,898.25
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 28,197.25

2A-213. June White Decker Park

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 3,022.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 3,022.50

2A-214. Norriego Point Beach A

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	1	1	\$ 519.80	\$ 519.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 519.80
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 519.80

2A-215. The Shore at Crystal Be

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 2,720.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	4	1	\$ 519.80	\$ 2,079.20
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 2,417.72
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 5,137.97

2A-218. O'Steen Beach Trail

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	1	1	\$ 519.80	\$ 519.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 519.80
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 519.80

2A-219. Calhoun Beach Trail

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 1,511.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 1,511.25

2A-220. Shirah St. Beach Trail

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	8	125	\$ 12.09	\$ 12,090.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 14,205.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Damaged detectable warning device	Remove and replace detectable warning device	5	1	\$ 519.80	\$ 2,599.00
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
Subtotal						\$ 6,799.50
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 21,005.25

2A-221. Crystal Beach Trail Acc

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 1,511.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,341.85
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 2,853.10

2A-222. Barracuda St. Trail

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	6	125	\$ 12.09	\$ 9,067.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 11,787.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	4	25	\$ 12.09	\$ 1,209.00
	Damaged detectable warning device	Remove and replace detectable warning device	7	1	\$ 519.80	\$ 3,638.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
						\$ 8,443.60
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 20,231.35

2A-223. Pompano St. Beach Trail

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	5	125	\$ 12.09	\$ 7,556.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 8,765.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	3	25	\$ 12.09	\$ 906.75
	Damaged detectable warning device	Remove and replace detectable warning device	7	1	\$ 519.80	\$ 3,638.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
Subtotal						\$ 8,782.12
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 17,547.37

2A-224. Tarpon St. Beach Trail

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 3,022.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	6	1	\$ 519.80	\$ 3,118.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
Subtotal						\$ 7,319.30
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 10,341.80

2A-225. Silver Shells Trail

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 1,511.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 1,511.25

2A-228 Kell Aire Park

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	8	125	\$ 12.09	\$ 12,090.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 13,601.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	3	25	\$ 12.09	\$ 906.75
	Damaged detectable warning device	Remove and replace detectable warning device	10	1	\$ 519.80	\$ 5,198.00
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 6,739.55
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 20,340.80

2B-227 Joes Bayou Boat Launch

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	3	125	\$ 12.09	\$ 4,533.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 7,858.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 7,858.50



Appendix C
Public Meeting Presentation

DRAFT

City of Destin ADA Transition Plan
Phase II



PUBLIC INFORMATION MEETING AGENDA

Friday, February 24th, 9:00 AM
City Hall Annex 4100 Indian Bayou Trail
Destin, FL 32541
(850)-837-4242

1. Introduction

- a. Purpose for the public meeting
 - i. Present the plan developed and ask for input from the community to further develop the priority locations.

2. ADA Coordinator and role responsibilities

- a. Michael Burgess interim ADA Coordinator
 - i. City plan for a full-time staff position

3. City of Destin grievance process

- a. Draft grievance process
 - i. City plan to develop and adopt the grievance process.

4. Discussion on full implementation of the transition plan

- a. Future phases will include parks and public buildings.

5. PowerPoint presentation Covering Phase I and II for City Rights-of-Way

- a. Phase I data collection scope and methods
- b. Phase II priority rankings within the City.

6. Conclusion and instruction for comment cards.

City of Destin ADA Transition Plan
Phase II



PUBLIC INFORMATION MEETING AGENDA

Friday, February 24th, 9:00 AM
City Hall Annex 4100 Indian Bayou Trail
Destin, FL 32541
(850)-837-4242

1. Introduction

- a. Purpose for the public meeting
 - i. Present the plan developed and ask for input from the community to further develop the priority locations.

2. ADA Coordinator and role responsibilities

- a. Michael Burgess interim ADA Coordinator
 - i. City plan for a full-time staff position

3. City of Destin grievance process

- a. Draft grievance process
 - i. City plan to develop and adopt the grievance process.

4. Discussion on full implementation of the transition plan

- a. Future phases will include parks and public buildings.

5. PowerPoint presentation Covering Phase I and II for City Rights-of-Way

- a. Phase I data collection scope and methods
- b. Phase II priority rankings within the City.

6. Conclusion and instruction for comment cards.



ADA Transition Plan Phase II 2023



- Purpose of the ADA Transition plan
 - Americans with Disabilities Act of 1990, Specifically, Title II
- Importance of Accessibility within the community

Transition Plan Phase I


An architectural drawing or blueprint is visible in the background, showing various lines, dimensions, and technical specifications. It appears to be a site plan or a detailed drawing of a building or infrastructure project.

- **Phase I Data Collection within the City Rights-of-way:**
- **Inventory and conditions of the existing pedestrian facilities including sidewalks, curb ramps and ramps.**
- **Create the City of Destin Dashboard to facilitate progress of the plan implementation.**

Transition Plan Phase I



Transition Plan Phase I

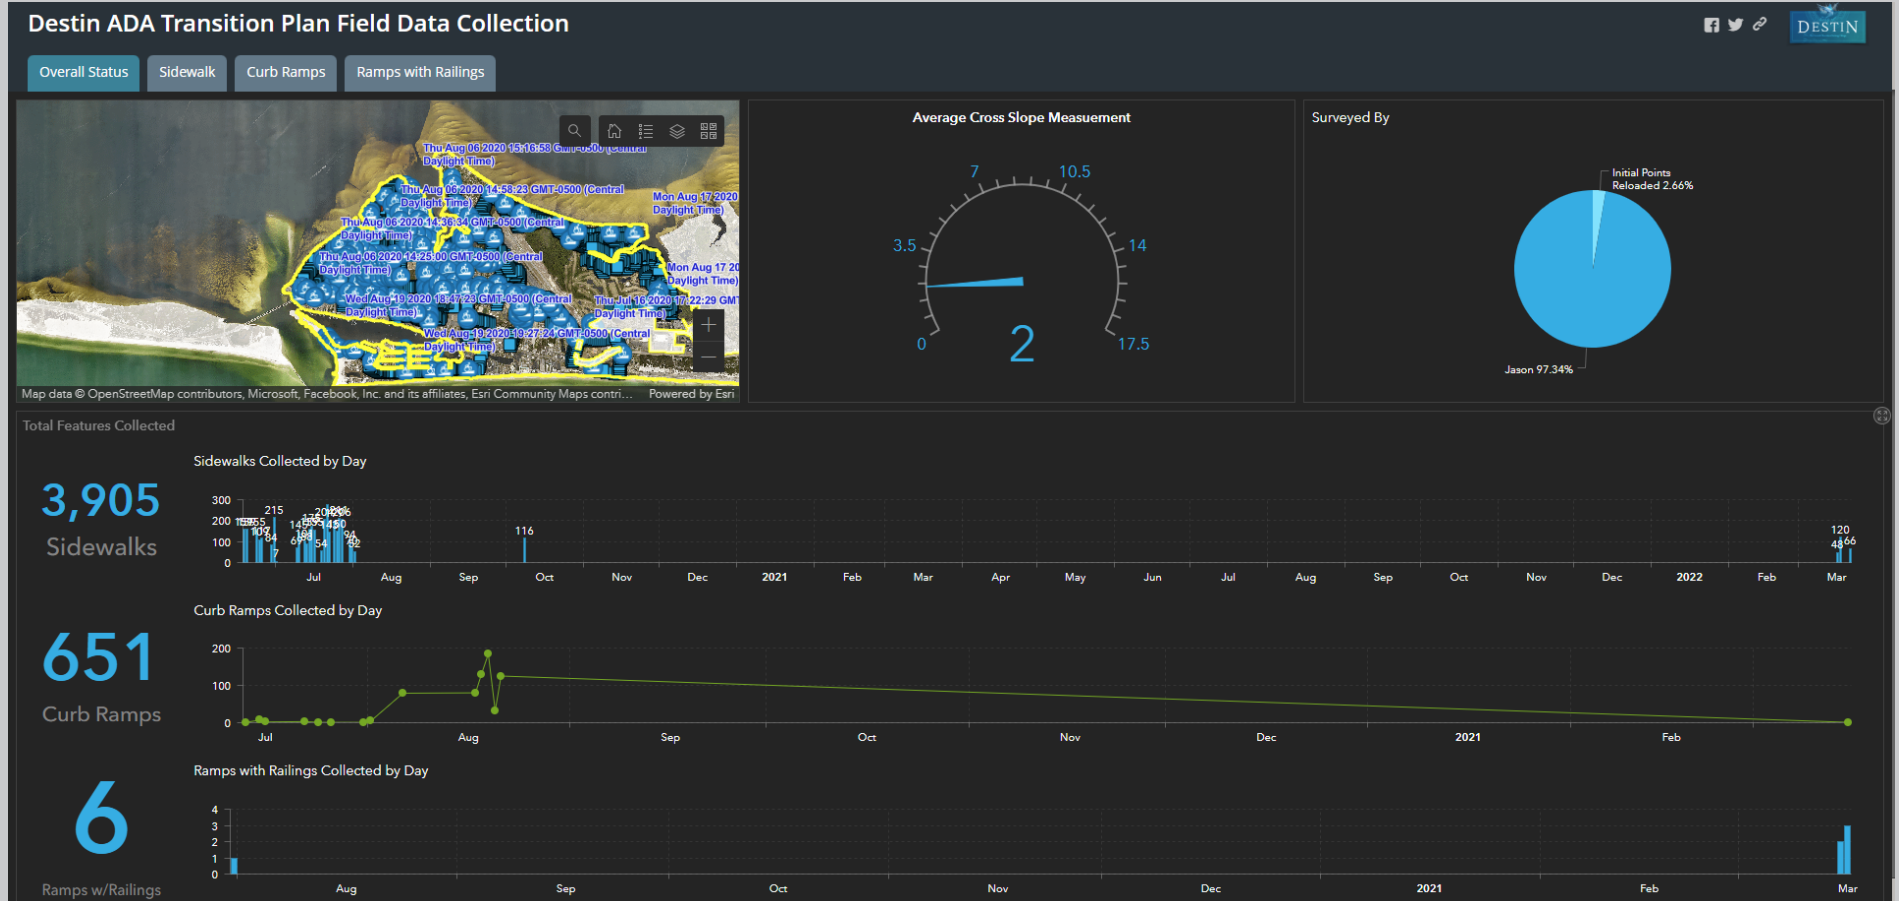

Transition Plan Phase I

Destin ADA Transition Plan Field Data Collection

Overall Status

Sidewalk

Curb Ramps

Ramps with Railings

Sidewalks

3,905

Total Points Collected

Last 50 Points Collected in Descending Order

10/8/2020, 5:50 PM

jfrick_bdiol

Cross Slope Measurement at 100' Interval	1.80
Slope in the direction of travel at 100' interval	6.60
Measure ____ the abrupt change in elevation greater than 1/2".	0.50
Measurement the number of openings (gaps) greater than 1/2"	0.00
In any sidewalk area identify areas that have an obstructed walking width of less than 36"	
Are there any obstructed walking widths of 36" or less?	No
Notes on obstructions:	
Is the restricted width at least 24"?	
Notes on restricted width 24":	
Is the 32" minimum walked with obstruction(s) for a distance less than or equal to 24"?	
Notes on 32" minimum walked:	
Is the 32" restricted width section separated from another restricted width section by a distance of 48" or greater?	
Notes on separation:	
Is there a Curb Ramp?	No
Slope measurement in the direction of travel ____% on either side of curb ramps at the joint where the sidewalk ends and the curb ramp begins:	
X-Slope measurement ____% on either side of curb ramps at the joint where the sidewalk ends and the curb ramp begins:	
Priority Level	

Notes:

sidewalks_image_repeat: 5050




Last edited by jfrick_bdiol on 10/8/2020, 5:50 PM.



Map data © OpenStreetMap contributors, Microsoft, Facebook, Inc. and its affiliates, Esri Community Maps contributors, Map layer by Esri | Okaloosa County FL GIS

Powered by Esri

Transition Plan Phase II

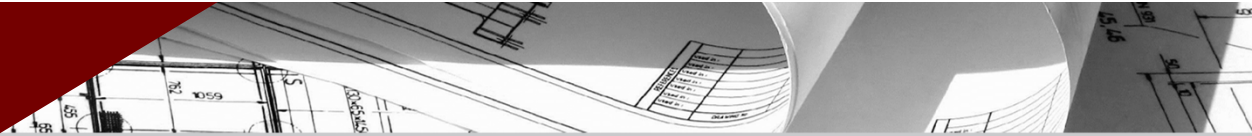Architectural blueprints showing various structural drawings and tables, partially visible on the right side of the slide.


- **Phase II Problems, Priorities, Solutions and Plan Development**
 - ☐ Identified Deficiencies
 - ☐ Priority Locations
 - ☐ **Public Workshop (Today)**
 - ☐ Solutions
 - ☐ ADA Plan Development

Transition Plan Phase II

■ Identified Deficiencies

- | | |
|--|------------------------|
| ☐ Cross Slope | Maximums at 2.0% |
| ☐ Running Slope | Maximums 8.33% |
| ☐ Sides of Curb Ramp | Maximum of 10% |
| ☐ Openings/Gaps | Maximum of ½ Inch |
| ☐ Changes in Level | Maximum of ¼ Inch |
| ☐ Clear Width | Minimum of 36 Inches |
| ☐ Detectable Warning Device | Included at curb ramps |
| ☐ Detectable Warning Device | Not be Damaged |

Transition Plan Phase II

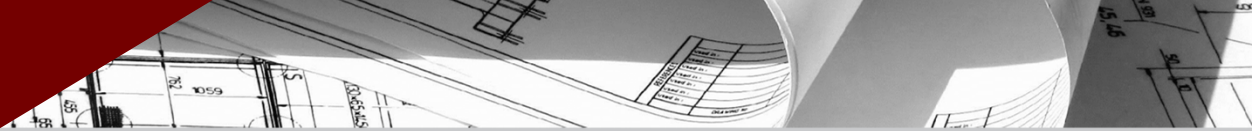

■ Priority Locations

- ☐ Priority 1A Collector Class Roadways and Intersections.
- ☐ Priority 1B Intersections and Roadway Sections serving Local Government Buildings.
- ☐ Priority 1C Intersections and Roadways Serving Public Transportation Access.


Transition Plan Phase II

Architectural blueprints showing various technical drawings, including a table with columns for 'Item No.', 'Description', 'Quantity', and 'Unit'. The table contains several rows of data, including items like '1.000' through '1.005'.

- **Priority Locations**


- ☐ Priority 2A Parks, Beach Parks, and Beach Trails.
- ☐ Priority 2B Boat Launches.
- ☐ Priority 3A all other areas not included in 1 and 2.

Goals and Objectives

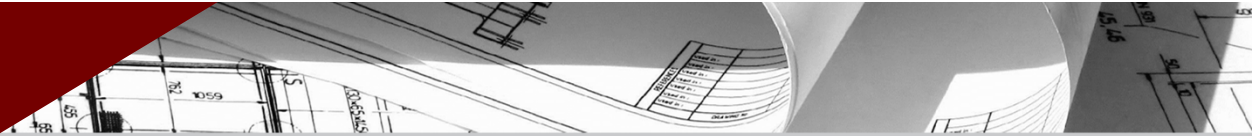Architectural blueprints showing various structural drawings and tables, partially visible on the right side of the slide.

- **Introduce ADA Coordinator.**
- **Present Draft Grievance Process.**
- **Short-term and Long-term Goals.**
- **Prioritization of Improvements.**
- **Establish Budgets and Timelines.**

Accessibility Improvements

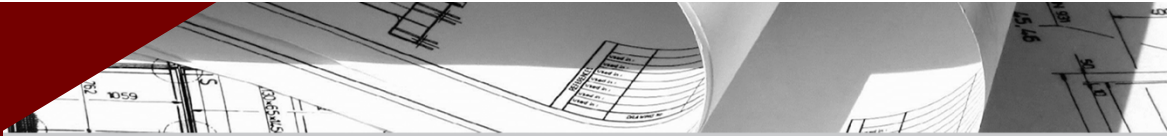An architectural drawing of a building with a ramp, showing structural details and dimensions. The drawing is partially visible on the right side of the slide, overlapping the red header bar.

- Repairs/Updates to Sidewalks.
- Repairs/Updates to Curb Ramps.
- Repairs/Updates to ramps with railing.
- Updates to Pedestrian Crossings.

Community Outreach

Architectural blueprints are visible in the top right corner of the slide, showing various lines, dimensions, and technical drawings.


- **Public Engagement Through the ADA Coordinator.**
- **Public Input and Feedback Through the Grievance Process.**
- **Partnering with local Interested Organizations to Improve Accessibility Within the City.**

Implementation

Architectural blueprints or technical drawings are visible in the top right corner of the slide, partially overlapping the red header bar. The drawings show various lines, dimensions, and tables, typical of engineering or architectural plans.

- **Develop Implementation Plan.**
 - ☐ Prioritize Repairs by Locations of Highest Use.
- **Monitoring Progress.**
 - ☐ Utilize the Dashboard to Track Progress.
- **Evaluation of Effectiveness.**
 - ☐ Utilizing Public Input from the ADA Coordinator.
- **Updates to the Program as the City Develops.**

Closing Summary

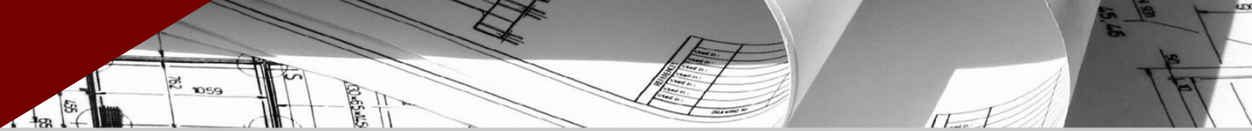Architectural blueprints or technical drawings are visible in the top right corner of the slide, partially overlapping the red header bar. The drawings show various lines, dimensions, and tables, typical of engineering or architectural plans.

- **Recap of Goals and Objectives**

- ☐ Importance of Accessibility.
- ☐ Evaluation of Effectiveness.
- ☐ Commitment of City to Ensure Welcoming and Inclusive Community.

Baskerville-Donovan, Inc.



ADA Transition Plan Phase II

Sign-In Sheet

[illegible]



Appendix D

Approved Concrete Pricing

DRAFT

S.H. Hayes Enterprises

1776 Tranquil Court
Chipley, FL 32428
(850) 326-5471
ShannonH@SHHayesEnterprises.com

March 02, 2023

City of Destin
4100 Indian Bayou Trail
Destin, FL 32541

To Whom It May Concern,

As many of you may know, during the last two years the price of lumber, concrete, rebar, diesel fuel, and every other construction material has soared in price. Due to the epidemic of Coronavirus, we have made little to no profit from our work with the City of Destin performing miscellaneous concrete projects because of these soaring prices. These are some examples of the inflation in our current economy.

- **FDOT Regulation 4000 PSI Concrete - Exhibit A**
 - September 23, 2021 - \$135/Cubic Yard
 - February 15, 2023 - \$175/Cubic Yard
 - **\$40/Cubic Yard Price Increase (30%)**

- **Concrete Fiber - Exhibit B**
 - November 11, 2021 - \$7.50/Cubic Yard
 - February 15, 2023 - 10.50/Cubic Yard
 - **\$3/ Cubic Yard Price Increase (40%)**

- **USA Average Diesel Fuel - Exhibit C**
 - September 23, 2021 - \$3.38/Gallon
 - February 13, 2023 - 4.44/Gallon
 - **\$1.05/Gallon Price Increase (31%)**

These economic price increases are affecting S.H. Hayes as a business, as well as affecting our concrete suppliers.

Today, we are asking to amend our contract prices to better serve you, and the citizens of Destin, FL. A revised price sheet is attached to this letter.

When reviewing our revised prices, please take into consideration that our prices are based on what we as a business have to profit in order to pay our vendors as well as pay our employees.

We would be more than happy to explain our prices, answer any questions, or discuss price changes.

Best regards,

James "Dylan" Wright

dylanw@shhayesenterprises.com

(850) 814-3866

Project Manager, S.H. Hayes Enterprises

RBM CONTRACTING
SERVICES-LLC

118 Industrial Park Rd
Freeport, FL 32439
Office: 850-622-1434

Invoice

Date	11/11/2021
Invoice #	807
Terms	Due on receipt

PAST DUE

Bill To
S H Hayes 707 W 8th St Lynn Haven, FL 32444

Ship To
862 US Hwy 98 Destin, FL

P.O. No.	
----------	--

Description	Qty	Rate	Amount
Ticket # 24591-Pour Date 11/10/21			
Concrete Sales-4000 PSI W/89 Stone	4.85	135.00	654.75T
Fuel Surcharge	1	40.00	40.00
Fiber	4.85	7.50	36.38T

Exhibit A**Exhibit B**

RBM Concrete Services appreciates your patronage.
Florida CGC# 1518187 - WOSB & FDOT Certified
www.rbmcontracting.com

Subtotal \$731.13**Sales Tax (6.5%)** \$44.93**Total** \$776.06**Payments/Credits** \$0.00**Balance Due** \$776.06

RBM CONTRACTING SERVICES-LLC

Quote

Date: 2/15/2023

Bill To:

Job Site Address:

Item Code	Description	Price Each	Quantity	Amount
Concrete Sales	3000 psi concrete	165.00	1	165
Concrete Sales	3500 psi concrete	170.00	1	170
Concrete Sales	4000 psi concrete	175.00	1	175
Concrete Sales	4500 psi concrete	180.00	1	180
Concrete Sales	5000 psi concrete	185.00	1	185
	Fiber per yard	10.50	1	10.5
	Surcharge per truck	40.00	1	40
	1% calcium	10.50	1	10.50
	2% calcium	21.00	1	21.00
	Over hour fee \$25/ 15 minutes over first hour	25.00	1	25
	*** 4 YDS Minimum ***			
Total				\$982.00

Search



DATA

TOOLS

SUPPORT

PLANS



b 27 2023

unsaved)

EXPORT

Annotate



CHART OPTIONS



1D

5D

1M

3M

6M

YTD

1Y

3Y

5Y

10Y

MAX

DATE RANGE

09/20/2021

10/20/2021

ADD

US Retail Diesel Price (I:USRDP)

Sep 20 '21

3.385

Exhibit C

ADD

BROWSE

LIST

+ CREATE

SEP 20

SEP 27

OCT 4

OCT 11

Search



DATA

TOOLS

SUPPORT

PLANS



27 2023

unsaved)

EXPORT

Annotate



CHART OPTIONS



PI

ADD

1D

5D

1M

3M

6M

YTD

1Y

3Y

5Y

10Y

MAX

DATE RANGE

09/20/2021

02/20/2023

US Retail Diesel Price (I:USRDP)

Feb 13 '23

4.444

Exhibit C

ADD

BROWSE

LIST

+ CREATE

JAN '22

MAY '22

SEP '22

13

Item	Unit	Previous Unit Price	New Unit Price
Concrete Driveway, 6 Inches Thick*	Square Foot	\$8.95	\$11.99
Concrete Sidewalk, 4 Inches Thick*	Square Foot	\$6.25	\$8.37
Concrete Flat/Ribbon Curb (12" Wide by 8" Deep)*	Linear Foot	\$18.00	\$24.12
Concrete Type "D" Curb*	Linear Foot	\$18.00	\$24.12
Concrete "E" Curb & Gutter*	Linear Foot	\$24.00	\$32.16
Concrete Type "F" Curb & Gutter*	Linear Foot	\$30.00	\$40.20
Concrete Modified (18") Type "F" Curb & Gutter*	Linear Foot	\$30.00	\$40.20
Fill Dirt Provided, Delivered, Spread, and Compacted	Cubic Yard	\$24.00	\$31.44
FDOT Qualified Traffic Control (MOT) Cost	Per Day	\$200.00	\$250.00
Bermuda Sod Installed	Square Foot	\$0.87	\$0.87
St. Augustine Sod Installed	Square Foot	\$0.97	\$0.97
Centipede Sod Installed	Square Foot	\$0.86	\$0.86
Removal of Concrete 4 Inches Thick	Square Foot	\$2.00	\$2.62
Removal of Concrete 6 Inches Thick	Square Foot	\$3.00	\$3.93
Removal of Asphalt (Up to 4 Inches Thick)	Square Foot	\$2.00	\$2.62

Clear & Grub	Square Foot	\$2.50	\$3.27
Debris Hauling	Cubic Yard	\$40.00	\$52.40
Silt Fence	Linear Foot	\$4.25	\$4.25
Asphalt Cut with Abrasive Blade	Linear Foot	\$4.50	\$5.89
Concrete Cut with Abrasive Blade	Linear Foot	\$5.50	\$7.20

Tree Trimming	Per Hour	\$100.00	\$131.00
Aluminum Pipe Guiderail (FDOT Index 870)	Linear Foot	\$140.00	\$183.40
Irrigation Repair	Per Hour	\$60.00	\$60.00
Manhole Adjustments	One Ring & Lid	\$475.00	\$475.00
Asphalt Patching (Hot Mix)	Square Foot x 2" Thick	\$34.50	\$34.50
Excavation	Square Foot	\$2.50	\$2.50
Curb Removal	Square Foot	\$6.50	\$6.50

*All Concrete Installations shall be fiber-reinforced 4000psi.

Unit Cost



Priority 1 Total

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	489	125	\$ 12.09	\$ 739,001.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	27	125	\$ 12.09	\$ 40,803.75
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	175	50	\$ 12.09	\$ 105,787.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	338	50	\$ 12.09	\$ 204,321.00
	Clear Width	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Damaged Concrete	SF Remove and Replace Concrete	87	125	\$ 12.09	\$ 131,478.75
Subtotal						\$ 1,221,996.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	79	25	\$ 12.09	\$ 23,877.75
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	7	28	\$ 12.09	\$ 2,369.64
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	10	28	\$ 12.09	\$ 3,385.20
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	91	25	\$ 12.09	\$ 27,504.75
	Missing or Damaged detectable warning device	Remove and replace detectable warning device	156	1	\$ 519.80	\$ 81,088.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	11	1	\$ 634.80	\$ 6,982.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	7	1	\$ 3,596.00	\$ 25,172.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	25	1	\$ 3,596.00	\$ 89,900.00
	Damaged concrete	Remove and replace Curb Ramp	33	1	\$ 3,596.00	\$ 118,668.00
Subtotal						\$ 378,948.94
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	2	150	\$ 12.09	\$ 3,627.00
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	8	30	\$ 185.20	\$ 44,447.04
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	4	85	\$ 12.09	\$ 4,110.60
Subtotal						\$ 52,184.64
Grand Total						\$1,653,130.33

Priority 2 Totals

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	79	125	\$ 12.09	\$ 119,388.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	5	125	\$ 12.09	\$ 7,556.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	23	50	\$ 12.09	\$ 13,903.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	39	50	\$ 12.09	\$ 23,575.50
	Clear Width	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged Concrete	SF Remove and Replace Concrete	14	125	\$ 12.09	\$ 21,157.50
Subtotal						\$ 185,883.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	12	25	\$ 12.09	\$ 3,627.00
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	2	28	\$ 12.09	\$ 677.04
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	15	25	\$ 12.09	\$ 4,533.75
	Damaged or missing detectable warning device	Remove and replace detectable warning device	58	1	\$ 519.80	\$ 30,148.40
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	2	1	\$ 634.80	\$ 1,269.60
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	3	1	\$ 3,596.00	\$ 10,788.00
	Damaged concrete	Remove and replace Curb Ramp	6	1	\$ 3,596.00	\$ 21,576.00
Subtotal						\$ 76,215.79
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 262,099.54

Priority 3 Totals

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	807	125	\$ 12.09	\$ 1,219,578.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	18	125	\$ 12.09	\$ 27,202.50
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	164	50	\$ 12.09	\$ 99,138.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	517	50	\$ 12.09	\$ 312,526.50
	Clear Width	SF Remove and Replace Concrete	5	25	\$ 12.09	\$ 1,511.25
	Damaged Concrete	SF Remove and Replace Concrete	76	125	\$ 12.09	\$ 114,855.00
Subtotal						\$ 1,774,812.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	14	25	\$ 12.09	\$ 4,231.50
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	187	1	\$ 519.80	\$ 97,202.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
	Damaged concrete	Remove and replace Curb Ramp	69	1	\$ 3,596.00	\$ 248,124.00
Subtotal						\$ 356,750.10
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 2,131,562.10

Total All Locations

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1,375	125	\$ 12.09	\$ 2,077,968.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	50	125	\$ 12.09	\$ 75,562.50
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	362	50	\$ 12.09	\$ 218,829.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	894	50	\$ 12.09	\$ 540,423.00
	Clear Width	SF Remove and Replace Concrete	8	25	\$ 12.09	\$ 2,418.00
	Damaged Concrete	SF Remove and Replace Concrete	177	125	\$ 12.09	\$ 267,491.25
Subtotal						\$ 3,182,692.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	105	25	\$ 12.09	\$ 31,736.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	9	28	\$ 12.09	\$ 3,046.68
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	10	28	\$ 12.09	\$ 3,385.20
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	106	25	\$ 12.09	\$ 32,038.50
	Damaged detectable warning device	Remove and replace detectable warning device	401	1	\$ 519.80	\$ 208,439.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	13	1	\$ 634.80	\$ 8,252.40
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	8	1	\$ 3,596.00	\$ 28,768.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	30	1	\$ 3,596.00	\$ 107,880.00
	Damaged concrete	Remove and replace Curb Ramp	108	1	\$ 3,596.00	\$ 388,368.00
Subtotal						\$ 811,914.83
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ 4,110.60
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	2	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	8	30	\$ 185.20	\$ 44,447.04
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	4	85	\$ 12.09	\$ 4,110.60
Subtotal						\$ 52,184.64
Grand Total						\$ 4,046,791.97

1A-100. Stahlman Avenue

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	26	125	\$ 12.09	\$ 39,292.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	11	50	\$ 12.09	\$ 6,649.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	31	50	\$ 12.09	\$ 18,739.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
Subtotal						\$ 70,726.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	3	28	\$ 12.09	\$ 1,015.56
	Missing or Damaged Detectable Warning Device	Remove and replace detectable warning device	1	1	\$ 519.80	\$ 519.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
Subtotal						\$ 5,131.36
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 75,857.86

1A-101. Benning Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	35	125	\$ 12.09	\$ 52,893.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	23	50	\$ 12.09	\$ 13,903.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	36	50	\$ 12.09	\$ 21,762.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
Subtotal						\$ 91,581.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	7	25	\$ 12.09	\$ 2,115.75
	Damaged detectable warning device	Remove and replace detectable warning device	12	1	\$ 519.80	\$ 6,237.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
Subtotal						\$ 16,186.12
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 107,767.87

1A-102. Beach Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	58	125	\$ 12.09	\$ 87,652.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	4	50	\$ 12.09	\$ 2,418.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	24	50	\$ 12.09	\$ 14,508.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 107,601.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	44	25	\$ 12.09	\$ 13,299.00
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	5	25	\$ 12.09	\$ 1,511.25
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	13	1	\$ 3,596.00	\$ 46,748.00
	Damaged concrete	Remove and replace Curb Ramp	5	1	\$ 3,596.00	\$ 17,980.00
Subtotal						\$ 80,916.37
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 188,517.37

1A-103. Main Street

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	31	125	\$ 12.09	\$ 46,848.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	5	125	\$ 12.09	\$ 7,556.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	9	50	\$ 12.09	\$ 5,440.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	12	50	\$ 12.09	\$ 7,254.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	14	125	\$ 12.09	\$ 21,157.50
Subtotal						\$ 88,257.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	4	28	\$ 12.09	\$ 1,354.08
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	3	25	\$ 12.09	\$ 906.75
	Damaged detectable warning device	Remove and replace detectable warning device	6	1	\$ 519.80	\$ 3,118.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	2	1	\$ 634.80	\$ 1,269.60
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	3	1	\$ 3,596.00	\$ 10,788.00
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 18,041.73
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 106,298.73

1A-104. Gulf Shore Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	7	125	\$ 12.09	\$ 10,578.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	4	50	\$ 12.09	\$ 2,418.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	4	50	\$ 12.09	\$ 2,418.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 15,414.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	8	1	\$ 519.80	\$ 4,158.40
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	3	1	\$ 3,596.00	\$ 10,788.00
Subtotal						\$ 15,581.20
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 30,995.95

1A-105. Matthew Boulevard

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	4	125	\$ 12.09	\$ 6,045.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 6,045.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	3	25	\$ 12.09	\$ 906.75
	Damaged detectable warning device	Remove and replace detectable warning device	6	1	\$ 519.80	\$ 3,118.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
Subtotal						\$ 11,858.32
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 17,903.32

1A-106. Hutchinson Street

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	7	125	\$ 12.09	\$ 10,578.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 13,299.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 640.77
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 13,939.77

1A-107. Kelly Street

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	31	125	\$ 12.09	\$ 46,848.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	8	50	\$ 12.09	\$ 4,836.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	17	50	\$ 12.09	\$ 10,276.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
Subtotal						\$ 66,495.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	5	25	\$ 12.09	\$ 1,511.25
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 2,550.85
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 69,045.85

1A-108. Azalea Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	8	125	\$ 12.09	\$ 12,090.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	4	50	\$ 12.09	\$ 2,418.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	6	50	\$ 12.09	\$ 3,627.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 19,646.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	3	25	\$ 12.09	\$ 906.75
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
Subtotal						\$ 9,138.35
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 28,784.60

1A-110. Legion Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	6	125	\$ 12.09	\$ 9,067.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	11	50	\$ 12.09	\$ 6,649.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 18,437.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	3	25	\$ 12.09	\$ 906.75
	Damaged detectable warning device	Remove and replace detectable warning device	4	1	\$ 519.80	\$ 2,079.20
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
Subtotal						\$ 11,151.27
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 29,588.52

1A-111. Airport Road

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	25	125	\$ 12.09	\$ 37,781.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	6	50	\$ 12.09	\$ 3,627.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	12	50	\$ 12.09	\$ 7,254.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	10	125	\$ 12.09	\$ 15,112.50
Subtotal						\$ 63,774.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	9	25	\$ 12.09	\$ 2,720.25
	Damaged detectable warning device	Remove and replace detectable warning device	16	1	\$ 519.80	\$ 8,316.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Damaged concrete	Remove and replace Curb Ramp	4	1	\$ 3,596.00	\$ 14,384.00
Subtotal						\$ 33,217.55
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 96,992.30

1A-112. Commons Boulevard

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 4,231.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 338.52
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 4,570.02

1A-113. Scenic Highway 98 East

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	28	125	\$ 12.09	\$ 42,315.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	7	50	\$ 12.09	\$ 4,231.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	13	50	\$ 12.09	\$ 7,858.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	8	125	\$ 12.09	\$ 12,090.00
Subtotal						\$ 69,517.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	13	25	\$ 12.09	\$ 3,929.25
	Damaged detectable warning device	Remove and replace detectable warning device	16	1	\$ 519.80	\$ 8,316.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Damaged concrete	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
Subtotal						\$ 27,869.35
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 97,386.85

1A-114. Calhoun Avenue

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	40	125	\$ 12.09	\$ 60,450.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	3	125	\$ 12.09	\$ 4,533.75
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	27	50	\$ 12.09	\$ 16,321.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	41	50	\$ 12.09	\$ 24,784.50
	Clear Width	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged Concrete	SF Remove and Replace Concrete	5	125	\$ 12.09	\$ 7,556.25
Subtotal						\$ 113,948.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	15	25	\$ 12.09	\$ 4,533.75
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	15	1	\$ 519.80	\$ 7,797.00
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Damaged concrete	Remove and replace Curb Ramp	4	1	\$ 3,596.00	\$ 14,384.00
Subtotal						\$ 37,502.75
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 151,451.00

1A-115. Sibert Avenue

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	8	125	\$ 12.09	\$ 12,090.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	19	50	\$ 12.09	\$ 11,485.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	43	50	\$ 12.09	\$ 25,993.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	4	125	\$ 12.09	\$ 6,045.00
Subtotal						\$ 55,614.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	3	25	\$ 12.09	\$ 906.75
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	6	25	\$ 12.09	\$ 1,813.50
	Damaged detectable warning device	Remove and replace detectable warning device	16	1	\$ 519.80	\$ 8,316.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 11,375.57
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 66,989.57

1A-116. Cross Street

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	6	125	\$ 12.09	\$ 9,067.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	7	50	\$ 12.09	\$ 4,231.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 16,019.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	3	25	\$ 12.09	\$ 906.75
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
Subtotal						\$ 5,542.35
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 21,561.60

1A-118. Mountain Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	21	125	\$ 12.09	\$ 31,736.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	4	125	\$ 12.09	\$ 6,045.00
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	10	50	\$ 12.09	\$ 6,045.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	5	125	\$ 12.09	\$ 7,556.25
Subtotal						\$ 52,591.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	10	25	\$ 12.09	\$ 3,022.50
	Damaged detectable warning device	Remove and replace detectable warning device	4	1	\$ 519.80	\$ 2,079.20
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 5,101.70
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 57,693.20

1A-119. Gulf Shore Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	34	125	\$ 12.09	\$ 51,382.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	3	125	\$ 12.09	\$ 4,533.75
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	13	50	\$ 12.09	\$ 7,858.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	11	50	\$ 12.09	\$ 6,649.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	11	125	\$ 12.09	\$ 16,623.75
Subtotal						\$ 87,048.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Damaged detectable warning device	Remove and replace detectable warning device	4	1	\$ 519.80	\$ 2,079.20
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
Subtotal						\$ 14,076.20
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 101,124.20

1A-120 Legion Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	8	125	\$ 12.09	\$ 12,090.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	3	50	\$ 12.09	\$ 1,813.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	3	50	\$ 12.09	\$ 1,813.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	3	125	\$ 12.09	\$ 4,533.75
Subtotal						\$ 20,250.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 20,250.75

1A-122. Indian Trail Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	32	125	\$ 12.09	\$ 48,360.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	7	50	\$ 12.09	\$ 4,231.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	15	50	\$ 12.09	\$ 9,067.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	4	125	\$ 12.09	\$ 6,045.00
Subtotal						\$ 69,215.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Damaged detectable warning device	Remove and replace detectable warning device	10	1	\$ 519.80	\$ 5,198.00
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 6,775.82
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 75,991.07

1A-123. 98 Palms Boulevard

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 1,209.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 1,209.00

1A-124. Mattie M. Kelly Bouleva

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	1	1	\$ 519.80	\$ 519.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,154.60
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 1,154.60

1A-126. Indian Bayou Trail

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 1,511.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,239.30
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 2,750.55

1A-127. Restaurant Row

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	4	125	\$ 12.09	\$ 6,045.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 7,858.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	28	\$ 12.09	\$ 677.04
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,281.54
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 9,140.04

1A-128. Scenic Highway 98 West

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 2,418.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	28	\$ 12.09	\$ 677.04
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 677.04
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 3,095.04

1A-130. Crystal Beach Drive

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	15	125	\$ 12.09	\$ 22,668.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	11	50	\$ 12.09	\$ 6,649.50
	Clear Width	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 30,225.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	6	25	\$ 12.09	\$ 1,813.50
	Damaged detectable warning device	Remove and replace detectable warning device	13	1	\$ 519.80	\$ 6,757.40
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Damaged concrete	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
Subtotal						\$ 27,826.47
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 58,051.47

1A-131. Dolphin Street

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	4	1	\$ 519.80	\$ 2,079.20
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 2,381.45
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 2,381.45

1B-132. Destin Library

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 4,836.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 4,836.00

1B-133. Community Center

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 1,511.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,039.60
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	8	30	\$ 185.20	\$ 44,447.04
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	4	85	\$ 12.09	\$ 4,110.60
Subtotal						\$ 48,557.64
Grand Total						\$ 51,108.49

1B-134. Destin Fishing Museum

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	3	50	\$ 12.09	\$ 1,813.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 5,440.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 3,898.25
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 9,338.75

1B-135. Destin City Annex

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ -

1B-136. Destin Maint. Facility

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 2,720.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 2,720.25

1B-137. Lifeguard Station

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 634.80
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 634.80

1B-138. Emergency Vehicles

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ -

1B-139. City Hall Entrance

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ -

1C-140. 98 Palms Plaza

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	10	125	\$ 12.09	\$ 15,112.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	5	50	\$ 12.09	\$ 3,022.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	3	125	\$ 12.09	\$ 4,533.75
Subtotal						\$ 23,273.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 3,898.25
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 27,171.50

1C-141. Crystal Beach Plaza

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 3,324.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 3,324.75

1C-142. Holiday In Express

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ -

1C-143. Destin Downtown Shoppin

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	5	125	\$ 12.09	\$ 7,556.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	3	50	\$ 12.09	\$ 1,813.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
Subtotal						\$ 14,508.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 14,508.00

1C-145. Sandpoper Cove North

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	5	125	\$ 12.09	\$ 7,556.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 8,160.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 4,200.50
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 12,361.25

1C-146. Gulf Shores Dr.

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ -

1C-147. Waterview Towers

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
Subtotal						\$ 8,231.60
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 8,231.60

1C-148. East Pass Towers

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 3,022.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	1	1	\$ 519.80	\$ 519.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 822.05
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 3,844.55

1C-149. Gulf Breeze Ct.

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,976.65
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 1,976.65

1C-150. Destin Pointe Jetty Ea

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 1,511.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 1,511.25

1C-151. Holiday Surf & Racquet

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	4	125	\$ 12.09	\$ 6,045.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 8,160.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 8,160.75

1C-152. Destin on the Gulf

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	7	125	\$ 12.09	\$ 10,578.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 10,578.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 10,578.75

1C-154. Benning Dr. & Harbor B

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	4	50	\$ 12.09	\$ 2,418.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 8,160.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	1	1	\$ 519.80	\$ 519.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$3,596.00	\$ -
Subtotal						\$ 822.05
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 8,982.80

1C-169. Windgate by Windham

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	3	50	\$ 12.09	\$ 1,813.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 6,951.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 6,951.75

1C-172. The Inn at Crystal Bea

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	3	125	\$ 12.09	\$ 4,533.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
Subtotal						\$ 9,974.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
Subtotal						\$ 4,937.85
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 14,912.10

1C-173. Crystal Sands

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	6	125	\$ 12.09	\$ 9,067.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 11,787.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,039.60
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 12,827.35

1C-174. James Lee Park

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 1,511.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 1,511.25

1C-177. Hampton Inn

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 3,627.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 3,627.00

1C-178. Back Porch Restaurant

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ -

2A-200. Captain Leonard Destin

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	4	125	\$ 12.09	\$ 6,045.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	3	50	\$ 12.09	\$ 1,813.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	8	50	\$ 12.09	\$ 4,836.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 12,694.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,644.10
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 14,338.60

2A-201. clement Taylor Park

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 3,627.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 3,627.00

2A-205. Nancy Weidenhammer par

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
Subtotal						\$ 5,742.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 5,742.75

2A-206. Morgan Sports Complex

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	12	125	\$ 12.09	\$ 18,135.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
Subtotal						\$ 22,366.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 22,366.50

2A-207. Buck Destin Park

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 4,533.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	1	1	\$ 519.80	\$ 519.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 519.80
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 5,053.55

2A-208. Dalton Threadgill Park

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	7	125	\$ 12.09	\$ 10,578.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	8	50	\$ 12.09	\$ 4,836.00
	Clear Width	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 17,832.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	1	1	\$ 519.80	\$ 519.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 822.05
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 18,654.80

2A-210. Kell-Aire Nature Walk

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 4,836.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Damaged detectable warning device	Remove and replace detectable warning device	3	1	\$ 519.80	\$ 1,559.40
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	2	1	\$ 3,596.00	\$ 7,192.00
Subtotal						\$ 13,888.95
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 18,724.95

2A-211. Main Street Park

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	10	125	\$ 12.09	\$ 15,112.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	6	50	\$ 12.09	\$ 3,627.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	6	50	\$ 12.09	\$ 3,627.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	5	125	\$ 12.09	\$ 7,556.25
Subtotal						\$ 31,434.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	3	1	\$ 519.80	\$ 1,559.40
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,559.40
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 32,993.40

2A-212. Mattie Kelly Park

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	4	125	\$ 12.09	\$ 6,045.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	4	50	\$ 12.09	\$ 2,418.00
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	8	50	\$ 12.09	\$ 4,836.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 13,299.00
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	5	25	\$ 12.09	\$ 1,511.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	5	1	\$ 519.80	\$ 2,599.00
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	3	1	\$ 3,596.00	\$ 10,788.00
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 14,898.25
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 28,197.25

2A-213. June White Decker Park

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 3,022.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 3,022.50

2A-214. Norriego Point Beach A

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	1	1	\$ 519.80	\$ 519.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 519.80
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 519.80

2A-215. The Shore at Crystal Be

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 2,720.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	4	1	\$ 519.80	\$ 2,079.20
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 2,417.72
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 5,137.97

2A-218. O'Steen Beach Trail

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ -
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	1	1	\$ 519.80	\$ 519.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 519.80
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 519.80

2A-219. Calhoun Beach Trail

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 1,511.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 1,511.25

2A-220. Shirah St. Beach Trail

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	8	125	\$ 12.09	\$ 12,090.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 14,205.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	2	25	\$ 12.09	\$ 604.50
	Damaged detectable warning device	Remove and replace detectable warning device	5	1	\$ 519.80	\$ 2,599.00
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
Subtotal						\$ 6,799.50
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 21,005.25

2A-221. Crystal Beach Trail Acc

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 1,511.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	2	1	\$ 519.80	\$ 1,039.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 1,341.85
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 2,853.10

2A-222. Barracuda St. Trail

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	6	125	\$ 12.09	\$ 9,067.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 11,787.75
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	4	25	\$ 12.09	\$ 1,209.00
	Damaged detectable warning device	Remove and replace detectable warning device	7	1	\$ 519.80	\$ 3,638.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
						\$ 8,443.60
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 20,231.35

2A-223. Pompano St. Beach Trail

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	5	125	\$ 12.09	\$ 7,556.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 8,765.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	1	28	\$ 12.09	\$ 338.52
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	3	25	\$ 12.09	\$ 906.75
	Damaged detectable warning device	Remove and replace detectable warning device	7	1	\$ 519.80	\$ 3,638.60
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
Subtotal						\$ 8,782.12
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 17,547.37

2A-224. Tarpon St. Beach Trail

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	2	125	\$ 12.09	\$ 3,022.50
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 3,022.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	1	25	\$ 12.09	\$ 302.25
	Damaged detectable warning device	Remove and replace detectable warning device	6	1	\$ 519.80	\$ 3,118.80
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	1	1	\$ 3,596.00	\$ 3,596.00
Subtotal						\$ 7,319.30
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 10,341.80

2A-225. Silver Shells Trail

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
Subtotal						\$ 1,511.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 1,511.25

2A-228 Kell Aire Park

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	8	125	\$ 12.09	\$ 12,090.00
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	0	50	\$ 12.09	\$ -
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 13,601.25
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	3	25	\$ 12.09	\$ 906.75
	Damaged detectable warning device	Remove and replace detectable warning device	10	1	\$ 519.80	\$ 5,198.00
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	1	1	\$ 634.80	\$ 634.80
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ 6,739.55
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 20,340.80

2B-227 Joes Bayou Boat Launch

Sidewalks	Observed Deficiency	Corrective Action	Qty Identified	Est. Repair Qty.	Unit Cost	Total
	Cross Slope deviations greater than 2.00%	SF Remove and Replace Concrete	3	125	\$ 12.09	\$ 4,533.75
	Running slope deviations greater than 5.0%	SF Remove and Replace Concrete	0	125	\$ 12.09	\$ -
	Openings/Gaps greater than ½"	SF Remove and Replace Concrete	1	50	\$ 12.09	\$ 604.50
	Abrupt changes in level greater than ¼"	SF Remove and Replace Concrete	2	50	\$ 12.09	\$ 1,209.00
	Clear Width	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged Concrete	SF Remove and Replace Concrete	1	125	\$ 12.09	\$ 1,511.25
Subtotal						\$ 7,858.50
Curb Ramps						
	Landing Lengths less than 3 feet	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramps with slopes greater than 8.33%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Cross slope deviations greater than 2.00%	SF Remove and Replace Concrete	0	28	\$ 12.09	\$ -
	Landing slope deviations greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Damaged detectable warning device	Remove and replace detectable warning device	0	1	\$ 519.80	\$ -
	Abrupt changes in level greater than ¼"	Remove and replace Curb Ramp	0	1	\$ 634.80	\$ -
	Gaps or openings in the walking surface greater than ½"	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Ramp Widths less than 3 feet	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
	Damaged concrete	Remove and replace Curb Ramp	0	1	\$ 3,596.00	\$ -
Subtotal						\$ -
Ramps with Handrails						
	Ramp lengths over 30'	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp running slopes greater than 8.33%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp cross slopes greater than 2.0%	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp clear width less than 36"	SF Remove and Replace Concrete	0	150	\$ 12.09	\$ -
	Ramp Landing slopes greater than 2.0% in any direction	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing lengths less than 60"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Ramp Landing clear width less than 36"	SF Remove and Replace Concrete	0	25	\$ 12.09	\$ -
	Handrails provided on only one side	LF handrail install	0	30	\$ 185.20	\$ -
	Handrails that are not continuous	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail gripping surface below 34" or less than 38"	LF handrail install	0	30	\$ 185.20	\$ -
	Handrail extensions extending less than 12" horizontally above the landing.	LF handrail install	0	30	\$ 185.20	\$ -
	Damaged concrete	SF Remove and Replace Concrete	0	85	\$ 12.09	\$ -
Subtotal						\$ -
Grand Total						\$ 7,858.50



City of Destin Public Works
4200 Indian Bayou Trail
Destin, FL, 32541

May 31, 2023
Michael Burgess
RE: ADA Transition Plan Phase II
JOB NO. 48201.02

☐ Shop Drawings ☐ Prints ☒ Plans ☐ Specifications

1

Public Works Update (May/Jun 2023)

Departmental Update

Vacancies:

- Maintenance Technician (vacant for over two years, advertised)
- Facilities Maintenance Technician (vacant over 6 months, advertised)

Operational Update

Recent & Upcoming Council Agenda Items

- Jun 5 – Regular City Council Meeting/Approved/Authorized
 - Resurfacing of Community Center & OCSD parking lots
 - Resurfacing/Restriping of Vintage Circle/Court
- Jun 20 – Regular City Council Meeting/Approved/Authorized
 - Voted for Lamar Advertising Presentation to be rerouted through committees.

Project Update

- US98 Median Improvements (SR293 to County Line) – **imminent**
- Resurfacing/Restriping of Vintage Circle/Court – **scheduling**
- H&T Main St speed hump installation – **complete**
- Tymco 600ss Street Sweeper purchase approved – **processing**
- 6 Pedestrian crosswalk light sets (12 total) – **ordered**
- New Dump Truck – Oct 2023

Emergency Management Update

Operational Update

- Updates to Disaster Preparedness Plan began in March of 2023
- Hurricane Season officially began 1 Jun